

STM32F101xC/D/E and STM32F103xC/D/E high-density device limitations

Silicon identification

This errata sheet applies to the revisions Z, Y, 1, 2, 3 and X of the STMicroelectronics STM32F101xC/D/E access line and STM32F103xC/D/E performance line high-density products. These families feature an Arm® 32-bit Cortex®-M3 core, for which an errata notice is also available (see [Section 1](#) for details).

The full list of part numbers is shown in [Table 2](#). The products are identifiable as shown in [Table 1](#):

- by the revision code marked below the order code on the device package
- by the last three digits of the internal order code printed on the box label

Table 1. Device Identification⁽¹⁾

Order code	Revision code ⁽²⁾ marked on device
STM32F103xC, STM32F103xD, STM32F103xE	"Z", "Y" or "1" or "2" or "3" or "X"
STM32F101xC, STM32F101xD, STM32F101xE	"Z", "Y" or "1" or "2" or "3" or "X"

1. The REV_ID bits in the DBGMCU_IDCODE register show the revision code of the device (see the STM32F10xxC/D/E reference manual for details on how to find the revision code).
2. Refer to [Appendix A: Revision code on device marking](#) for details on how to identify the Revision code on the different packages.

Table 2. Device summary

References		Part numbers
STM32F10xxC/D/E	STM32F101xC/D/E	STM32F101RC, STM32F101VC, STM32F101ZC STM32F101RD, STM32F101VD, STM32F101ZD STM32F101RE, STM32F101VE, STM32F101ZE
	STM32F103xC/D/E	STM32F103RC, STM32F103VC, STM32F103ZC STM32F103RD, STM32F103VD, STM32F103ZD STM32F103RE, STM32F103VE, STM32F103ZE

Contents

- 1 Arm® 32-bit Cortex®-M3 limitations 7**
- 1.1 Cortex-M3 limitations description for STM32F10xxC/D/E
 high-density devices 8
- 1.1.1 Cortex-M3 LDRD with base in list may result in incorrect base register
 when interrupted or faulted 8
- 1.1.2 Cortex-M3 event register is not set by interrupts and debug 8
- 1.1.3 Cortex-M3 BKPT in debug monitor mode can cause DFSR mismatch .. 8
- 1.1.4 Cortex-M3 may freeze for SLEEPONEXIT single instruction ISR 9
- 1.1.5 Interrupted loads to SP can cause erroneous behavior 9
- 1.1.6 SVC and BusFault/MemManage may occur out of order 10

- 2 STM32F10xxC/D/E silicon limitations 11**
- 2.1 Voltage glitch on ADC input 0 14
- 2.2 Flash memory read after WFI/WFE instruction 14
- 2.3 Debug registers cannot be read by user software 14
- 2.4 Debugging Stop mode and system tick timer 15
- 2.5 Debugging Stop mode with WFE entry 15
- 2.6 Wakeup sequence from Standby mode when using more
 than one wakeup source 15
- 2.7 LSE start-up in harsh environments 16
- 2.8 RDP protection 16
- 2.9 Alternate functions 18
- 2.9.1 USART1_RTS and CAN_TX 18
- 2.9.2 SPI1 in slave mode and USART2 in synchronous mode 18
- 2.9.3 SPI1 in master mode and USART2 in synchronous mode 18
- 2.9.4 SPI2 in slave mode and USART3 in synchronous mode 19
- 2.9.5 SPI2 in master mode and USART3 in synchronous mode 19
- 2.9.6 SDIO with TIM8 19
- 2.9.7 SDIO and TIM3_REMAP 20
- 2.9.8 SDIO with USART3 remapped and UART4 20
- 2.9.9 FSMC with I2C1 and TIM4_CH2 20
- 2.9.10 FSMC with USART2 remapped 20
- 2.9.11 FSMC with USART3 and TIM1 remapped 21
- 2.9.12 I2S2 in master/slave mode and USART3 in synchronous mode 21



2.9.13	USARTx_TX pin usage	21
2.10	PVD and USB wakeup events	23
2.11	SPI3 in I ² S slave mode: timing sensitivity between I2S3_WS and I2S3_CK	23
2.12	Boundary scan TAP: wrong pattern sent out after the “capture IR” state	23
2.13	Flash memory BSY bit delay versus STRT bit setting	24
2.14	PC3 I/O pin not bonded in WCLSP64 package	24
2.15	I ² C peripheral	25
2.15.1	Some software events must be managed before the current byte is being transferred	25
2.15.2	Wrong data read into data register	26
2.15.3	SMBus standard not fully supported	27
2.15.4	Wrong behavior of I2C peripheral in master mode after a misplaced Stop	27
2.15.5	Mismatch on the “Setup time for a repeated Start condition” timing parameter	28
2.15.6	Data valid time (t _{VD;DAT}) violated without the OVR flag being set	28
2.15.7	I2C analog filter may provide wrong value, locking BUSY flag and preventing master mode entry	29
2.16	SPI peripheral	31
2.16.1	CRC still sensitive to communication clock when SPI is in slave mode even with NSS high	31
2.16.2	SPI2/I2S2 slave mode wrong behavior in transmission and reception	31
2.16.3	SPI CRC may be corrupted when a peripheral connected to the same DMA channel of the SPI is under DMA transaction close to the end of transfer or end of transfer -1	32
2.17	I2S peripheral	33
2.17.1	Wrong WS signal generation in 16-bit extended to 32-bit PCM long synchronisation mode	33
2.17.2	In I2S slave mode, WS level must be set by the external master when enabling the I2S	33
2.17.3	I2S slave mode desynchronisation with the master during communication	33
2.18	USART peripheral	34
2.18.1	Parity Error flag (PE) is set again after having been cleared by software	34
2.18.2	Idle frame is not detected if receiver clock speed is deviated	34
2.18.3	In full duplex mode, the Parity Error (PE) flag can be cleared by writing the data register	34

2.18.4	Parity Error (PE) flag is not set when receiving in Mute mode using address mark detection	35
2.18.5	Break frame is transmitted regardless of nCTS input line status	35
2.18.6	nRTS signal abnormally driven low after a protocol violation	35
2.19	Timers	36
2.19.1	Missing capture flag	36
2.19.2	Overcapture detected too early	36
2.19.3	General-purpose timer: regulation for 100% PWM	36
2.20	LSI clock stabilization time	37
2.21	FSMC limitations	38
2.21.1	Multimaster access on the FSMC memory map	38
2.21.2	Dummy read cycles inserted when reading synchronous memories	38
2.21.3	1 dummy clock cycle inserted when writing to synchronous memories when CLKDIV=1	38
2.22	SDIO limitations	39
2.22.1	Limited multibyte support with SDIO cards	39
2.22.2	Data errors in SDIO hardware flow control mode	39
2.22.3	Wrong CCRCFAIL status after a response without CRC is received	39
2.22.4	Data corruption in SDIO clock dephasing (NEGEDGE) mode	39
2.22.5	CE-ATA multiple write command and card busy signal management	40
2.22.6	No underrun detection with wrong data transmission	40
2.23	USB limitations	41
2.23.1	USB packet buffer memory: over/underrun or COUNTn_RX[9:0] field reporting incorrect number if APB1 frequency is below 13 MHz	41
Appendix A Revision code on device marking		42
Revision history		48

List of tables

Table 1.	Device Identification	1
Table 2.	Device summary	1
Table 3.	Cortex-M3 core limitations and impact on microcontroller behavior	7
Table 4.	Summary of silicon limitations	11
Table 5.	Document revision history	48

List of figures

Figure 1.	LSE start-up using an additional resistor	16
Figure 2.	LFPGA144 package top view	42
Figure 3.	LFPGA100 package top view	43
Figure 4.	WLCSP64 package top view	44
Figure 5.	LQFP144 package top view	45
Figure 6.	LQFP100 package top view	46
Figure 7.	LQFP64 package top view	47

1 Arm® 32-bit Cortex®-M3 limitations

Errata notices for the Arm^{®(a)} Cortex[®] cores are available from <http://infocenter.arm.com>.

All the described limitations are minor and related to the revision r1p1-01rel0 of the Cortex-M3 core. [Table 3](#) summarizes these limitations and their implications on the behavior of high-density STM32F10xxC/D/E devices.

Table 3. Cortex-M3 core limitations and impact on microcontroller behavior

Arm ID	Arm category	Arm summary of errata	Impact on high-density STM32F10xxC/D/E devices
752419	Cat 2	Interrupted loads to SP can cause erroneous behavior	Minor
740455	Cat 2	SVC and BusFault/MemManage may occur out of order	Minor
602117	Cat 2	LDRD with base in list may result in incorrect base register when interrupted or faulted	Minor
563915	Cat 2	Event register is not set by interrupts and debug	Minor
531064	impl	SWJ-DP missing POR reset sync	No
511864	Cat 3	Cortex-M3 may fetch instructions using incorrect privilege on return from an exception	No
532314	Cat 3	DWT CPI counter increments during sleep	No
538714	Cat 3	Cortex-M3 TPIU clock domain crossing	No
548721	Cat 3	Internal write buffer could be active whilst asleep	No
463763	Cat 3	BKPT in debug monitor mode can cause DFSR mismatch	Minor
463764	Cat 3	Core may freeze for SLEEPONEXIT single instruction ISR	Minor
463769	Cat 3	Unaligned MPU fault during a write may cause the wrong data to be written to a successful first access	No

arm

a. Arm is a registered trademark of Arm Limited (or its subsidiaries) in the US and/or elsewhere.

1.1 Cortex-M3 limitations description for STM32F10xxC/D/E high-density devices

Only the limitations described below have an impact, though minor, on the implementation of STM32F10xxC/D/E high-density devices.

All the other limitations described in the Arm errata notice (and summarized in [Table 3](#) above) have no impact and are not related to the implementation of STM32F10xxC/D/E high-density devices (Cortex-M3 r1p1-01rel0).

1.1.1 Cortex-M3 LDRD with base in list may result in incorrect base register when interrupted or faulted

Description

The Cortex-M3 Core has a limitation when executing an LDRD instruction from the system-bus area, with the base register in a list of the form LDRD Ra, Rb, [Ra, #imm]. The execution may not complete after loading the first destination register due to an interrupt before the second loading completes or due to the second loading getting a bus fault.

Workarounds

1. This limitation does not impact the STM32F10xxC/D/E code execution when executing from the embedded Flash memory, which is the standard use of the microcontroller.
2. Use the latest compiler releases. As of today, they no longer generate this particular sequence. Moreover, a scanning tool is provided to detect this sequence on previous releases (refer to your preferred compiler provider).

1.1.2 Cortex-M3 event register is not set by interrupts and debug

Description

When interrupts related to a WFE occur before the WFE is executed, the event register used for WFE wakeup events is not set and the event is missed. Therefore, when the WFE is executed, the core does not wake up from WFE if no other event or interrupt occur.

Workaround

Use STM32F10xxC/D/E external events instead of interrupts to wake up the core from WFE by configuring an external or internal EXTI line in event mode.

1.1.3 Cortex-M3 BKPT in debug monitor mode can cause DFSR mismatch

Description

A BKPT may be executed in debug monitor mode. This causes the debug monitor handler to be run. However, the bit 1 in the Debug fault status register (DFSR) at address 0xE00ED30 is not set to indicate that it was originated by a BKPT instruction. This only occurs if an interrupt other than the debug monitor is already being processed just before the BKPT is executed.

Workaround

If the DFSR register does not have any bit set when the debug monitor is entered, this means that we must be in this “corner case” and so, that a BKPT instruction was executed in debug monitor mode.

1.1.4 Cortex-M3 may freeze for SLEEPONEXIT single instruction ISR

Description

If the Cortex-M3 SLEEPONEXIT functionality is used and the concerned interrupt service routine (ISR) contains only a single instruction, the core becomes frozen. This freezing may occur if only one interrupt is active and it is preempted by an interrupt whose handler only contains a single instruction.

However, any new interrupt that causes a preemption would cause the core to become unfrozen and behave correctly again.

Workaround

This scenario does not happen in real application systems since all enabled ISRs should at least contain one instruction. Therefore, if an empty ISR is used, then insert a NOP or any other instruction before the exit instruction (BX or BLX).

1.1.5 Interrupted loads to SP can cause erroneous behavior

Description

If an interrupt occurs during the data-phase of a single word load to the stack-pointer (SP/R13), erroneous behavior can occur. In all cases, returning from the interrupt will result in the load instruction being executed an additional time. For all instructions performing an update to the base register, the base register is erroneously updated on each execution, resulting in the stack-pointer being loaded from an incorrect memory location.

The affected instructions are:

1. LDR SP,[Rn],#imm
2. LDR SP,[Rn,#imm]!
3. LDR SP,[Rn,#imm]
4. LDR SP,[Rn]
5. LDR SP,[Rn,Rm]

Workaround

As of today, there is no compiler generating these particular instructions. This limitation can only occur with hand-written assembly code.

Both issues may be worked around by replacing the direct load to the stack-pointer, with an intermediate load to a general-purpose register followed by a move to the stack-pointer.

Example: the following instruction "LDR SP, [R0]" can be replaced by

```
"LDR R2,[R0]
MOV SP,R2 "
```

1.1.6 SVC and BusFault/MemManage may occur out of order

Description

If an SVC exception is generated by executing the SVC instruction while the following instruction fetch is faulted, then the MemManage or BusFault handler may be entered even though the faulted instruction which followed the SVC should not have been executed.

Workaround

A workaround is only required if the SVC handler will not return to the return address that has been stacked for the SVC exception and the instruction access after the SVC will fault. If this is the case then padding can be inserted between the SVC and the faulting area of code, for example, by inserting NOP instructions.

2 STM32F10xxC/D/E silicon limitations

[Table 4](#) gives quick references to all documented limitations (● = limitation present in this Rev).

Table 4. Summary of silicon limitations

Links to silicon limitations		Rev Z	Rev Y, 1, 2, 3 and X
Section 2.1: Voltage glitch on ADC input 0		●	●
Section 2.2: Flash memory read after WFI/WFE instruction		●	●
Section 2.3: Debug registers cannot be read by user software		●	●
Section 2.4: Debugging Stop mode and system tick timer		●	●
Section 2.5: Debugging Stop mode with WFE entry		●	●
Section 2.6: Wakeup sequence from Standby mode when using more than one wakeup source		●	●
Section 2.7: LSE start-up in harsh environments		●	●
Section 2.8: RDP protection		●	●
Section 2.9: Alternate functions	Section 2.9.1: USART1_RTS and CAN_TX	●	●
	Section 2.9.2: SPI1 in slave mode and USART2 in synchronous mode	●	●
	Section 2.9.3: SPI1 in master mode and USART2 in synchronous mode	●	●
	Section 2.9.4: SPI2 in slave mode and USART3 in synchronous mode	●	●
	Section 2.9.5: SPI2 in master mode and USART3 in synchronous mode	●	●
	Section 2.9.6: SDIO with TIM8	●	●
	Section 2.9.7: SDIO and TIM3_REMAP	●	●
	Section 2.9.8: SDIO with USART3 remapped and UART4	●	●
	Section 2.9.9: FSMC with I2C1 and TIM4_CH2	●	●
	Section 2.9.10: FSMC with USART2 remapped	●	●
	Section 2.9.11: FSMC with USART3 and TIM1 remapped	●	●
	Section 2.9.12: I2S2 in master/slave mode and USART3 in synchronous mode	●	●
	Section 2.9.13: USARTx_TX pin usage	●	●
Section 2.10: PVD and USB wakeup events		●	●
Section 2.11: SPI3 in I²S slave mode: timing sensitivity between I2S3_WS and I2S3_CK		●	●
Section 2.12: Boundary scan TAP: wrong pattern sent out after the "capture IR" state		●	●
Section 2.13: Flash memory BSY bit delay versus STRT bit setting		●	●
Section 2.14: PC3 I/O pin not bonded in WCLSP64 package		●	●

Table 4. Summary of silicon limitations (continued)

Links to silicon limitations		Rev Z	Rev Y, 1, 2, 3 and X
Section 2.15: I ² C peripheral	Section 2.15.1: Some software events must be managed before the current byte is being transferred	•	•
	Section 2.15.2: Wrong data read into data register	•	•
	Section 2.15.3: SMBus standard not fully supported	•	•
	Section 2.15.4: Wrong behavior of I2C peripheral in master mode after a misplaced Stop	•	•
	Section 2.15.5: Mismatch on the “Setup time for a repeated Start condition” timing parameter	•	•
	Section 2.15.6: Data valid time (t_{VD, DAT}) violated without the OVR flag being set	•	•
	Section 2.15.7: I2C analog filter may provide wrong value, locking BUSY flag and preventing master mode entry	•	•
Section 2.16: SPI peripheral	Section 2.16.1: CRC still sensitive to communication clock when SPI is in slave mode even with NSS high	•	•
	Section 2.16.2: SPI2/I2S2 slave mode wrong behavior in transmission and reception	•	Fixed
Section 2.17: I2S peripheral	Section 2.17.1: Wrong WS signal generation in 16-bit extended to 32-bit PCM long synchronisation mode	•	•
	Section 2.17.2: In I2S slave mode, WS level must be set by the external master when enabling the I2S	•	•
	Section 2.17.3: I2S slave mode desynchronisation with the master during communication	•	•
Section 2.18: USART peripheral	Section 2.18.1: Parity Error flag (PE) is set again after having been cleared by software	•	•
	Section 2.18.2: Idle frame is not detected if receiver clock speed is deviated	•	•
	Section 2.18.3: In full duplex mode, the Parity Error (PE) flag can be cleared by writing the data register	•	•
	Section 2.18.4: Parity Error (PE) flag is not set when receiving in Mute mode using address mark detection	•	•
	Section 2.18.5: Break frame is transmitted regardless of nCTS input line status	•	•
	Section 2.18.6: nRTS signal abnormally driven low after a protocol violation	•	•
Section 2.19: Timers	Section 2.19.1: Missing capture flag	•	•
	Section 2.19.2: Overcapture detected too early	•	•
	Section 2.19.3: General-purpose timer: regulation for 100% PWM	•	•
Section 2.20: LSI clock stabilization time		•	•

Table 4. Summary of silicon limitations (continued)

Links to silicon limitations		Rev Z	Rev Y, 1, 2, 3 and X
Section 2.21: FSMC limitations	Section 2.21.1: Multimaster access on the FSMC memory map	•	•
	Section 2.21.2: Dummy read cycles inserted when reading synchronous memories	•	•
	Section 2.21.3: 1 dummy clock cycle inserted when writing to synchronous memories when CLKDIV=1	•	•
Section 2.22: SDIO limitations	Section 2.22.1: Limited multibyte support with SDIO cards	•	•
	Section 2.22.2: Data errors in SDIO hardware flow control mode	•	•
	Section 2.22.3: Wrong CCRCFAIL status after a response without CRC is received	•	•
	Section 2.22.4: Data corruption in SDIO clock dephasing (NEGEDGE) mode	•	•
	Section 2.22.5: CE-ATA multiple write command and card busy signal management	•	•
	Section 2.22.6: No underrun detection with wrong data transmission	•	•
Section 2.23: USB limitations	Section 2.23.1: USB packet buffer memory: over/underrun or COUNTn_RX[9:0] field reporting incorrect number if APB1 frequency is below 13 MHz	•	•

2.1 Voltage glitch on ADC input 0

Description

A low-amplitude voltage glitch may be generated (on ADC input 0) on the PA0 pin, when the ADC is converting with injection trigger. It is generated by internal coupling and synchronized to the beginning and the end of the injection sequence, whatever the channel(s) to be converted.

The glitch amplitude is less than 150 mV with a typical duration of 10 ns (measured with the I/O configured as high-impedance input and left unconnected). If PA0 is used as a digital output, this has no influence on the signal. If PA0 is used as a digital input, it is not detected as a spurious transition, providing that PA0 is driven with an impedance lower than 5 k Ω . This glitch does not have any influence on the remaining port A pin or on the ADC conversion injection results, in single ADC configuration.

When using the ADC in dual mode with injection trigger, and in order to avoid any side effect, it is advised to distribute the analog channels so that Channel 0 is configured as an injected channel.

Workaround

None.

2.2 Flash memory read after WFI/WFE instruction

Conditions

- Flash prefetch on
- Flash memory timing set to 2 wait states
- FLITF clock stopped in Sleep mode

Description

If a WFI/WFE instruction is executed during a Flash memory access and the Sleep duration is very short (less than 2 clock cycles), the instruction fetch from the Flash memory may be corrupted on the next wakeup event.

Workaround

When using the Flash memory with two wait states and prefetch on, the FLITF clock must *not* be stopped during the Sleep mode – the FLITFEN bit in the RCC_AHBENR register must be set (keep the reset value).

2.3 Debug registers cannot be read by user software

Description

The DBGMCU_IDCODE and DBGMCU_CR debug registers are accessible only in debug mode (not accessible by the user software). When these registers are read in user mode, the returned value is 0x00.

Workaround

None.

2.4 Debugging Stop mode and system tick timer

Description

If the system tick timer interrupt is enabled during the Stop mode debug (DBG_STOP bit set in the DBGMCU_CR register), it wakes up the system from Stop mode.

Workaround

To debug the Stop mode, disable the system tick timer interrupt.

2.5 Debugging Stop mode with WFE entry

Description

When the Stop debug mode is enabled (DBG_STOP bit set in the DBGMCU_CR register) this allows software debugging during Stop mode.

However, if the application software uses the WFE instruction to enter Stop mode, after wakeup some instructions could be missed if the WFE is followed by sequential instructions. This affects only Stop debug mode with WFE entry.

Workaround

To debug Stop mode with WFE entry, the WFE instruction must be inside a dedicated function with 1 instruction (NOP) between the execution of the WFE and the Bx LR.

Example: `__asm void _WFE(void) {`

WFE

NOP

BX lr }

2.6 Wakeup sequence from Standby mode when using more than one wakeup source

Description

The various wakeup sources are logically OR-ed in front of the rising-edge detector which generates the wakeup flag (WUF). The WUF flag needs to be cleared prior to the Standby mode entry, otherwise the MCU wakes up immediately.

If one of the configured wakeup sources is kept high during the clearing of WUF flag (by setting the CWUF bit), it may mask further wakeup events on the input of the edge detector. As a consequence, the MCU could not be able to wake up from Standby mode.

Workaround

To avoid this problem, the following sequence should be applied before entering Standby mode:

1. Disable all used wakeup sources.
2. Clear all related wakeup flags.
3. Re-enable all used wakeup sources.
4. Enter Standby mode.

Be aware that, when applying this workaround, if one of the wakeup sources is still kept high, the MCU enters the Standby mode, but then it wakes up immediately generating the power reset.

2.7 LSE start-up in harsh environments


Description

The LSE (Low Speed External) oscillator system has been designed to minimize the overall power consumption of the STM32F1 microcontroller. It is extremely important to take specific care in the design of the PCB to ensure this low power oscillator starts in harsh conditions. In some PCB designs without coating, an induced low leakage may prevent the LSE to start-up, regardless of the 32.768 KHz crystal used. This phenomenon is amplified in humid environments that create frost on the OSC32_IN/OSC32_OUT tracks. This unwanted behavior may happen only at the first back-up domain power-on of the device.

Workaround

It is recommended to mount an additional parallel feedback resistor (from 16 MΩ to 22 MΩ) on board to help the oscillation start-up in all cases (see [Figure 1](#)). For more details on compatible crystals and hardware techniques on PCB refer to AN2867 “Oscillator design guide for STM8AF/AL/S, STM32 MCUs and MPUs” available on www.st.com.

Figure 1. LSE start-up using an additional resistor

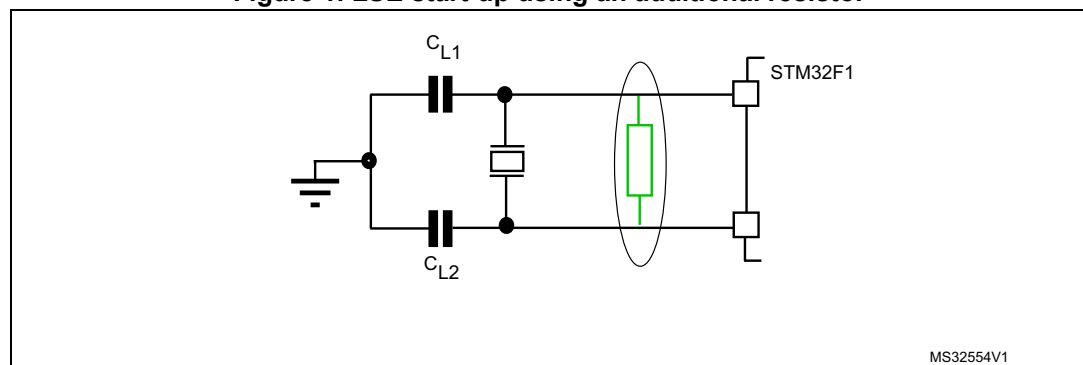

2.8 RDP protection

Description

When the RDP protection is set, the debugger can still access the CPU program counter register and the NVIC registers as well. Remapping the table vector location at different

address in the code memory map and triggering the interrupts may allow to retrieve a part of the Flash memory code in CPU registers.

Workaround

None,

2.9 Alternate functions

In some specific cases, a potential weakness may exist between alternate function outputs mapped onto the same pin. On those IOs the EVENTOUT Cortex output feature cannot be used at the same time as another alternate function.

2.9.1 USART1_RTS and CAN_TX

Conditions

- USART1 is clocked
- CAN is not clocked
- I/O port pin PA12 is configured as an alternate function output.

Description

Even if CAN_TX is not used, this signal is set by default to 1 if I/O port pin PA12 is configured as an alternate function output.

In this case USART1_RTS cannot be used.

Workaround

When USART1_RTS is used, the CAN must be remapped to either another IO configuration when the CAN is used, or to the unused configuration (CAN_REMAP[1:0] set to "01") when the CAN is not used.

2.9.2 SPI1 in slave mode and USART2 in synchronous mode

Conditions

- SPI1 and USART2 are clocked
- I/O port pin PA4 is configured as an alternate function output.

Description

USART2 cannot be used in synchronous mode (USART2_CK signal), if SPI1 is used in slave mode.

Workaround

None.

2.9.3 SPI1 in master mode and USART2 in synchronous mode

Conditions

- SPI1 and USART2 are clocked
- I/O port pin PA4 is configured as an alternate function output.

Description

USART2 cannot be used in synchronous mode (USART2_CK signal) if SPI1 is used in master mode and SP1_NSS is configured in software mode. In this case USART2_CK is not output on the pin.

Workaround

In order to output USART2_CK, the SSOE bit in the SPI1_CR2 register must be set to configure the pin in output mode.

2.9.4 SPI2 in slave mode and USART3 in synchronous mode**Conditions**

- SPI2 and USART3 are clocked
- I/O port pin PB12 is configured as an alternate function output.

Description

USART3 cannot be used in synchronous mode (USART3_CK signal) if SPI2 is used in slave mode.

Workaround

None.

2.9.5 SPI2 in master mode and USART3 in synchronous mode**Conditions**

- SPI2 and USART3 are clocked
- I/O port pin PB12 is configured as an alternate function output.

Description

USART3 cannot be used in synchronous mode (USART3_CK signal) if SPI2 is used in master mode and SP2_NSS is configured in software mode. In this case USART3_CK is not output on the pin.

Workaround

In order to output USART3_CK, the SSOE bit in the SPI2_CR2 register must be set to configure the pin in output mode,

2.9.6 SDIO with TIM8**Description**

Conflicts occur when:

- the SDIO is configured in 1- or 4-bit mode and TIM8_CH4 is configured as an output

The signals that conflict are the following:

- TIM8_CH4 and SDIO_D1

Workaround

Do not use TIM8_CH4 as an output when the SDIO is being used.

2.9.7 SDIO and TIM3_REMAP

Description

When SDIO is configured in 1- or 4-bit mode, and TIM3 channels are remapped to PC6 to PC9, and configured as outputs, a conflict occurs between:

- TIM3_CH4 and SDIO_D1

Workaround

Do not use TIM3_CH4 as an output when the SDIO is being used.

2.9.8 SDIO with USART3 remapped and UART4

Description

When SDIO is configured in 1-bit mode, there are conflicts with the USART3_TX pin remapped and with the UART4_TX pin. Conflicts are between the following signals:

- USART3_TX and SDIO_D2
- UART4_TX and SDIO_D2

Workaround

Use USART3_TX either in the default configuration (on the PB10 I/O) or remap USART3_TX to PD8 when the SDIO is being used.

Do not use UART4_TX when the SDIO is being used.

2.9.9 FSMC with I2C1 and TIM4_CH2

Description

When the FSMC is being used, the NADV signal is set to 1 by default when the alternate function output is selected for this pin. TIM4_CH2 and the I2C1 SDA signal are in conflict with the NADV signal.

Workaround

Do not use TIM4_CH2 as an output when the FSMC is being used.

Concerning I2C1, it is possible to use the remap functionality available on the PB8 and PB9 pins. Otherwise, disable the FSMC clock through the "RCC_AHBENR" register prior using the I2C1.

2.9.10 FSMC with USART2 remapped

Description

When the FSMC is being used and the alternate function output is selected on PD4, PD5 and PD7, the following signals are in conflict:

- USART2_RTS remapped to PD4 and FSMC_OEN
- USART2_TX remapped to PD5 and FSMC_WEN
- USART2_CK remapped to PD7 and FSMC_NE1/FSMC_NCE2

Workaround

Use the USART2 default configuration (no remap).

2.9.11 FSMC with USART3 and TIM1 remapped**Description**

When the FSMC is being used in 8-bit mode and the alternate function output is selected on the unused FSMC data lines 8 to 15, the following signals are in conflict:

- USART3_TX and USART3_CK remapped to PD8 and PD10, respectively, are in conflict with FSMC_D13 and FSMC_D15, respectively.
- TIM1_CH2, TIM1_CH3N, TIM1_CH3 and TIM1_CH4 used as outputs and remapped to PE11 to PE14, respectively, are in conflict with FSMC_D8 to FSMC_D11, respectively.

Workaround

- Use the USART3's partial remap functionality or default configuration (no remap).
- Do not use TIM1_CH2, TIM1_CH3N, TIM1_CH3 and TIM1_CH4 as outputs when they are remapped to PE11 to PE14, respectively.

2.9.12 I2S2 in master/slave mode and USART3 in synchronous mode**Conditions**

- USART3 in synchronous mode is clocked
- I2S2 is not clocked
- I/O port pin PB12 is configured as an alternate function output

Description

If I2S2 was used prior to operating USART3 in synchronous mode, a conflict occurs between the I2S2_WS and USART3_CK signal even though the I2S2 clock was disabled.

Workaround

To use USART3 in synchronous mode, first disable the I2S2 clock, then perform a software reset of SPI2(I2S2).

2.9.13 USARTx_TX pin usage**Description**

In USART receive-mode-only communication (TE = 0 in the USARTx_CR1 register), even when the USARTx_TX pin is not being used, the corresponding I/O port pin cannot be used to output another alternate function (in this mode the USARTx_TX output is set to 1 and thus no other alternate function output can be used).

This limitation applies to all USARTx_TX pins that share another alternate function output.

Workaround

Do not use the corresponding I/O port of the USARTx_TX pin in alternate function output mode. Only the input mode can be used (TE bit in the USARTx_CR1 has to be cleared).

2.10 PVD and USB wakeup events

Description

PVD and USB Wakeup, which are internally linked to EXTI line16 and EXTI line18, respectively, cannot be used as event sources for the Cortex-M3 core. As a consequence, these signals cannot be used to exit the Sleep or the Stop mode (exit WFE).

Workaround

Use interrupt sources and the WFI instruction if the application must be woken up from the Sleep or the Stop mode by PVD or USB Wakeup.

2.11 SPI3 in I²S slave mode: timing sensitivity between I2S3_WS and I2S3_CK

Description

When SPI3 is configured in I²S slave audio mode in I2S Philips or PCM modes, If the I2S3_WS signal arrives too early with respect to the active edge of I2S3_CK, a wrong communication starting too soon may result: then, depending on the clock polarity and the Audio mode selected, it is either shifted by one bit from start to end or, the first left and right data items are lost and the others, shifted.

Workaround

None. Use I2S3 in slave mode in the MSB/LSB justified mode only.

2.12 Boundary scan TAP: wrong pattern sent out after the “capture IR” state

Description

After the “capture IR” state of the boundary scan TAP, the two lower significant bits in the instruction register should be loaded with “01” for them to be shifted out whenever a next instruction is shifted in.

However, the boundary scan TAP shifts out the latest value loaded into the instruction register, which could be “00”, “01”, “10” or “11”.

Workaround

The data shifted out, after the capture IR state, in the boundary scan flow should therefore be ignored and the software should check not only the two least significant bits (XXX01) but all register bits (XXXXX).

2.13 Flash memory BSY bit delay versus STRT bit setting

Description

When the STRT bit in the Flash memory control register is set (to launch an erase operation), the BSY bit in the Flash memory status register goes high one cycle later.

Therefore, if the FLASH_SR register is read immediately after the FLASH_CR register is written (STRT bit set), the BSY bit is read as 0.

Workaround

Read the BSY bit at least one cycle after setting the STRT bit.

2.14 PC3 I/O pin not bonded in WCLSP64 package

Description

In the WCLSP64 package, the PC3 I/O pin is not bonded. Since the default state of the I/O is input floating and if the PC3 is not fixed at low level by software, it results in an extra current consumption in low power mode.

Workaround

PC3 must be configured by software to output push-pull mode and writing 0 into the data register in order to avoid an extra consumption during low power modes.

2.15 I²C peripheral

2.15.1 Some software events must be managed before the current byte is being transferred

Description

When the EV7, EV7_1, EV6_1, EV6_3, EV2, EV8, and EV3 events are not managed before the current byte is being transferred, problems may be encountered such as receiving an extra byte, reading the same data twice or missing data.

Workarounds

When it is not possible to manage the EV7, EV7_1, EV6_1, EV6_3, EV2, EV8, and EV3 events before the current byte transfer and before the acknowledge pulse when changing the ACK control bit, it is recommended to:

- **Workaround 1**
Use the I2C with DMA in general, except when the Master is receiving a single byte.
- **Workaround 2**
Use I2C interrupts and boost their priorities to the highest one in the application to make them uninterruptible
- **Workaround 3** (only for EV6_1 and EV6_3 events used in method 2)
EV6_1 event (used in master receiver 2 bytes):
Stretch SCL line between ADDR bit is cleared and ACK is cleared:
 - a) ADDR=1
 - b) Configure SCL I/O as GPIO open-drain output low
 - c) Clear ADDR by reading SR1 register followed by reading SR3
 - d) Program ACK=0
 - e) Configure SCL I/O as Alternate Function open drainEV6_3 event (used in master receiver 1 byte):
Stretch SCL line between ADDR bit is cleared and STOP bit programming:
 - a) ADDR=1
 - b) Program ACK=0
 - c) Configure SCL I/O as GPIO open-drain output low
 - d) Clear ADDR by reading SR1 register followed by reading SR3
 - e) Program STOP=1
 - f) Configure SCL I/O as Alternate Function open drain

2.15.2 Wrong data read into data register

In Master Receiver mode, when closing the communication using method 2, the content of the last read data can be corrupted. The following two sequences are concerned by the limitation:

- **Sequence 1:** Transfer sequence for master receiver when $N = 2$:
 - a) BTF = 1(Data N-1 in DR and Data N in shift register)
 - b) Program STOP = 1,
 - c) Read DR twice (Read Data N-1 and Data N) just after programming the STOP.
- **Sequence 2:** Transfer sequence for master receiver when $N > 2$:
 - a) BTF = 1 (Data N-2 in DR and Data N-1 in shift register)
 - b) Program ACK = 0,
 - c) Read DataN-2 in DR.
 - d) Program STOP = 1,
 - e) Read DataN-1.

If the user software is not able to read the data N-1 before the STOP condition is generated on the bus, the content of the shift register (data N) is corrupted (data N is shifted 1-bit to the left).

Workarounds

- Workaround 1
Stretch the SCL line by configuring SCL I/O as a general purpose I/O, open-drain output low level, before the SET STOP in sequence 1 and before the READ Data N-2 in séquence 2. Then configure back the SCL I/O as alternate function open-drain after the READ Data N-1. The sequences become:
Sequence 1:
 - a) BTF = 1(Data N-1 in DR and Data N in shift register)
 - b) Configure SCL I/O as GPIO open-drain output low
 - c) Program STOP = 1
 - d) Read Data N-1
 - e) Configure SCL I/O as Alternate Function open drain
 - f) Read Data N

Sequence 2:

- a) BTF = 1 (Data N-2 in DR and Data N-1 in shift register)
 - b) Program ACK = 0
 - c) Configure SCL I/O as GPIO open-drain output low
 - d) Read Data N-2 in DR.
 - e) Program STOP = 1,
 - f) Read Data N-1.
 - g) Configure SCL I/O as Alternate Function open drain
- Workaround 2
Mask all active interrupts between the SET STOP and the READ data N-1 for sequence 1; and between the READ data N-2, the SET STOP and the READ data N-1 for Sequence 2.
 - Workaround 3
Manage I2C RxNE events with DMA or interrupts with the highest priority level, so that the condition BTF = 1 never occurs.

2.15.3 SMBus standard not fully supported

Description

The I²C peripheral is not fully compliant with the SMBus v2.0 standard since It does not support the capability to NACK an invalid byte/command.

Workarounds

A higher-level mechanism should be used to verify that a write operation is being performed correctly at the target device, such as:

1. Using the SMBAL pin if supported by the host
2. the alert response address (ARA) protocol
3. the Host notify protocol

2.15.4 Wrong behavior of I2C peripheral in master mode after a misplaced Stop

Description

If a misplaced Stop is generated on the bus, the peripheral cannot enter master mode properly:

- If a void message is received (START condition immediately followed by a STOP): the BERR (bus error) flag is not set, and the I2C peripheral is not able to send a start condition on the bus after the write to the START bit in the I2C_CR2 register.
- In the other cases of a misplaced STOP, the BERR flag is set. If the START bit is already set in I2C_CR2, the START condition is not correctly generated on the bus and can create bus errors.

Workaround

In the I²C standard, it is allowed to send a Stop only at the end of the full byte (8 bits + acknowledge), so this scenario is not allowed. Other derived protocols like CBUS allow it, but they are not supported by the I²C peripheral.

In case of a noisy environment in which unwanted bus errors can occur, it is recommended to implement a timeout to ensure that after the START control bit is set, the SB (start bit) flag is set. In case the timeout has elapsed, the peripheral must be reset by setting the SWRST bit in the I2C_CR2 control register. It should also be reset in the same way if a BERR is detected while the START bit is set in I2C_CR2.

2.15.5 Mismatch on the “Setup time for a repeated Start condition” timing parameter

Description

In case of a repeated Start, the “Setup time for a repeated Start condition” (named $T_{su;sta}$ in the I²C specification) can be slightly violated when the I²C operates in Master Standard mode at a frequency between 88 kHz and 100 kHz.

The issue can occur only in the following configuration:

- in Master mode
- in Standard mode at a frequency between 88 kHz and 100 kHz (no issue in Fast-mode)
- SCL rise time:
 - If the slave does not stretch the clock and the SCL rise time is more than
 - 300 ns (if the SCL rise time is less than 300 ns the issue cannot occur)
 - If the slave stretches the clock

The setup time can be violated independently of the APB peripheral frequency.

Workaround

Reduce the frequency down to 88 kHz or use the I²C Fast-mode if supported by the slave.

2.15.6 Data valid time ($t_{VD;DAT}$) violated without the OVR flag being set

Description

The data valid time ($t_{VD;DAT}$, $t_{VD;ACK}$) described by the I²C standard can be violated (as well as the maximum data hold time of the current data ($t_{HD;DAT}$)) under the conditions described below. Moreover, if the data register is written too late and close to the SCL rising edge, an error can be generated on the bus (SDA toggles while SCL is high). These violations cannot be detected because the OVR flag is not set (no transmit buffer underrun is detected).

This issue can occur only under the following conditions:

- In Slave transmit mode
- With clock stretching disabled (NOSTRETCH=1)
- If the software is late in writing the DR data register, but not late enough to set the OVR flag (the data register is written before the SCL rising edge).

Workaround

If the master device allows it, use the clock stretching mechanism by programming the bit NOSTRETCH=0 in the I2C_CR1 register.

If the master device does not allow it, ensure that the software writes to the data register fast enough after TXE or ADDR events. For instance, use an interrupt on the TXE or ADDR flag and boost its priority to the higher level, or use DMA. Use this "NOSTRETCH" mode with a slow I2C bus speed.

Note: The first data byte to transmit must be written in the data register after the ADDR flag is cleared, and before the next SCL rising edge, so that the time window for writing the first data byte in the data register is less than t_{LOW} .

If this is not possible, a workaround can be used:

Clear the ADDR flag

Wait for the OVR flag to be set

Clear OVR and write the first data byte.

Then the time window for writing the next data byte is the time to transfer one byte. In this case, the master must discard the first received data byte.

2.15.7 I2C analog filter may provide wrong value, locking BUSY flag and preventing master mode entry

Description

The I2C analog filters embedded in the I2C I/Os may be tied to low level, whereas SCL and SDA lines are kept at high level. This can occur after an MCU power-on reset, or during ESD stress. Consequently, the I2C BUSY flag is set, and the I2C cannot enter master mode (START condition cannot be sent). The I2C BUSY flag cannot be cleared by the SWRST control bit, nor by a peripheral or a system reset. BUSY bit is cleared under reset, but it is set high again as soon as the reset is released, because the analog filter output is still at low level. This issue occurs randomly.

Note: Under the same conditions, the I2C analog filters may also provide a high level, whereas SCL and SDA lines are kept to low level. This should not create issues as the filters output is correct after next SCL and SDA transition.

Workaround

The SCL and SDA analog filter output is updated after a transition occurs on the SCL and SDA line respectively. The SCL and SDA transition can be forced by software configuring the I2C I/Os in output mode. Then, once the analog filters are unlocked and output the SCL and SDA lines level, the BUSY flag can be reset with a software reset, and the I2C can enter master mode.

Therefore, the following sequence must be applied:

1. Disable the I2C peripheral by clearing the PE bit in I2Cx_CR1 register.
2. Configure the SCL and SDA I/Os as General Purpose Output Open-Drain, High level (Write 1 to GPIOx_ODR).
3. Check SCL and SDA High level in GPIOx_IDR.
4. Configure the SDA I/O as General Purpose Output Open-Drain, Low level (Write 0 to GPIOx_ODR).
5. Check SDA Low level in GPIOx_IDR.
6. Configure the SCL I/O as General Purpose Output Open-Drain, Low level (Write 0 to GPIOx_ODR).
7. Check SCL Low level in GPIOx_IDR.
8. Configure the SCL I/O as General Purpose Output Open-Drain, High level (Write 1 to GPIOx_ODR).
9. Check SCL High level in GPIOx_IDR.
10. Configure the SDA I/O as General Purpose Output Open-Drain , High level (Write 1 to GPIOx_ODR).
11. Check SDA High level in GPIOx_IDR.
12. Configure the SCL and SDA I/Os as Alternate function Open-Drain.
13. Set SWRST bit in I2Cx_CR1 register.
14. Clear SWRST bit in I2Cx_CR1 register.
15. Enable the I2C peripheral by setting the PE bit in I2Cx_CR1 register.

2.16 SPI peripheral

2.16.1 CRC still sensitive to communication clock when SPI is in slave mode even with NSS high

Description

When the SPI is configured in slave mode with the CRC feature enabled, the CRC is calculated even if the NSS pin deselects the SPI (high level applied on the NSS pin).

Workaround

The CRC has to be cleared on both Master and Slave sides between the slave deselection (high level on NSS) and the slave selection (low level on NSS), in order to resynchronize the Master and Slave for their respective CRC calculation.

To procedure to clear the CRC is the following:

1. disable the SPI (SPE = 0)
2. clear the CRCEN bit.
3. set the CRCEN bit
4. enable the SPI (SPE = 1)

2.16.2 SPI2/I2S2 slave mode wrong behavior in transmission and reception

Description

When the SPI2/I2S2 slave mode is used:

- In transmit or in full-duplex mode, the TXE flag may go high two times before RXNE is set, that is, TXE may be asserted before the data already in the data register are transmitted. This may result in data loss during transmission.
- In receive or in full-duplex mode, with CRC calculation enabled, the CRC may be detected as wrong (the CRCERR flag is set) while the received data are correct.
- In transmit or in full-duplex mode, with CRC calculation enabled, the CRC may not be output on the data line after the CRCNEXT bit is set in CPU mode, or when the DMA in transmission reaches the end of transfer.

Workarounds

- The transmit or full-duplex mode (CRC feature not used) may be used if the master stops the clock for every data transfer. The SPI2/I2S2 slave then has enough time to load the data register on the RXNE flag going high. DMA must not be used.
- In receive only mode, with CRC calculation enabled, at the end of the CRC reception, the software needs to check the CRCERR flag.
 - If it is found set, read back the SPI_RXCRC:
 - If the value is 0, the complete data transfer is successful.
 - Otherwise, one or more errors have been detected during the data transfer by CPU or DMA.
 - If it is found reset, the complete data transfer is successful.
- In full duplex or transmit only configurations, the CRC feature cannot be used.

2.16.3 **SPI CRC may be corrupted when a peripheral connected to the same DMA channel of the SPI is under DMA transaction close to the end of transfer or end of transfer -1**

Description

In the following conditions, the CRC may be frozen before the CRCNEXT bit is written, resulting in a CRC error:

- SPI is slave or master.
- Full duplex or simplex mode is used.
- CRC feature is enabled.
- SPI is configured to manage data transfers by software (interrupt or polling).
- A peripheral, mapped on the same DMA channel as the SPI, is executing DMA transfers.

Workaround

If the application allows it, you can use the DMA for SPI transfers.

2.17 I2S peripheral

2.17.1 Wrong WS signal generation in 16-bit extended to 32-bit PCM long synchronisation mode

Description

When I2S is master with PCM long synchronization is selected as 16-bit data frame extended to 32-bit, the WS signal is generated every 16 bits rather than every 32 bits.

Workaround

Only the 16-bit mode with no data extension can be used when the I2S is master and when the selected mode has to be PCM long synchronization mode.

2.17.2 In I2S slave mode, WS level must be set by the external master when enabling the I2S

Description

In slave mode the WS signal level is used only to start the communication. If the I2S (in slave mode) is enabled while the master is already sending the clock and the WS signal level is low (for I2S protocol) or is high (for the LSB or MSB-justified mode), the slave starts communicating data immediately. In this case the master and slave is desynchronized throughout the whole communication.

Workaround

The I2S peripheral must be enabled when the external master sets the WS line at:

- High level when the I2S protocol is selected.
- Low level when the LSB or MSB-justified mode is selected.

2.17.3 I2S slave mode desynchronisation with the master during communication

Description

In I2S slave mode, if glitches on SCK or WS signals are generated at an unexpected time, a desynchronization of the master and the slave occurs. No error is reported to allow audio system to re-synchronize.

Workaround

The following workarounds can be applied in order to detect and react after a desynchronization by disabling and enabling I2S peripheral in order to resynchronize with the master.

1. Monitoring the I2S WS signal through an external Interrupt to check the I2S WS signal status.
2. Monitoring the I2S clock signal through an input capture interrupt to check the I2S clock signal status.
3. Monitoring the I2S clock signal through an input capture interrupt and the I2S WS signal via an external interrupt to check the I2S clock and I2S WS signals status.

2.18 USART peripheral

2.18.1 Parity Error flag (PE) is set again after having been cleared by software

Description

The parity error flag (PE) is set at the end of the last data bit. It should be cleared by software by making a read access to the status register followed by reading the data in the data register.

Once the PE flag is set by hardware, if it is cleared by software before the middle of the stop bit, it is set again. Consequently, the software may jump several times to the same interrupt routine for the same parity error.

Workaround

Before clearing the Parity Error flag, the software must wait for the RXNE flag to be set.

2.18.2 Idle frame is not detected if receiver clock speed is deviated

Description

If the USART receives an idle frame followed by a character, and the clock of the transmitter device is faster than the USART receiver clock, the USART receive signal falls too early when receiving the character start bit, with the result that the idle frame is not detected (IDLE flag is not set).

Workaround

None.

2.18.3 In full duplex mode, the Parity Error (PE) flag can be cleared by writing the data register

Description

In full duplex mode, when the Parity Error flag is set by the receiver at the end of a reception, it may be cleared while transmitting by reading the USART_SR register to check the TXE or TC flags and writing data in the data register.

Consequently, the software receiver can read the PE flag as '0' even if a parity error occurred.

Workaround

The Parity Error flag should be checked after the end of reception and before transmission.

2.18.4 Parity Error (PE) flag is not set when receiving in Mute mode using address mark detection

Description

The USART receiver is in Mute mode and is configured to exit the Mute mode using the address mark detection. When the USART receiver recognizes a valid address with a parity error, it exits the Mute mode without setting the Parity Error flag.

Workaround

None.

2.18.5 Break frame is transmitted regardless of nCTS input line status

Description

When CTS hardware flow control is enabled (CTSE = 1) and the Send Break bit (SBK) is set, the transmitter sends a break frame at the end of current transmission regardless of nCTS input line status.

Consequently, if an external receiver device is not ready to accept a frame, the transmitted break frame is lost.

Workaround

None.

2.18.6 nRTS signal abnormally driven low after a protocol violation

Description

When RTS hardware flow control is enabled, the nRTS signal goes high when a data is received. If this data was not read and a new data is sent to the USART (protocol violation), the nRTS signal goes back to low level at the end of this new data.

Consequently, the sender gets the wrong information that the USART is ready to receive further data.

On USART side, an overrun is detected which indicates that some data has been lost.

Workaround

The lost data should be resent to the USART.

2.19 Timers

These limitations apply only to TIM1, TIM2, TIM3, TIM4, TIM5 and TIM8.

2.19.1 Missing capture flag

Description

In capture mode, when a capture occurs while the CCRx register is being read, the capture flag (CCxIF) may be cleared without the overcapture flag (CCxOF) being set. The new data are actually captured in the capture register.

Workaround

An external interrupt can be enabled on the capture I/O just before reading the capture register (in the capture interrupt), and disabled just after reading the captured data. A missed capture is detected by the EXTI peripheral.

2.19.2 Overcapture detected too early

Description

In capture mode, the overcapture flag (CCxOF) can be set even though no data have been lost.

Conditions

If a capture occurs while the capture register is being read, an overcapture is detected even though the previously captured data are correctly read and the new data are correctly stored into the capture register.

The system is at the limit of an overcapture but no data are lost.

Workaround

None.

2.19.3 General-purpose timer: regulation for 100% PWM

Description

When the OCREF_CLR functionality is activated, the OCxREF signal becomes de-asserted (and consequently OCx is deasserted / OCxN is asserted) when a high level is applied on the OCREF_CLR signal. The PWM then restarts (output re-enabled) at the next counter overflow.

But if the PWM is configured at 100% ($CCxR > ARR$), then it does not restart and OCxREF remains de-asserted.

Workaround

None.

2.20 LSI clock stabilization time

Description

When the LSIRDY flag is set, the clock may still be out of the specified frequency range (f_{LSI} parameter, see LSI oscillator characteristics in the product datasheet).

Workaround

To have a fully stabilized clock in the specified range, a software temporization of 100 μ s should be added.

2.21 FSMC limitations

2.21.1 Multimaster access on the FSMC memory map

Description

When multimaster accesses are performed on the FSMC memory map (address space from 0x6000 0000 to 0xA000 0FFF), an error could be generated, leading to either a bus fault or a DMA transfer error.

A multimaster can be:

- DMA1 and DMA2
- DMA1 and CPU
- DMA2 and CPU

Workaround

If multimaster accesses are required on the FSMC address space, the software must ensure that accesses are performed one at a time, and not at the same time.

2.21.2 Dummy read cycles inserted when reading synchronous memories

Description

When performing a burst read access to a synchronous memory, some dummy read accesses are performed at the end of the burst cycle whatever the type of AHB burst access. However, the extra data values which are read are not used by the FSMC and there is no functional failure. The number of dummy reads corresponds to the AHB data size.

Example: if AHB data size = 32bit and MEMSIZE= 16bit, two extra 16-bit reads is performed.

Workaround

None.

2.21.3 1 dummy clock cycle inserted when writing to synchronous memories when CLKDIV=1

Description

When performing a write access to a synchronous memory and CLKDIV=1 (in FSMC_BTRx register), one dummy clock cycle is generated after nWE is de-asserted whatever the type of write burst access. However, there is no dummy write to the memory since the extra clock is generated while nWE is de-asserted.

Workaround

None.

2.22 SDIO limitations

2.22.1 Limited multibyte support with SDIO cards

Description

The SDIO standard allows multibyte transfers (to transfer any number of data bytes from 1, 2, 3 up to 512), which extends the block transfer of the SD standard.

In a multibyte transfer operation, CMD53 transfers only a number of bytes that is equal to a power of 2 (1, 2, 4, 8...512) between 1 and 512.

Workaround

In case the application needs to read a number of bytes N that is not a power of 2, and if the SDIO device supports the multiblock mode, it is then possible to read the N bytes using the CMD53 multiblock command:

- Configure the SDIO block size to 1 byte
- Read N bytes using the CMD53 multiblock command

2.22.2 Data errors in SDIO hardware flow control mode

Description

When HW Flow Control is enabled by setting bit 14 of SDIO_CLKCR register, some glitches can occur on the SDIO_CK output clock resulting in wrong data being written in the SD/MMC Card or the SDIO device. As consequence a data CRC error is reported to the SD/SDIO MMC host interface (DCRCFAIL bit in the SDIO_STA register is set).

Workaround

None. HW Flow Control must not be used. Software has to manage Overrun Errors (Rx mode) and FIFO underrun (Tx mode).

2.22.3 Wrong CCRCFAIL status after a response without CRC is received

Description

The CRC is calculated even if the response to a command does not contain any CRC field. As a consequence, after the SDIO command IO_SEND_OP_COND (CMD5) is sent, the CCRCFAIL bit of the SDIO_STA register is set.

Workaround

The CCRCFAIL bit in the SDIO_STA register shall be ignored by the software. CCRCFAIL must be cleared by setting CCRCFAILC bit of the SDIO_ICR register after reception of the response to the CMD5 command.

2.22.4 Data corruption in SDIO clock dephasing (NEGEDGE) mode

Description

When NEGEDGE bit is set to '1', it may lead to invalid data and command response read.

Workaround

None. A configuration with the NEGEDGE bit equal to '1' should not be used.

2.22.5 CE-ATA multiple write command and card busy signal management**Description**

The CE-ATA card may inform the host that it is busy by driving the SDIO_D0 line low, two cycles after the transfer of a write command (RW_MULTIPLE_REGISTER or RW_MULTIPLE_BLOCK). When the card is in a busy state, the host must not send any data until the BUSY signal is de-asserted (SDIO_D0 released by the card).

This condition is not respected if the data state machine leaves the IDLE state (Write operation programmed and started, DTEN = 1, DTDIR = 0 in SDIO_DCTRL register and TXFIFOE = 0 in SDIO_STA register).

As a consequence, the write transfer fails and the data lines are corrupted.

Workaround

After sending the write command (RW_MULTIPLE_REGISTER or RW_MULTIPLE_BLOCK), the application must check that the card is not busy by polling the BSY bit of the ATA status register using the FAST_IO (CMD39) command before enabling the data state machine.

2.22.6 No underrun detection with wrong data transmission**Description**

In case there is an ongoing data transfer from the SDIO host to the SD card and the hardware flow control is disabled (bit 14 of the SDIO_CLKCR is not set), if an underrun condition occurs, the controller may transmit a corrupted data block (with wrong data word) without detecting the underrun condition when the clock frequencies have the following relationship:

$$[3 \times \text{period}(\text{PCLK2}) + 3 \times \text{period}(\text{SDIOCLK})] \geq (32 / (\text{BusWidth})) \times \text{period}(\text{SDIO_CK})$$

Workaround

Avoid the above-mentioned clock frequency relationship, by:

- incrementing the APB frequency
- or decreasing the transfer bandwidth
- or reducing SDIO_CK frequency.

2.23 USB limitations

2.23.1 USB packet buffer memory: over/underrun or COUNTn_RX[9:0] field reporting incorrect number if APB1 frequency is below 13 MHz

Description

The USB peripheral packet buffer memory is expected to operate at a minimum APB1 frequency of 8 MHz.

It may however happen that, when OUT transactions are sent by the Host with a data payload size exactly equal to the maximum packet size already programmed in the COUNTn_RX packet buffer memory (via the BLSIZE and NUM_BLOCK[4:0] fields), the packet and all bytes from the Host are correctly received and stored into the packet buffer memory, but, the COUNTn_RX[9:0] field indicates an incorrect number (one byte less).

Workaround

This limitation concerns applications that check the exact number of bytes received in the packet buffer memory. To avoid that these applications interpret a Host error and so, stall the OUT endpoint even if no data reception error actually occurred, it is recommended to:

1. increase the APB1 frequency to a minimum of 13 MHz, or
2. increase the APB1 frequency to a minimum of 10 MHz, then program USB_COUNTn_RX (via the BLSIZE and NUM_BLOCK[4:0] fields) to have more than the number of bytes in the maximum packet size allocated for reception in the packet buffer memory

Appendix A Revision code on device marking

Figure 2 to Figure 7 show the marking compositions for the LFBGA144, LFBGA100, WLCSP64, LQFP144, LQFP100 and LQFP64 packages. Only the Additional field containing the revision code and the Year and Week fields making up the date code are shown.

Figure 2. LFBGA144 package top view

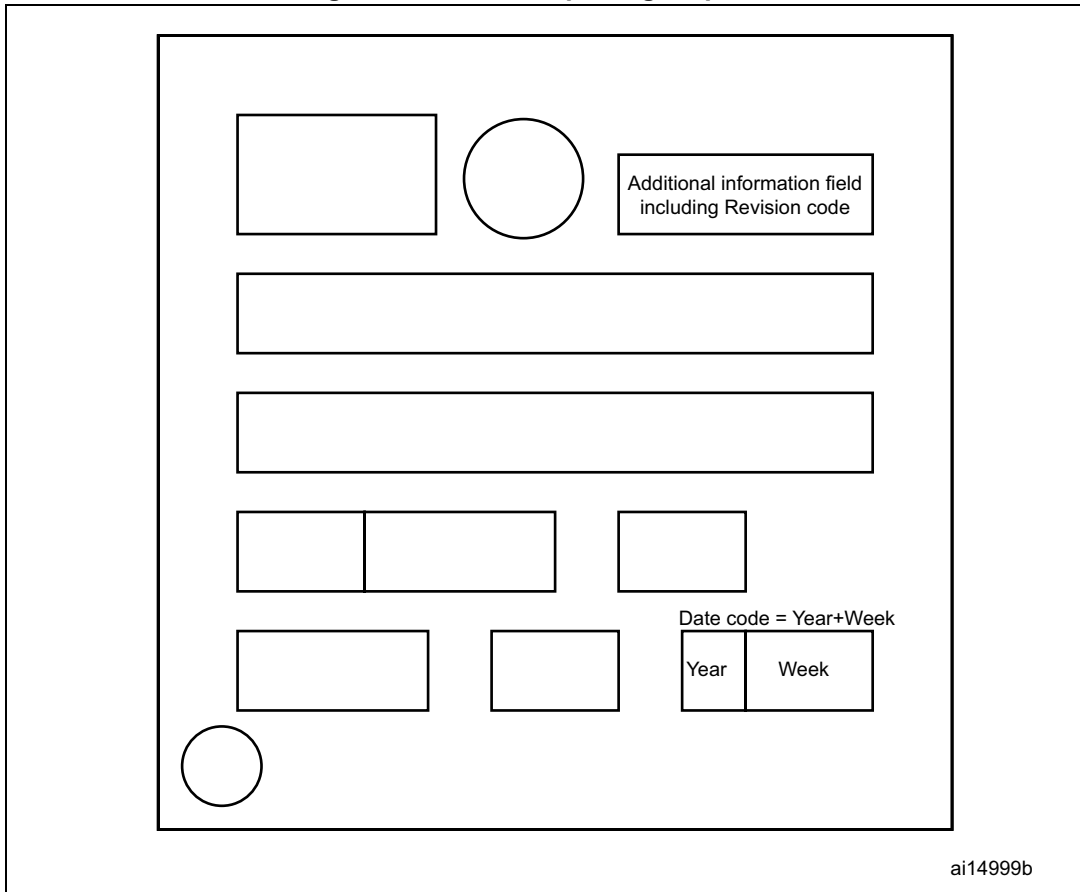


Figure 3. LFBGA100 package top view

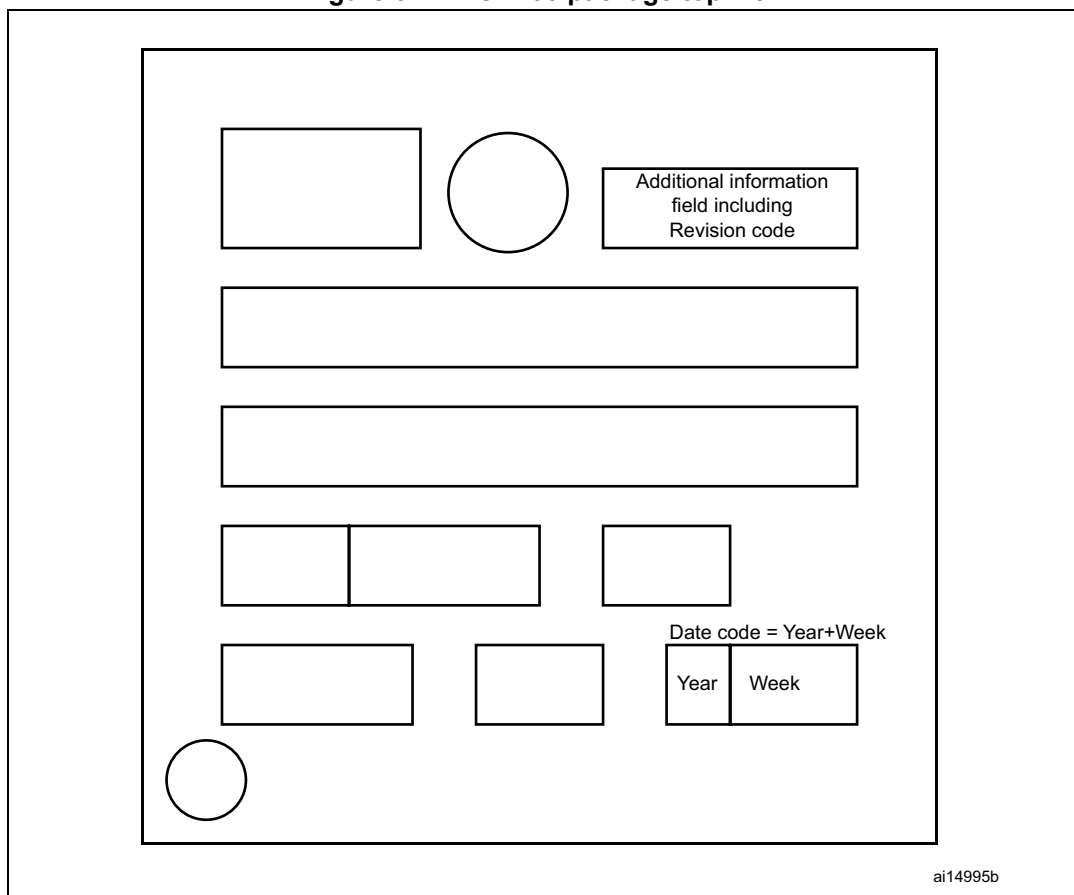


Figure 4. WLCSP64 package top view

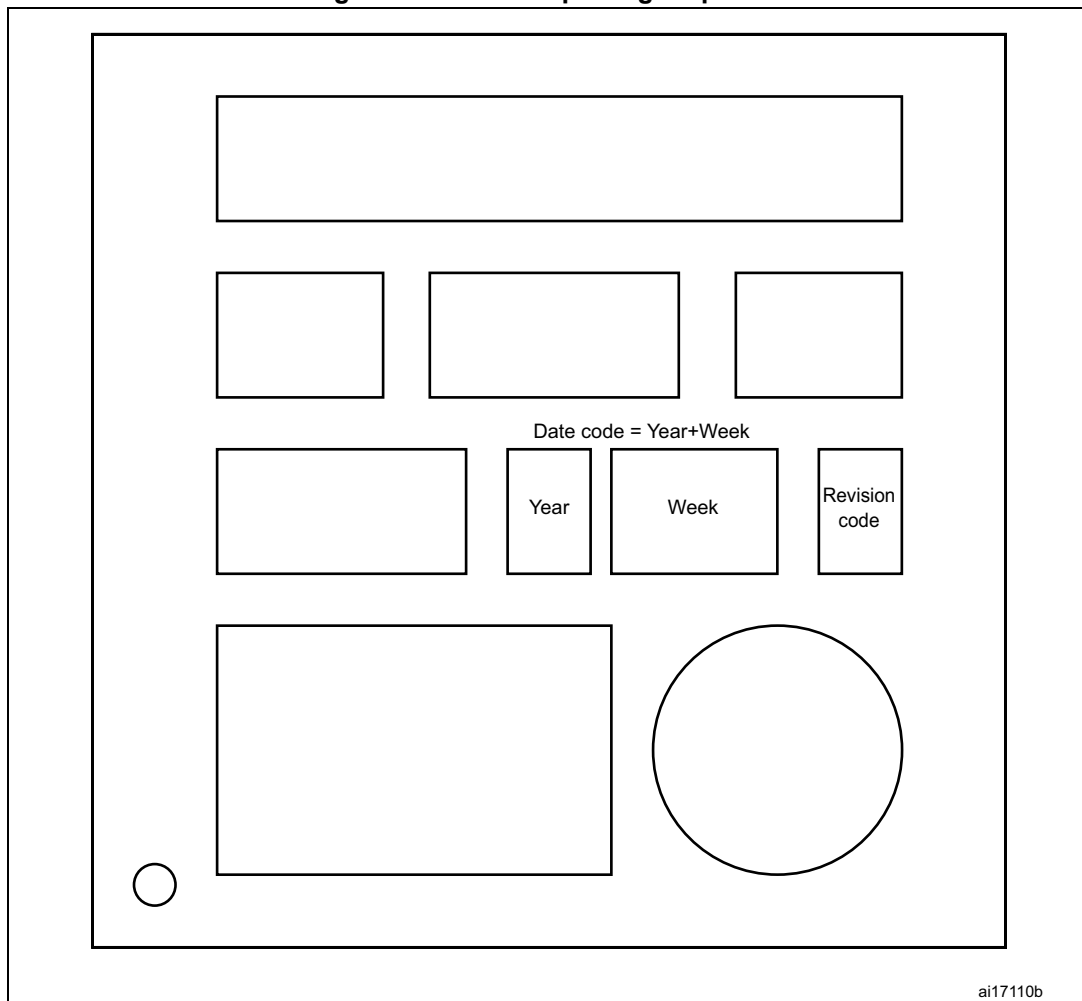


Figure 5. LQFP144 package top view

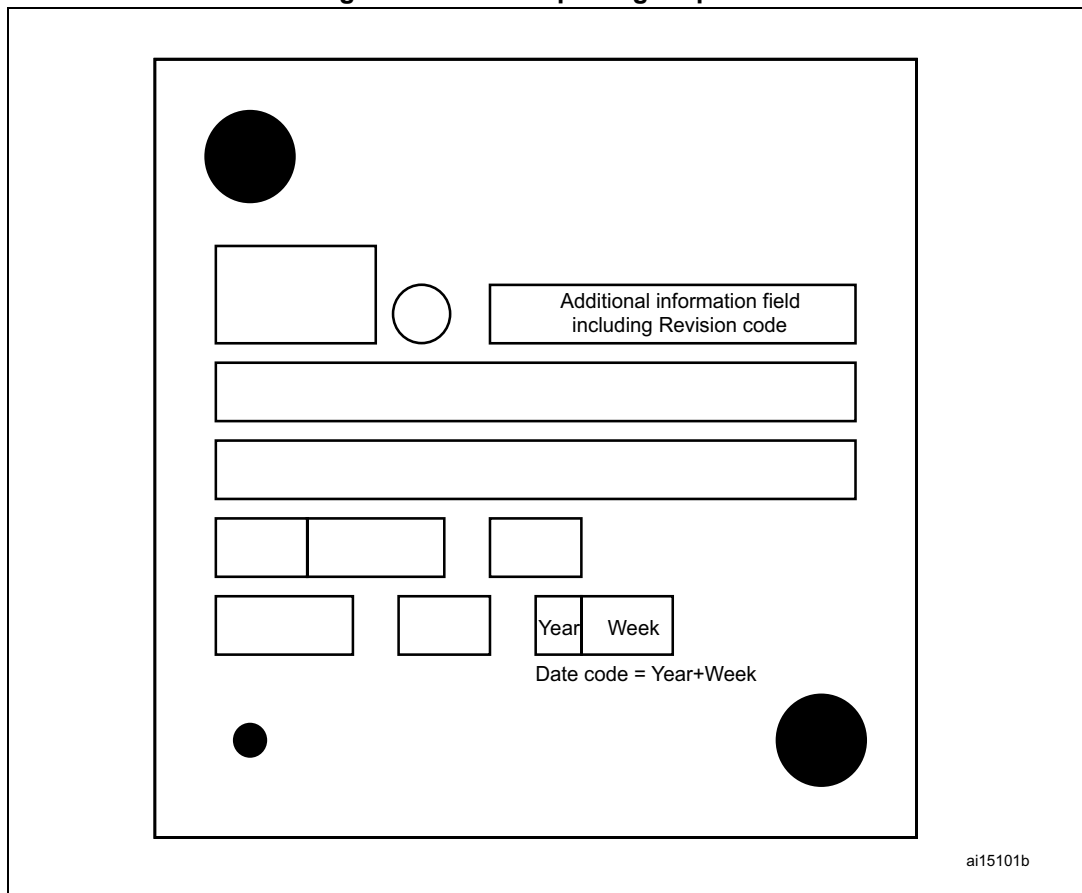


Figure 6. LQFP100 package top view


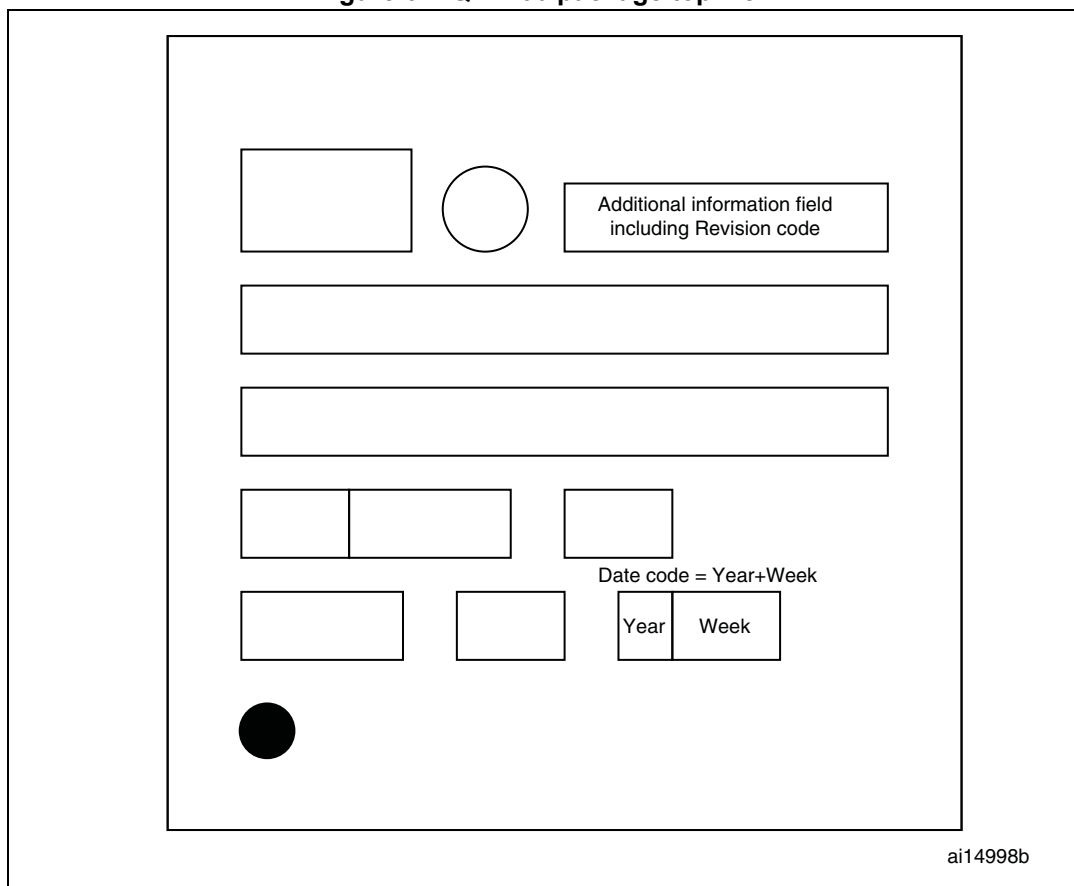


Figure 7. LQFP64 package top view

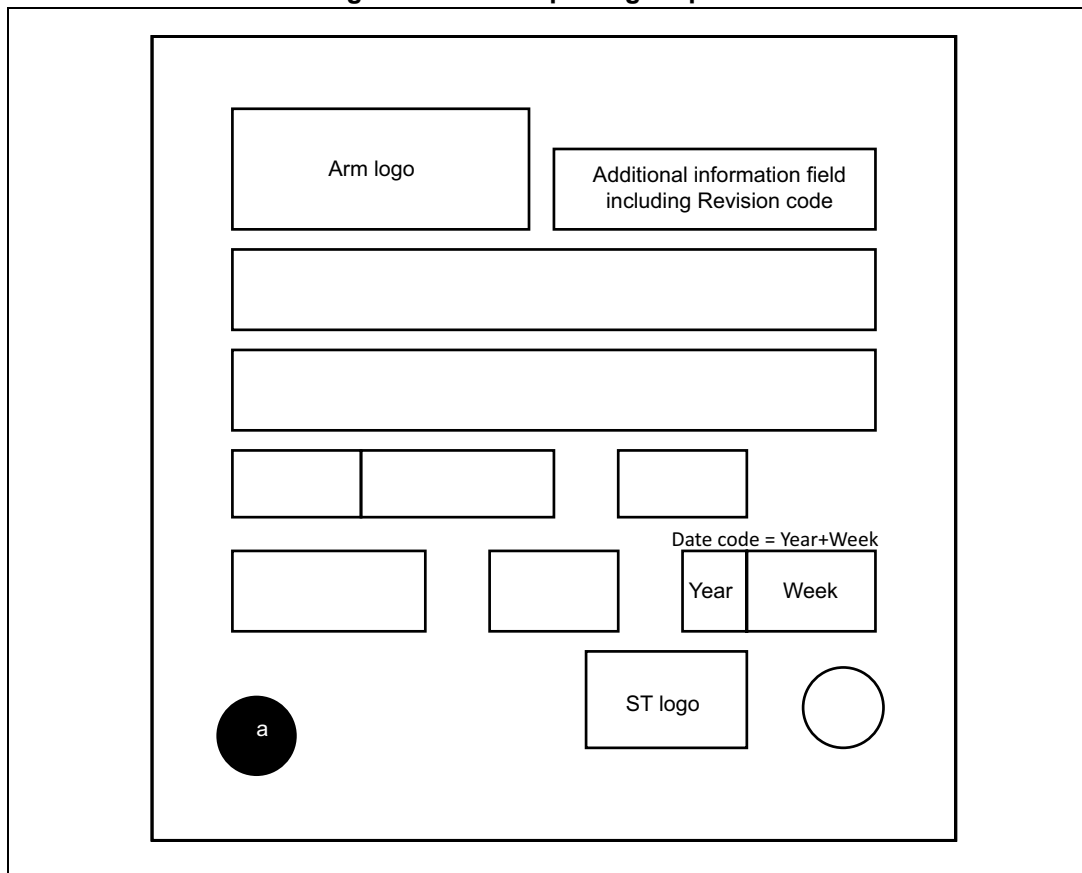

Revision history

Table 5. Document revision history

Date	Revision	Changes
23-May-2008	1	Initial release.
21-Jul-2008	2	Section 2.10: PVD and USB wakeup events added.
29-Sep-2008	3	Figure 7: LQFP64 package top view on page 47 corrected.
11-Feb-2009	4	<p>Section 1: Arm® 32-bit Cortex®-M3 limitations specified (Table 3: Cortex-M3 core limitations and impact on microcontroller behavior added limitations described).</p> <p>Limitation added: SPI3 in I²S slave mode: timing sensitivity between I2S3_WS and I2S3_CK on page 23.</p> <p>Added limitations:</p> <ul style="list-style-type: none"> – Boundary scan TAP: wrong pattern sent out after the “capture IR” state – Flash memory BSY bit delay versus STRT bit setting – I²C peripheral – Timers – LSI clock stabilization time – Section 2.21.1: Multimaster access on the FSMC memory map – Section 2.22.1: Limited multibyte support with SDIO cards <p>Table 4: Summary of silicon limitations on page 11 added.</p>
22-Jun-2009	5	<p>Introduction text updated in Section 2.9: Alternate functions.</p> <p>Section 2.9.10: FSMC with USART2 remapped updated.</p> <p>Section 2.9.11: FSMC with USART3 and TIM1 remapped added.</p> <p>Section 2.22.1: Limited multibyte support with SDIO cards clarified.</p> <p>Section 2.23.1: USB packet buffer memory: over/underrun or COUNTn_RX[9:0] field reporting incorrect number if APB1 frequency is below 13 MHz added.</p> <p>Figure 4: WLCSP64 package top view added.</p>
21-Jul-2009	6	Section 2.9.12: I2S2 in master/slave mode and USART3 in synchronous mode added.

Table 5. Document revision history

Date	Revision	Changes
11-Jan-2010	7	<p>Workaround modified in Section 2.11: SPI3 in I²S slave mode: timing sensitivity between I2S3_WS and I2S3_CK.</p> <p>Added limitations:</p> <ul style="list-style-type: none"> – Section 2.9.13: USARTx_TX pin usage – Section 2.15.4: Wrong behavior of I2C peripheral in master mode after a misplaced Stop – Section 2.15.5: Mismatch on the “Setup time for a repeated Start condition” timing parameter – Section 2.15.6: Data valid time (t_{VD;DAT}) violated without the OVR flag being set – Section 2.16.1: CRC still sensitive to communication clock when SPI is in slave mode even with NSS high – Section 2.23.1: USB packet buffer memory: over/underrun or COUNTn_RX[9:0] field reporting incorrect number if APB1 frequency is below 13 MHz <p>Date code added to Figure 2 to Figure 7.</p>
17-Jun-2010	8	<p>Updated for rev Y silicon</p> <p>Updated Table 4: Summary of silicon limitations with fix status.</p> <p>Added Section 2.4: Debugging Stop mode and system tick timer</p> <p>Added Section 2.5: Debugging Stop mode with WFE entry</p> <p>Added Section 2.21: FSMC limitations</p> <p>Added Section 2.15.2: Wrong data read into data register</p> <p>Updated Section 2.15.4: Wrong behavior of I2C peripheral in master mode after a misplaced Stop</p> <p>Modified section Section 2.16.2: SPI2/I2S2 slave mode wrong behavior in transmission and reception</p> <p>Added Section 2.18: USART peripheral</p> <p>Updated Section 2.15.6: Data valid time (t_{VD;DAT}) violated without the OVR flag being set</p>
21-Jan-2011	9	<p>Updated Section 2.9.9: FSMC with I2C1 and TIM4_CH2</p> <p>Added Section 2.17: I2S peripheral</p> <p>Added Section 2.18.6: nRTS signal abnormally driven low after a protocol violation</p>
07-Feb-2011	10	<p>Updated workarounds in Section 2.15.1: Some software events must be managed before the current byte is being transferred and Section 2.15.2: Wrong data read into data register</p>
20-Jun-2011	11	<p>Added reference to revision code 1 in Table 1</p> <p>Added Section 1.1.5: Interrupted loads to SP can cause erroneous behavior</p> <p>Section 1.1.6: SVC and BusFault/MemManage may occur out of order</p> <p>Section 2.22.2: Data errors in SDIO hardware flow control mode</p>

Table 5. Document revision history

Date	Revision	Changes
07-Oct-2013	12	Added: – <i>Section 2.6: Wakeup sequence from Standby mode when using more than one wakeup source</i> – <i>Section 2.7: LSE start-up in harsh environments</i> – <i>Section 2.15.7: I2C analog filter may provide wrong value, locking BUSY flag and preventing master mode entry</i> – <i>Section 2.16.3: SPI CRC may be corrupted when a peripheral connected to the same DMA channel of the SPI is under DMA transaction close to the end of transfer or end of transfer -1</i> – <i>Section 2.22.3: Wrong CCRCFAIL status after a response without CRC is received</i> – <i>Section 2.22.4: Data corruption in SDIO clock dephasing (NEGEDGE) mode</i> – <i>Section 2.22.5: CE-ATA multiple write command and card busy signal management</i> – <i>Section 2.22.6: No underrun detection with wrong data transmission</i> Updated: – <i>Section : Silicon identification</i> – <i>Table 1: Device Identification, “Revision code marked on device” column.</i> – <i>Table 2: Device summary</i> – <i>Table 4: Summary of silicon limitations.</i>
10-Apr-2014	13	Added - <i>Section 2.14: PC3 I/O pin not bonded in WCLSP64 package</i> - new limitation in <i>Table 4: Summary of silicon limitations</i>
26-Nov-2015	14	Updated: – <i>Silicon identification</i> – <i>Table 1: Device Identification</i>
17-Dec-2018	15	Updated: – <i>Table 4: Summary of silicon limitations</i>
16-Apr-2020	16	Updated <i>Section 1: Arm® 32-bit Cortex®-M3 limitations.</i> Updated <i>Table 4: Summary of silicon limitations.</i> Added <i>Section 2.8: RDP protection.</i> Updated <i>Figure 7: LQFP64 package top view.</i> Minor text edits across the whole document.

IMPORTANT NOTICE – PLEASE READ CAREFULLY

STMicroelectronics NV and its subsidiaries (“ST”) reserve the right to make changes, corrections, enhancements, modifications, and improvements to ST products and/or to this document at any time without notice. Purchasers should obtain the latest relevant information on ST products before placing orders. ST products are sold pursuant to ST’s terms and conditions of sale in place at the time of order acknowledgement.

Purchasers are solely responsible for the choice, selection, and use of ST products and ST assumes no liability for application assistance or the design of Purchasers’ products.

No license, express or implied, to any intellectual property right is granted by ST herein.

Resale of ST products with provisions different from the information set forth herein shall void any warranty granted by ST for such product.

ST and the ST logo are trademarks of ST. For additional information about ST trademarks, please refer to www.st.com/trademarks. All other product or service names are the property of their respective owners.

Information in this document supersedes and replaces information previously supplied in any prior versions of this document.

© 2020 STMicroelectronics – All rights reserved