

# AN5087 Application note

LSM303AH:

#### ultra-compact, high-performance eCompass module

#### Introduction

This document is intended to provide usage information and application hints related to ST's LSM303AH eCompass module.

The LSM303AH is a 3D digital magnetometer and 3D digital accelerometer system-in-package with a digital I²C and 3-wire SPI interface standard output. Thanks to the ultra-low noise performance of the magnetometer and to the ultra-low power of the accelerometer, the device combines always-on low-power features with superior sensing precision for an optimal motion experience for the consumer. The device features ultra low-power operational modes that allow advanced power saving and smart sleep-to-wake and return-to-sleep functions.

The device has a magnetic field dynamic range of  $\pm 50$  gauss and a user-selectable full scale acceleration range of  $\pm 2g/\pm 4g/\pm 8g/\pm 16g$ .

The LSM303AH can be configured to generate an interrupt signal for magnetic field detection and to automatically compensate for hard-iron offsets provided from the higher application layer.

It can be also configured to generate interrupt signals by using hardware recognition of free-fall events, 6D orientation, tap and double-tap sensing, activity or inactivity, and wake-up events.

The LSM303AH is compatible with the requirements of the leading OSs, offering real and virtual sensors. It has been designed to implement in hardware significant motion, tilt, and pedometer functions.

The LSM303AH has an integrated 256-level first-in first-out (FIFO) buffer allowing the user to store accelerometer data in order to limit intervention by the host processor.

The LSM303AH is available in a small thin plastic land grid array package (LGA) and it is guaranteed to operate over an extended temperature range from -40 °C to +85 °C.

The ultra-small size and weight of the SMD package make it an ideal choice for handheld portable applications such as smartphones, IoT connected devices, and wearables or any other application where reduced package size and weight are required.

Contents AN5087

# **Contents**

1	Pin c	description	7
	1.1	INT_MAG/DRDY pin configuration	9
2	Regi	sters	0
	2.1	Advanced configuration registers	3
3	Magı	netometer operating modes14	4
	3.1	Idle mode	4
	3.2	Continuous mode	5
	3.3	Single mode	5
4	Magı	netometer power modes10	6
5	Magı	netometer low-pass filter	7
6	Read	ding magnetometer output data18	8
	6.1	Startup sequence	8
	6.2	Using the status register	8
	6.3	Using the data-ready signal19	9
	6.4	Using the block data update (BDU) feature	9
	6.5	Understanding output data	9
		6.5.1 Example of output data	0
		6.5.2 Big-little endian selection	0
7	Magı	netometer reboot and software reset	1
8	Magı	netometer offset cancellation	2
9	Magı	netometer hard-iron compensation	3
10	Magı	netometer interrupt generation	4
	10.1	Interrupt configuration example	
	10.2	Overflow interrupt	5



11	Magr	netometer self-test
12	Acce	lerometer operating modes
	12.1	Power-down
	12.2	High-resolution/high-frequency mode
	12.3	Low-power mode
	12.4	Accelerometer bandwidth
		12.4.1 Accelerometer slope filter
13	Read	ling accelerometer output data
	13.1	Startup sequence
	13.2	Using the status register
	13.3	Using the data-ready signal
	13.4	Using the block data update (BDU) feature
	13.5	Understanding output data
		13.5.1 Example of output data
14	Acce	lerometer interrupt generation and embedded functions 35
	14.1	Interrupt pin configuration
	14.2	Event status
	14.3	Free-fall interrupt
	14.4	Wake-up interrupt
	14.5	6D/4D orientation detection
		14.5.1 6D orientation detection
		14.5.2 4D orientation detection
	14.6	Single-tap and double-tap recognition
		14.6.1 Single tap
		14.6.2 Double tap
		14.6.3 Single-tap and double-tap recognition configuration
		14.6.4 Single-tap example
	447	14.6.5 Double-tap example
	14.7	Activity/Inactivity recognition
	14.8	Boot status
	14.9	Embedded functions
		14.9.1 Pedometer functions: step detector and step counter 51

		14.9.2	Significant motion	54
		14.9.3	Tilt	
15	Acce	leromet	ter First-In First-Out (FIFO) buffer .........5	7
	15.1	FIFO d	escription	57
	15.2	FIFO re	egisters5	59
		15.2.1	FIFO_CTRL_A register (25h)	59
		15.2.2	FIFO_THS_A register (2Eh)5	59
		15.2.3	FIFO_SRC_A (2Fh)	30
		15.2.4	FIFO_SAMPLES_A (30h)6	31
	15.3	FIFO ir	nterrupts6	31
		15.3.1	FIFO threshold6	31
		15.3.2	FIFO full6	31
	15.4	Module	e-to-FIFO	32
	15.5	FIFO m	nodes	32
		15.5.1	Bypass mode	32
		15.5.2	FIFO mode	32
		15.5.3	Continuous mode	34
		15.5.4	Continuous-to-FIFO mode	35
		15.5.5	Bypass-to-Continuous mode	36
	15.6	Retriev	ing data from FIFO6	37
16	Acce	leromet	ter self-test	8
17	Temp	perature	e sensor	'0
	17.1	Examp	le of temperature data calculation	'0
18	Revi	sion his	tory	'1

Contents

AN5087 List of tables

# List of tables

Table 1.	Pin description	8
Table 2.	INT_MAG/DRDY pin configuration	9
Table 3.	Registers	. 10
Table 4.	Advanced configuration registers	. 13
Table 5.	Operative modes	. 14
Table 6.	Output data rate configuration	. 15
Table 7.	Maximum ODR in single mode	. 15
Table 8.	Current consumption	. 16
Table 9.	Operating mode and turn-on time	. 16
Table 10.	RMS noise of operating modes	. 17
Table 11.	Accelerometer ODR and power mode selection	. 28
Table 12.	Power consumption	. 29
Table 13.	Accelerometer LPF1 cutoff frequency	. 30
Table 14.	CTRL4_A register	. 36
Table 15.	CTRL5_A register	. 36
Table 16.	Free-fall threshold LSB value	. 38
Table 17.	6D_SRC_A register	
Table 18.	Threshold for 4D/6D function	. 41
Table 19.	6D_SRC_A register for 6D positions	. 43
Table 20.	TAP_SRC_A register	. 47
Table 21.	SMD threshold	
Table 22.	FIFO buffer full representation (256 <sup>th</sup> sample set stored)	
Table 23.	FIFO buffer full representation (257 <sup>th</sup> sample set stored and 1st sample discarded)	
Table 24.	FIFO_CTRL_A register	
Table 25.	FIFO_THS_A register	
Table 26.	FIFO_SRC_A register	
Table 27.	FIFO_SRC_A behavior assuming FTH[7:0] = 15	
Table 28.	FIFO_SAMPLES_A register	
Table 29.	Example: threshold function of ODR	
Table 30.	Output data registers content vs. temperature	
Table 31.	Document revision history	. 71



List of figures AN5087

# List of figures

Figure 1.	Pin connections	7
Figure 2.	Magnetometer filtering chain	17
Figure 3.	Interrupt function	24
Figure 4.	Magnetometer self-test procedure	27
Figure 5.	Accelerometer sampling chain	30
Figure 6.	Accelerometer slope filter	31
Figure 7.	Data-ready signal	33
Figure 8.	Free-fall interrupt	37
Figure 9.	Wake-up interrupt	40
Figure 10.	6D recognized orientations	42
Figure 11.	Single-tap event recognition	44
Figure 12.	Double-tap event recognition (LIR bit = 0)	45
Figure 13.	Single and double-tap event recognition (LIR bit = 0)	47
Figure 14.	Activity/Inactivity recognition	
Figure 15.	Minimum threshold	
Figure 16.	FIFO mode behavior	63
Figure 17.	Continuous mode with interrupt trigger	64
Figure 18.	Continuous-to-FIFO mode: interrupt latched and non-latched	65
Figure 19.	Bypass-to-Continuous mode	66
Figure 20	Accelerometer self-test procedure	60

DocID031070 Rev 1



AN5087 Pin description

# Pin description

11 12 SCL/SPC Vdd\_IO TOP VIEW cs Vdd **DIRECTION OF** DETECTABLE **ACCELERATIONS** Reserved GND 6 5 SDA/SDI/SDO INT\_MAG/DRDY  $^{\circ}$ (BOTTOM VIEW) TOP VIEW DIRECTION OF DETECTABLE MAGNETIC FIELDS

Figure 1. Pin connections

Pin description AN5087

Table 1. Pin description

Pin #	Name	Function	Pin status
1	SCL SPC	I²C serial clock (SCL) SPI serial port clock (SPC)	Default: input without pull-up
2	CS	l²C/SPI mode selection 1: SPI idle mode / l²C communication enabled; 0: SPI communication mode / l²C disabled	Default: input without pull-up
3	Reserved	Connect to GND	
4	SDA SDI SDO	I <sup>2</sup> C serial data (SDA) SPI serial data input (SDI) 3-wire interface serial data output (SDO)	Default: (SDA) input without pull-up
5	C1	Capacitor connection (C1 = 220 nF)	External capacitor, voltage forced by the device
6	GND	0 V supply	
7	INT_MAG/ DRDY	Magnetometer interrupt/data-ready signal	Default: output high impedance
8	GND	0 V supply	
9	Vdd	Power supply	
10	Vdd_IO	Power supply for I/O pins	
11	INT2_XL	Accelerometer interrupt pin 2	Default: push-pull output forced to GND
12	INT1_XL	Accelerometer interrupt pin 1	Default: push-pull output forced to GND

AN5087 Pin description

#### 1.1 INT\_MAG/DRDY pin configuration

The INT\_MAG/DRDY pin can be configured to have one HW signal to determine when a new set of measurement data is available for reading or when an interrupt event occurs.

The Zyxda data-ready signal in the STATUS\_REG\_M register can be driven to the INT\_MAG/DRDY pin by setting the INT\_MAG bit in the CFG\_REG\_C\_M register to 1 (see *Section 6.3: Using the data-ready signal* for further details).

The INT signal in the INT\_SOURCE\_REG\_M register can be driven to the INT\_MAG/DRDY pin by setting the INT\_MAG\_PIN bit in CFG\_REG\_C\_M to 1 (see Section 10: Magnetometer interrupt generation for further details).

Note:

Both the INT\_MAG and INT\_MAG\_PIN bits in CFG\_REG\_C\_M configure the INT\_MAG/DRDY pin as a digital output, but only one signal (INT or DRDY) can be routed on the INT\_MAG/DRDY pin. If both bits are asserted, only the INT signal is routed as shown in following table.

The table below summarizes the INT\_MAG/DRDY pin status and functionality in different configurations of the INT\_MAG and INT\_MAG\_PIN bits of the CFG\_REG\_C\_M register.

INT\_MAG/DRDY INT\_MAG/DRDY INT\_MAG\_PIN INT\_MAG pin status pin function 0 0 High impedance output None 1 0 Push-pull output DRDY (Zyxda) signal routed 0 1 Push-pull output INT signal routed 1 1 Push-pull output INT signal routed

Table 2. INT\_MAG/DRDY pin configuration

# Table 3. Registers

Register name	Addr	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
Module_8bit_A	0Ch	Module_7	Module_6	Module_5	Module_4	Module_3	Module_2	Module_1	Module_0
WHO_AM_I_A	0Fh	0	1	0	0	0	0	1	1
CTRL1_A	20h	ODR3	ODR2	ODR1	ODR0	FS1	FS0	HF_ODR	BDU
CTRL2_A	21h	воот	SOFT_ RESET	0	FUNC_CFG_ EN	FDS_SLOPE	IF_ADD_INC	I2C_ DISABLE	SPI_ENABLE
CTRL3_A	22h	ST2	ST1	TAP_X_EN	TAP_Y_EN	TAP_Z_EN	LIR	H_LACTIVE	PP_OD
CTRL4_A	23h	0	INT1_S_TAP	INT1_WU	INT1_FF	INT1_TAP	INT1_6D	INT1_FTH	INT1_DRDY
CTRL5_A	24h	DRDY _PULSED	INT2_BOOT	INT2_ON _INT1	INT2_TILT	INT2_SIG_ MOT	INT2_STEP	INT2_FTH	INT2_DRDY
FIFO_CTRL_A	25h	FMODE2	FMODE1	FMODE0	INT_STEP_ COUNT_OV	MODULE_ TO_FIFO	0	0	IF_CS_PU _DIS
OUT_T_A	26h	TEMP7	TEMP6	TEMP5	TEMP4	TEMP3	TEMP2	TEMP1	TEMP0
STATUS_A	27h	FIFO_THS	WU_IA	SLEEP _STATE	DOUBLE _TAP	SINGLE _TAP	6D_IA	FF_IA	DRDY
OUTX_L_A	28h	X_L7	X_L6	X_L5	X_L4	X_L3	X_L2	0	0
OUTX_H_A	29h	X_H7	X_H6	X_H5	X_H4	X_H3	X_H2	X_H1	X_H0
OUTY_L_A	2Ah	Y_L7	Y_L6	Y_L5	Y_L4	Y_L3	Y_L2	0	0
OUTY_H_A	2Bh	Y_H7	Y_H6	Y_H5	Y_H4	Y_H3	Y_H2	Y_H1	Y_H0
OUTZ_L_A	2Ch	Z_L7	Z_L6	Z_L5	Z_L4	Z_L3	Z_L2	0	0
OUTZ_H_A	2Dh	Z_H7	ZH_6	Z_H5	ZH_4	Z_H3	Z_H2	Z_H1	Z_H0
FIFO_THS_A	2Eh	FTH7	FTH6	FTH5	FTH4	FTH3	FTH2	FTH1	FTH0
FIFO_SRC_A	2Fh	FTH	FIFO_OVR	DIFF8	0	0	0	0	0
FIFO_SAMPLES_A	30h	DIFF7	DIFF6	DIFF5	DIFF4	DIFF3	DIFF2	DIFF1	DIFF0
TAP_6D_THS_A	31h	4D_EN	6D_THS1	6D_THS0	TAP_THS4	TAP_THS3	TAP_THS2	TAP_THS1	TAP_THS0

			Table 3. R	egisters
1				

Register name	Addr	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
INT_DUR_A	32h	LAT3	LAT2	LAT1	LAT0	QUIET1	QUIET0	SHOCK1	SHOCK0
WAKE_UP_THS_A	33h	SINGLE_ DOUBLE_TAP	SLEEP_ON	WU_THS5	WU_THS4	WU_THS3	WU_THS2	WU_THS1	WU_THS0
WAKE_UP_DUR_A	34h	FF_DUR5	WU_DUR1	WU_DUR0	INT1_FSS7	SLEEP_ DUR3	SLEEP_ DUR2	SLEEP_ DUR1	SLEEP_ DUR0
FREE_FALL_A	35h	FF_DUR4	FF_DUR3	FF_DUR2	FF_DUR1	FF_DUR0	FF_THS2	FF_THS1	FF_THS0
STATUS_DUP_A	36h	OVR	WU_IA	SLEEP _STATE	DOUBLE _TAP	SINGLE_ TAP	6D_IA	FF_IA	DRDY
WAKE_UP_SRC_A	37h	0	0	FF_IA	SLEEP_ STATE_IA	WU_IA	X_WU	Y_WU	Z_WU
TAP_SRC_A	38h	0	TAP_IA	SINGLE _TAP	DOUBLE _TAP	TAP_SIGN	X_TAP	Y_TAP	Z_TAP
6D_SRC_A	39h	0	6D_IA	ZH	ZL	YH	YL	XH	XL
STEP_COUNTER_ MINTHS_A	3Ah	RST_NSTEP	PEDO4g	SC_MTHS5	SC_MTHS4	SC_MTHS3	SC_MTHS2	SC_MTHS1	SC_MTHS0
STEP_COUNTER_ L_A	3Bh	nSTEP_L7	nSTEP_L6	nSTEP_L5	nSTEP_L4	nSTEP_L3	nSTEP_L2	nSTEP_L1	nSTEP_L0
STEP_COUNTER_ H_A	3Ch	nSTEP_H7	nSTEP_H6	nSTEP_H5	nSTEP_H4	nSTEP_H3	nSTEP_H2	nSTEP_H1	nSTEP_H0
FUNC_CK_GATE_A	3Dh	TILT_INT	FS_SRC1	FS_SRC0	SIG_MOT_ DETECT	RST_SIG_ MOT	RST_PEDO	STEP_ DETECT	CK_GATE_ FUNC
FUNC_SRC_A	3Eh	0	0	0	0	0	RST_TILT	MODULE_ READY	0
FUNC_CTRL_A	3Fh	0	0	MODULE_ ON	TILT_ON	0	0	SIG_MOT_ ON	STEP_CNT _ON
OFFSET_ X_REG_L_M	45h	Offset_X_7	Offset_X_6	Offset_X_5	Offset_X_4	Offset_X_3	Offset_X_2	Offset_X_1	Offset_X_0
OFFSET_ X_REG_H_M	46h	Offset_X_15	Offset_X_14	Offset_X_13	Offset_X_12	Offset_X_11	Offset_X_10	Offset_X_9	Offset_X_8

# Table 3. Registers

Register name	Addr	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
OFFSET_ Y_REG_L_M	47h	Offset_Y_7	Offset_Y_6	Offset_Y_5	Offset_Y_4	Offset_Y_3	Offset_Y_2	Offset_Y_1	Offset_Y_0
OFFSET_ Y_REG_H_M	48h	Offset_Y_15	Offset_Y_14	Offset_Y_13	Offset_Y_12	Offset_Y_11	Offset_Y_10	Offset_Y_9	Offset_Y_8
OFFSET_ Z_REG_L_M	49h	Offset_Z_7	Offset_Z_6	Offset_Z_5	Offset_Z_4	Offset_Z_3	Offset_Z_2	Offset_Z_1	Offset_Z_0
OFFSET_ Z_REG_H_M	4Ah	Offset_Z_15	Offset_Z_14	Offset_Z_13	Offset_Z_12	Offset_Z_11	Offset_Z_10	Offset_Z_9	Offset_Z_8
WHO_AM_I_M	4Fh	0	1	0	0	0	0	0	0
CFG_REG_A_M	60h	COMP_ TEMP_EN <sup>(1)</sup>	REBOOT	SOFT_RST	LP	ODR1	ODR0	MD1	MD0
CFG_REG_B_M	61h	0	0	0	OFF_CANC_ ONE_SHOT	INT_on_ DataOFF	Set_FREQ	OFF_CANC	LPF
CFG_REG_C_M	62h	0	INT_MAG_ PIN	I2C_DIS	BDU	BLE	0	Self_test	INT_MAG
INT_CTRL_REG_M	63h	XIEN	YIEN	ZIEN	0	0	IEA	IEL	IEN
INT_SOURCE_ REG_M	64h	P_TH_S_X	P_TH_S_Y	P_TH_S_Z	N_TH_S_X	N_TH_S_Y	N_TH_S_Z	MROI	INT
INT_THS_L_REG_M	65h	TH7	TH6	TH5	TH4	TH3	TH2	TH1	TH0
INT_THS_H_REG_M	66h	TH15	TH14	TH13	TH12	TH11	TH10	TH9	TH8
STATUS_REG_M	67h	Zyxor	zor	yor	xor	Zyxda	zda	yda	xda
OUTX_L_REG_M	68h	D7	D6	D5	D4	D3	D2	D1	D0
OUTX_H_REG_M	69h	D15	D14	D13	D12	D11	D10	D9	D8
OUTY_L_REG_M	6Ah	D7	D6	D5	D4	D3	D2	D1	D0
OUTY_H_REG_M	6Bh	D15	D14	D13	D12	D11	D10	D9	D8
OUTZ_L_REG_M	6Ch	D7	D6	D5	D4	D3	D2	D1	D0
OUTZ_H_REG_M	6Dh	D15	D14	D13	D12	D11	D10	D9	D8

<sup>1.</sup> For proper operation of the magnetometer sensor, the COMP\_TEMP\_EN bit in the CFG\_REG\_A\_M register must be set to 1 by the user.



# 2.1 Advanced configuration registers

The advanced configuration registers are used to configure specific device functions such as the pedometer and sensor hub. To switch to the advanced configuration register page, the FUNC\_CFG\_EN bit must be set to '1' in CTRL2\_A (21h). To go back to the standard register page, the FUNC\_CFG\_EN bit must be set to '0' in register CTRL2\_A (3Fh).

Note: All modifications to the content of the advanced configuration registers have to be performed with the accelerometer sensor in power-down mode.

**Table 4. Advanced configuration registers** 

Register name	Addr	Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
PEDO_DEB_ REG_A	2Bh	DEB_TIME4	DEB_TIME3	DEB_TIME2	DEB_TIME1	DEB_TIME0	DEB_STEP2	DEB_STEP1	DEB_STEP0
SM_THS_A	34h	SM_THS_7	SM_THS_6	SM_THS_5	SM_THS_4	SM_THS_3	SM_THS_2	SM_THS_1	SM_THS_0
STEP_COUNT_ DELTA_A	3Ah	STEP_ COUNT_D7	STEP_ COUNT_D6	STEP_ COUNT_D5	STEP_ COUNT_D4	STEP_ COUNT_D3	STEP_ COUNT_D2	STEP_ COUNT_D1	STEP_ COUNT_D0
CTRL2_A	3Fh	BOOT <sup>(1)</sup>	SW_ RESET <sup>(1)</sup>	0 <sup>(1)</sup>	FUNC_CFG_ EN	FDS_ SLOPE <sup>(1)</sup>	IF_ADD_ INC <sup>(1)</sup>	I2C_ DISABLE <sup>(1)</sup>	SIM <sup>(1)</sup>

<sup>1.</sup> Read-only bit

# 3 Magnetometer operating modes

The LSM303AH magnetometer provides three operating modes:

- Idle mode;
- Continuous mode;
- · Single mode.

After the power supply is applied, the magnetometer performs a 20 ms boot procedure to load the trimming parameters. After the boot is completed, the magnetometer is automatically configured in Idle mode.

In order to avoid potential conflicts, during the power-on sequence it is recommended to set the lines connected to the device IO pins to high-impedance state on the host side. Furthermore, to guarantee proper power-off of the device it is recommended to maintain the duration of the Vdd line to GND for at least  $100 \, \mu s$ .

The operating modes of the magnetometer can be set through the MD[1:0] bits of CFG\_REG\_A\_M as shown in table below.

MD1	MD0	Mode
0	0	Continuous mode
0	1	Single mode
1	0	Idle mode
1	1	Idle mode

Table 5. Operative modes

In all three operating modes, the typical value of the magnetic dynamic range is 50 gauss which applies when the magnetic field is fully aligned to one of the sensitive axes. In presence of a stray field in the cross-axis direction, the magnetic dynamic range can decrease down to 25 gauss (in the worst case).

#### 3.1 Idle mode

When the magnetometer is in Idle mode, almost all internal blocks of the device are switched off to minimize power consumption. Digital interfaces (I<sup>2</sup>C and SPI) are still active to allow communication with the device. The content of the configuration registers is preserved and the output data registers are not updated, keeping the last data sampled in memory before going into idle mode.



#### 3.2 Continuous mode

Continuous mode can be enabled by writing the MD[1:0] bits to 00 in CFG\_REG\_A\_M register.

In Continuous mode the device continuously performs measurements and places the result in the output data registers. Either High-Resolution or Low-Power mode can be selected by configuring the LP bit in CFG\_REG\_A\_M (please refer to Section 4: Magnetometer power modes).

In Continuous mode the output data rate can be selected using the ODR[1:0] bits of CFG\_REG\_A\_M register as shown in table below.

ODR1	ODR0	ODR (Hz)
0	0	10 (default)
0	1	20
1	0	50
1	1	100

Table 6. Output data rate configuration

#### 3.3 Single mode

The LSM303AH magnetometer offers Single mode in both High-Resolution and Low-Power modes (please refer to *Section 4: Magnetometer power modes*).

Single mode configuration allows performing a single acquisition upon request; the acquisition is triggered by writing the MD[1:0] bits to 01 in the CFG\_REG\_A\_M register. Once the measurement has been performed, the Zyxda, zda, yda, xda bits of the STATUS\_REG\_M register are asserted, data are available in the output registers and the magnetometer is automatically configured in Idle mode by setting the MD[1:0] bits to 11.

Single mode is independent of the programmed ODR: it depends on the frequency at which the MD[1:0] bits are written by the microcontroller/application processor. Maximum ODR frequency achievable in Single mode is given in the following table and strictly depends on the power mode selected (please refer to Section 4: Magnetometer power modes).

 Power mode (LP bit of CFG\_REG\_A\_M register)
 Maximum ODR [Hz]

 High-Resolution (LP = 0)
 100

 Low-Power (LP = 1)
 150

Table 7. Maximum ODR in single mode

In Single mode, the typical time needed for the generation of the new data corresponds to the turn-on time indicated in *Table 9: Operating mode and turn-on time*.

#### 4 Magnetometer power modes

The LSM303AH magnetometer provides two power modes, operating with the device configured either in Continuous or Single mode:

- High-Resolution mode;
- Low-Power mode.

The power mode can be selected by configuring the LP bit of CFG\_REG\_A\_M register: if the LP bit is asserted, the device operates in Low-Power mode, otherwise it operates in High-Resolution mode (default configuration).

In both Low-Power mode and High-Resolution mode, the magnetometer circuitry is periodically turned on/off with a duty cycle that is a function of the selected ODR and data interrupt generation is active.

The difference distinguishing the two modes is in the number of samples used to generate each output sample, which is four times less in Low-Power mode than the number used in High-Resolution mode, thus ensuring a lower power consumption.

The table below summarizes the current consumption of the two power modes with offset cancellation disabled/enabled (the sensor offset cancellation feature can be configured using the OFF\_CANC bit of CFG\_REG\_B\_M register - please refer to Section 8:

Magnetometer offset cancellation).

**Current consumption Current consumption Current consumption Current consumption** ODR (LP = 0 and(LP = 1 and)(LP = 0 and(LP = 1 and) $OFF_CANC = 0$  $OFF_CANC = 0$  $OFF_CANC = 1)$  $OFF_CANC = 1)$ [Hz] [uA] [uA] [uA] [uA] 100 25 120 50 10 20 200 50 235 100 50 475 125 575 235 100 950 250 1130 460

**Table 8. Current consumption** 

The following table summarizes the turn-on time of the device in the two different power modes with the offset cancellation function enabled or disabled (see *Section 8: Magnetometer offset cancellation*).

Table 9. Operating mode and turn-on time

Operating mode	Turn-on time			
CFG_REG_A_M[LP]	CFG_REG_A_M[OFF_CANC = 0]	CFG_REG_A_M[OFF_CANC = 1]		
0 (High-Resolution)	9.4 ms	9.4 ms + 1/ODR		
1 (Low-Power)	6.4 ms	6.4 ms + 1/ODR		



#### **Magnetometer low-pass filter** 5

The LSM303AH magnetometer embeds a digital low-pass filter in order to reduce noise. The filter can be enabled by setting the LPF bit in CFG\_REG\_B\_M.

OUTPUT SPI / I<sup>2</sup>C REGISTERS HARD-IRON CORRECTION LP Filter INT\_MAG/DRDY INTERRUPT PIN **ADC** INT\_on\_DataOFF LPF OFF\_CANC

Figure 2. Magnetometer filtering chain

The table below summarizes the bandwidth and RMS noise values in different device configurations.

When the low-pass filter is enabled, the bandwidth is reduced while noise performance is improved without any increase in power consumption.

Note:

The offset cancellation feature (please refer to Section 8: Magnetometer offset cancellation) works as a two-level moving average filter, thus giving the same bandwidth and noise performance as with the LPF filter enabled.

LP = 0**LP = 1** LPF or OFF\_CANC BW [Hz] Noise RMS [mg] BW [Hz] Noise RMS [mg] 9 0 (disable) ODR/2 4.5 ODR/2 ODR/4 3 6 1 (enable) ODR/4

Table 10. RMS noise of operating modes

#### 6 Reading magnetometer output data

#### 6.1 Startup sequence

Once the device is powered up, the magnetometer automatically downloads the calibration coefficients from the embedded flash to the internal registers. When the boot procedure is completed (it takes 20 ms), the magnetometer automatically enters Idle mode.

To turn on the magnetometer and gather magnetic data, it is necessary to select one of the operating modes through the CFG\_REG\_A\_M register.

The following general-purpose sequence can be used to configure the magnetometer:

Writing 81h in CFG\_REG\_A\_M instead of 80h will set the magnetometer to operate in Single mode instead of Continuous mode.

#### 6.2 Using the status register

The device is provided with a STATUS\_REG\_M register which should be polled to check when a new set of data is available (Zyxda = 1).

The reads should be performed as follows:

- Read STATUS\_REG\_M
- 2. If Zyxda = 0, then go to 1
- 3. Read OUTX L REG M
- 4. Read OUTX\_H\_REG\_M
- Read OUTY\_L\_REG\_M
- 6. Read OUTY\_H\_REG\_M
- 7. Read OUTZ\_L\_REG\_M
- 8. Read OUTZ\_H\_REG\_M
- 9. Data processing
- 10. Go to 1

If the magnetometer is configured in Single mode instead of Continuous mode, the routine will be stuck at step 1 after one execution, since the device performs a single measurement, sets the Zyxda bit high and returns to idle mode. Please note that the MD bits return to Idle mode values. It is possible to trigger another single read by setting the MD bits to 01.

#### 6.3 Using the data-ready signal

The magnetometer can be configured to have one HW signal to determine when a new set of measurement data is available for reading.

The data-ready signal (DRDY) is represented by the Zyxda bit of the STATUS\_REG\_M register. This signal can be driven to the INT\_MAG/DRDY pin by setting the INT\_MAG bit of the CFG\_REG\_C\_M register to 1.

The data-ready signal rises to 1 when a new set of data has been generated and it is available for reading. The signal gets reset when the higher part of one of the channels has been read (OUTX\_H\_REG\_M, OUTY\_H\_REG\_M and OUTZ\_H\_REG\_M registers).

#### 6.4 Using the block data update (BDU) feature

If reading the magnetometer data is particularly slow and cannot be synchronized (or it is not required) with either the Zyxda event bit in the STATUS\_REG\_M register or with the data-ready signal driven to the INT\_MAG/DRDY pin, it is strongly recommended to set the BDU (block data update) bit to 1 in the CFG\_REG\_C\_M register.

This feature avoids reading values (most significant and least significant parts of output data) related to different samples. In particular, when the BDU is activated, the data registers related to each channel always contain the most recent output data produced by the device, but, in case the read of a given pair (i.e. OUTX\_H\_REG\_M and OUTX\_L\_REG\_M, OUTY\_H\_REG\_M and OUTY\_L\_REG\_M, OUTZ\_H\_REG\_M and OUTZ\_L\_REG\_M) is initiated, the refresh for that pair is blocked until both MSB and LSB parts of the data are read.

Note:

BDU only guarantees that the LSB part and MSB part have been sampled at the same moment. For example, if the reading speed is too slow, X and Y can be read at T1 and Z sampled at T2.

#### 6.5 Understanding output data

The measured magnetic data are sent to the OUTX\_H\_REG\_M, OUTX\_L\_REG\_M, OUTY\_H\_REG\_M, OUTY\_L\_REG\_M, OUTZ\_H\_REG\_M, and OUTZ\_L\_REG\_M registers. These registers contain, respectively, the most significant part and the least significant part of the magnetic signals acting on the X, Y, and Z axes.

The complete output data for the X, Y, Z channels is given by the concatenation OUTX\_H\_REG\_M & OUTX\_L\_REG\_M, OUTY\_H\_REG\_M & OUTY\_L\_REG\_M, OUTZ H REG M & OUTZ L REG M and it is expressed as a two's complement number.

Magnetic data is represented as 16-bit numbers, called LSB. It must be multiplied by the proper sensitivity parameter,  $M_So = 1.5 \text{ mG} / \text{LSB}$ , in order to obtain the corresponding value in mG.



#### 6.5.1 Example of output data

Hereafter is a simple example of how to use the LSB data and transform it into mG.

Get raw data from the sensor:

```
OUTX_L_REG_M: 21h
OUTX_H_REG_M: 00h
OUTY_L_REG_M: 1Dh
OUTY_H_REG_M: FFh
OUTZ_L_REG_M: CBh
OUTZ_H_REG_M: FEh
```

#### Do registers concatenation:

```
OUTY_H_REG_M & OUTY_L_REG_M: 0021h
OUTY_H_REG_M & OUTY_L_REG_M: FF1Dh
OUTZ_H_REG_M & OUTZ_L_REG_M: FECBh
```

Calculate signed decimal value (two's complement format):

```
X: +33
Y: -227
Z: -309
```

#### Apply sensitivity:

```
X: +33 * 1.5 = +49.5 \text{ mG}

Y: -227 * 1.5 = -340.5 \text{ mG}

Z: -309 * 1.5 = -463.5 \text{ mG}
```

#### 6.5.2 Big-little endian selection

The LSM303AH magnetometer allows swapping the content of the lower and the upper part of the output data registers (i.e. OUTX\_H\_REG\_M with OUTX\_L\_REG\_M) in order to be compliant with both little-endian and big-endian data representations.

"Little Endian" means that the low-order byte of the number is stored in memory at the lowest address, and the high-order byte at the highest address. This mode corresponds to the BLE bit of the CFG\_REG\_C\_M register set to 0 (default configuration).

On the contrary, "Big Endian" means that the high-order byte of the number is stored in memory at the lowest address, and the low-order byte at the highest address. This mode corresponds to the BLE bit of the CFG\_REG\_C\_M register set to 1.

### 7 Magnetometer reboot and software reset

After the device is powered up, the LSM303AH magnetometer performs a 20 ms boot procedure to load the trimming parameters. After the boot is completed, the magnetometer is automatically configured in Idle mode.

During the boot time the registers are not accessible.

After power-up, the trimming parameters can be re-loaded by setting the REBOOT bit of the CFG REG A M register to 1.

No toggle of the device power lines is required; after the reboot is completed, the device enters in Idle mode (regardless of the selected operating mode) after performing one measurement.

If the reset to the default value of the control registers is required, it can be performed by setting the SOFT\_RST bit of the CFG\_REG\_A\_M register to 1. The software reset procedure can take 5  $\mu$ s; the status of the reset is signaled by the status of the SOFT\_RST bit of the CFG\_REG\_A\_M register: once the reset is completed, this bit is automatically set low.

In order to avoid conflicts, the reboot and the software reset must not be executed at the same time (do not set to 1 at the same time both the REBOOT bit and SOFT\_RST bit of the CFG\_REG\_A\_M register).

The flow must be performed serially as shown in the example below:

- 1. Set the SOFT\_RST bit of the CFG\_REG\_A\_M register to 1;
- 2. Wait 5 μs (or wait until the SOFT\_RST bit of the CFG\_REG\_A\_M register returns to 0);
- Set the REBOOT bit of the CFG\_REG\_A\_M register to 1;
- 4. Wait 20 ms.



# 8 Magnetometer offset cancellation

The LSM303AH magnetometer is based on AMR technology: a set pulse is needed to set an initial operating condition.

Offset cancellation is the result of performing a set and reset pulse in the magnetic sensor and it can be enabled to remove the intrinsic sensor offset.

The offset cancellation technique is defined as follows:

$$H_{out} = \frac{H_n + H_{n-1}}{2}$$

where  $H_n$  and  $H_{n-1}$  are two consecutive magnetic field measurements, one after a set pulse, the other after a reset pulse.

Considering a magnetic offset (Hoff), the two magnetic field measurements are:

- Set: H<sub>n</sub> = H + H<sub>off</sub>
- Reset: H<sub>n-1</sub> = H H<sub>off</sub>

The offset is cancelled according to the offset cancellation technique:

$$H_{out} = \frac{H_n + H_{n-1}}{2} = \frac{2H + H_{off} - H_{off}}{2} = H$$

If the magnetometer is operating in Continuous mode, the offset cancellation is enabled by setting the OFF\_CANC bit to 1 in CFG\_REG\_B\_M. In this case, set/reset pulses are continuously performed; a set pulse is applied to one measurement, a reset pulse is applied to the next measurement. If the offset cancellation is disabled (OFF\_CANC = 0) and Continuous mode is selected, the set pulse frequency can be configured by setting the Set\_FREQ bit in CFG\_REG\_B\_M. If Set\_FREQ is set to 0, the set pulse is released every 63 ODR, otherwise if Set\_FREQ is set to 1, the set pulse is released only at power-on from Idle mode (a set of the magnetic sensor is performed anyway, even if the offset cancellation is disabled).

If the magnetometer is operating in Single mode, in order to enable the offset cancellation, both OFF\_CANC and OFF\_CANC\_ONE\_SHOT bits must be set to 1 in CFG\_REG\_B\_M. Enabling these bits, the impulse polarity is inverted between a single read and the next one. While offset cancellation is automatically managed by the device in Continuous mode, if this feature is enabled in Single mode, the user has to remove the offset manually using the formula below:

$$H_{out} = \frac{H_n + H_{n-1}}{2}$$

Offset cancellation using single reads is effective only if the reads are close in time, thus ensuring the offset does not drift between two consecutive reads.

57/

### 9 Magnetometer hard-iron compensation

Hard-iron distortion occurs when a magnetic object is placed near the magnetometer and appears as a permanent bias in the sensor's outputs. The hard-iron correction consists of compensating magnetic data from hard-iron distortion.

The operation is defined as follows:

$$H_{out} = H_{read} - H_{HI}$$

#### where:

- H<sub>read</sub> is the generic uncompensated magnetic field data, as read by the sensor;
- H<sub>HI</sub> is the hard-iron distortion field;
- H<sub>out</sub> is the compensated magnetic data.

The computation of the hard-iron distortion field should be performed by an external processor. After the computation of the hard iron-distortion field has been performed, the measured magnetic data can be compensated.

The device offers the possibility of storing hard-iron data inside six dedicated registers from address 45h to 4Ah.

Each register contains eight bits so that the hard-iron data can be expressed as a 16-bit two's complement number. The OFFSET\_X\_REG\_H\_M, OFFSET\_Y\_REG\_H\_M and OFFSET\_Z\_REG\_H\_M registers should contain the MSBs of the hard-iron distortion field estimated along the X, Y and Z axes respectively. The OFFSET\_X\_REG\_L\_M, OFFSET\_Y\_REG\_L\_M and OFFSET\_Z\_REG\_L\_M registers should contain the LSBs of the hard-iron distortion field estimated along the X, Y and Z axes respectively. Hard-iron data have the same format and sensitivity of the magnetic output data. The hard-iron values stored in dedicated registers are automatically subtracted from the output data.



# 10 Magnetometer interrupt generation

In the LSM303AH, the magnetometer interrupt signal generation is based on the comparison between the magnetometer output data and the programmable threshold.

To enable the interrupt function, the IEN bit in INT\_CTRL\_REG\_M must be set to 1. The interrupt function can be selectively enabled on each axis. In order to do this, the XIEN, YIEN, and ZIEN bits in INT\_CTRL\_REG\_M need be set properly.

The threshold value can be programmed by setting the INT\_THS\_L\_REG\_M and INT\_THS\_H\_REG\_M registers.

The threshold is expressed in absolute value as a 15-bit unsigned number. The threshold has the same sensitivity as the magnetic data.

When magnetic data exceeds the positive or the negative threshold, an interrupt signal is generated and the INT bit in the INT\_SOURCE\_REG\_M register goes high. Information about which axis has triggered the wake-up event is also available in the INT\_SOURCE\_REG\_M register; in particular, when magnetic data exceeds the positive threshold the P\_TH\_S\_[X, Y, Z] bit is set to 1, while if data exceeds the negative threshold the N\_TH\_S\_[X, Y, Z] bit is set to 1. If magnetic data lay between the positive and the negative thresholds, no interrupt signal is generated.

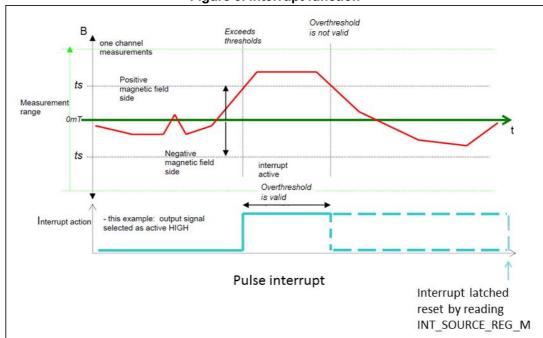


Figure 3. Interrupt function

Two different approaches for the interrupt function are available:

- Typical: comparison is between magnetic data read by the sensor and the programmable threshold;
- Advanced: comparison is made between magnetic data after hard-iron correction and the programmable threshold.

These approaches are configurable by setting the INT\_on\_DataOFF bit in CFG\_REG\_B\_M.

57

If INT\_on\_DataOFF is set to 0, the typical approach is selected, otherwise, if it is set to 1, the advanced approach is selected.

The hardware interrupt signal can be either pulsed or latched:

- Pulsed interrupt signal: it goes to active level when the magnetic data exceeds one of the two thresholds and goes low when the magnetic data are between the two thresholds (positive or negative). This kind of interrupt is selected by setting the IEL bit in INT\_CTRL\_REG\_M register to 0.
- Latched interrupt signal: it goes to active level when the data exceed one of the two
  thresholds but is reset only once the source register is read and not when the magnetic
  data returns between the two thresholds. This kind of interrupt is selected by setting the
  IEL bit in INT\_CTRL\_REG\_M register to 1.

The interrupt signal polarity can be set using the IEA bit in INT\_CTRL\_REG\_M.

If IEA is set to 1, then the interrupt signal is active high, while if it is set to 0, the interrupt signal is active low.

#### 10.1 Interrupt configuration example

A basic SW routine for threshold event recognition is given below.

```
    Write 80h in CFG_REG_A_M  // Temperature compensation enabled  // ODR = 10 Hz  // Continuous mode and High-Resolution
    Write 40h in CFG_REG_C_M  // Configure INT_MAG/DRDY pin as digital output and route interrupt signal
    Write 80h in INT_THS_L_REG_M  // Set a threshold equal to 128 (expressed in LSB)
    Write E7h in INT_CTRL_REG_M  // Enable a latched active-high interrupt on the three axes
```

The sample code exploits a threshold set to 192 mG (128 LSB \* 1.5 mG / LSB) and the event is notified by hardware through the INT\_MAG/DRDY pin.

#### 10.2 Overflow interrupt

The MROI bit in INT\_SOURCE\_REG\_M alerts the user if a measurement range overflow has occurred at internal ADC level. This function is enabled only if the interrupt generator is active (IEN bit = 1). MROI behavior is always latched: once the internal measurement range overflow has occurred, the MROI bit is reset by reading INT\_SOURCE\_REG\_M.



# 11 Magnetometer self-test

The embedded self-test function allows checking device functionality without moving it. When the magnetometer self-test is enabled, a current is forced into a coil inside the device. This current will generate a magnetic field that will produce a variation of the magnetometer output signals. If the output signals change within the amplitude limits, then the sensor is working properly and the parameters of the interface chip are within the defined specifications.

The magnetometer self-test function is off when the Self\_test bit of the CFG\_REG\_C\_M register is disabled; setting the Self\_test bit to 1 enables the self-test.

When the magnetometer self-test is activated, the sensor output level is given by the algebraic sum of the signals produced by the magnetic field acting on the sensor and by the current forced.

The procedure consists of:

- 1. enabling the magnetometer;
- 2. averaging fifty samples before enabling the self-test;
- averaging fifty samples after enabling the self-test;
- 4. computing the difference in the module for each axis and verifying that it falls in the given range: the min and max value are provided in the datasheet.


The complete magnetometer self-test procedure is indicated in *Figure 4*.

Note: Keep the device still during the self-test procedure.





Figure 4. Magnetometer self-test procedure

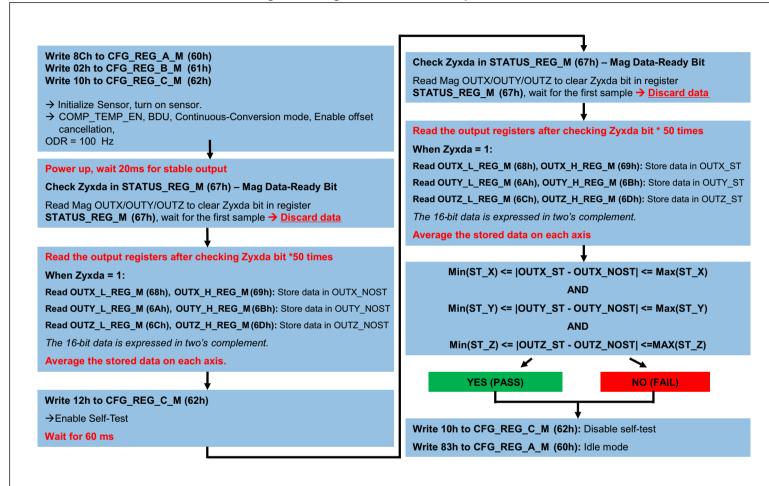

# 12 Accelerometer operating modes

The LSM303AH accelerometer provides two power modes: high-resolution (HR)/high-frequency mode (HF) and low-power (LP) mode.

After the power supply is applied, the accelerometer performs a 20 ms boot procedure to load the trimming parameters. After the boot is completed, the accelerometer is automatically configured in power-down mode.

Referring to the LSM303AH datasheet, the output data rate (ODR) and high-frequency (HF\_ODR) bits of CTRL1\_A register are used to select the power mode and the output data rate of the accelerometer sensor (*Table 11: Accelerometer ODR and power mode selection*).

Table 11. Accelerometer ODR and power mode selection

ODR [3:0]	HF_ODR	Mode	ODR selection [Hz]	Resolution (bit number)	
0000	0	Power-down	ower-down Power-down		
1000	0	LP	1	10	
1001	0	LP	12.5	10	
1010	0	LP	25	10	
1011	0	LP	50	10	
1100	0	LP	100	10	
1101	0	LP	200	10	
1110	0	LP	400	10	
1111	0	LP	800	10	
0001	0	HR	12.5	14	
0010	0	HR	25	14	
0011	0	HR	50	14	
0100	0	HR	100	14	
0101	0	HR	200	14	
0110	0	HR	400	14	
0111	0	HR	800 1		
0101	1	HF	HF 1600 12		
0110	1	HF	3200	12	
0111	1	HF	6400	12	

The output data have different resolution and are left-aligned. For example in case of the 10-bit resolution the output data are the 10 most significant bits of OUT\_H\_A & OUT\_L\_A concatenation, and the raw value has to be right-shifted by 6.



*Table 12* shows the typical values of the LSM303AH accelerometer power consumption for the different operating modes.

ODR [Hz] HR/HF (µA) LP (µA) 162 4.5 12.5 162 25 162 8 162 10 50 100 162 16 200 162 28 400 162 52 800 162 100 1600 162 3200 162 6400 162

**Table 12. Power consumption** 

#### 12.1 Power-down

When the accelerometer is in power-down, almost all internal blocks of the device are switched off to minimize power consumption. Digital interfaces (I<sup>2</sup>C and SPI) are still active to allow communication with the device. The content of the configuration registers is preserved and the output data registers are not updated, keeping the last data sampled in memory before going into power-down.

# 12.2 High-resolution/high-frequency mode

In HR/HF mode, all accelerometer circuitry is always on and data are generated at the data rate selected through the ODR bits. Data interrupt generation is active.

HR mode works with a 14-bit resolution, while HF with a 12-bit resolution (see *Table 11: Accelerometer ODR and power mode selection*).

# 12.3 Low-power mode

In low-power mode the accelerometer circuitry is periodically turned on/off with a duty cycle that is a function of the selected ODR. This mode differs from HR/HF mode in the available output data rates. In low-power mode we have same data rates as HR mode (from 12.5 Hz to 800 Hz, but with a lower consumption) plus the 1 Hz case.

Data interrupt generation is active.

LP mode works with a 10-bit resolution (see *Table 11: Accelerometer ODR and power mode selection*).



#### 12.4 Accelerometer bandwidth

The accelerometer sampling chain (*Figure 5*) is represented by a cascade of a few blocks: an ADC converter, a digital low-pass filter and a digital slope filter.

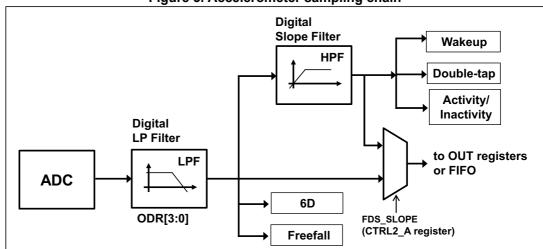


Figure 5. Accelerometer sampling chain

The digital signal is filtered by a low-pass digital filter (LPF) whose cutoff frequency depends on the selected accelerometer ODR, as shown in *Table 13*.

Mode	ODR selection [Hz]	LPF cutoff [Hz]		
LP	1	3200		
LP	12.5	3200		
LP	25	3200		
LP	50	3200		
LP	100	3200		
LP	200	3200		
LP	400	3200		
LP	800	3200		
HR	12.5	5.5		
HR	25	11		
HR	50	22		
HR	100	44		
HR	200	88		
HR	400	177		
HR	800	355		
HF	1600	710		
HF	3200	1420		
HF	6400	2840		

Table 13. Accelerometer LPF1 cutoff frequency

The selection of the signal (LPF or HPF) which is sent to the OUT registers is determined by the FDS\_SLOPE bit of CTRL2\_A register. When it is logic '1', the HPF signal is selected, LPF otherwise.

The signal that is sent to the digital functions (wakeup, double-tap, activity/inactivity and 6D orientation) is always the HPF signal. Anti-aliasing filtering is guaranteed by the ADC sampling frequency and the digital LPF cutoff frequency. Anti-aliasing filtering is available in HR/HF mode only. When the accelerometer is in LP mode, the circuitry is periodically turned on/off (reducing power consumption) with a fixed on-time and a period that is a function of the selected ODR. For this reason the LPF cutoff is fixed to 3.2 kHz, so the user must take care to select the proper ODR value Vs application sampling frequency in order to avoid aliasing (based on the noise characteristics of the system in use).

#### 12.4.1 Accelerometer slope filter

As shown in *Figure 6*, the LSM303AH accelerometer embeds a digital slope filter which is used for wakeup and single/double-tap features. The slope filter output data is computed using the following formula:

$$slope(t_n) = [acc(t_n) - acc(t_n-1)]/2$$

An example of a slope data signal is illustrated in Figure 6.

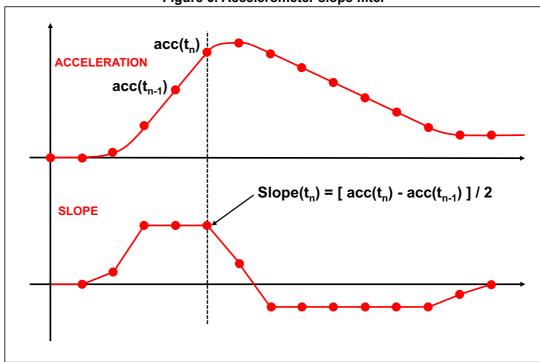


Figure 6. Accelerometer slope filter

Slope filter bandwidth is ~ ODR/4 and its data is available in the output registers and FIFO by setting the FDS\_SLOPE bit of CTRL2\_A (21h) to '1'.

# 13 Reading accelerometer output data

#### 13.1 Startup sequence

Once the device is powered up, the accelerometer automatically downloads the calibration coefficients from the embedded flash to the internal registers. When the boot procedure is completed, i.e. after approximately 20 milliseconds, the accelerometer automatically enters power-down.

To turn on the accelerometer and gather acceleration data, it is necessary to select one of the operating modes through the CTRL1\_A register.

The following general-purpose sequence can be used to configure the accelerometer:

```
    Write CTRL1_A = 60h  // Acc = 400 Hz (high-resolution mode)
    Write CTRL4_A = 01h  // Acc data-ready interrupt on INT1_XL
```

#### 13.2 Using the status register

The device is provided with a STATUS\_A register which should be polled to check when a new set of data is available. The DRDY bit is set to 1 when a new set of data is available from the accelerometer output.

For the accelerometer, the reads should be performed as follows:

- 1. Read STATUS A
- 2. If DRDY = 0, then go to 1
- 3. Read OUTX\_L\_A
- 4. Read OUTX H A
- Read OUTY\_L\_A
- 6. Read OUTY\_H\_A
- 7. Read OUTZ\_L\_A
- 8. Read OUTZ\_H\_A
- 9. Data processing
- 10. Go to 1

#### 13.3 Using the data-ready signal

The device can be configured to have one HW signal to determine when a new set of measurement data is available for reading.

For the accelerometer sensor, the data-ready signal is represented by the DRDY bit of the STATUS\_A register. The signal can be driven to the INT1\_XL pin by setting to 1 the INT1\_DRDY bit of the CTRL4\_A register and to the INT2\_XL pin by setting to 1 the INT2\_DRDY bit of the CTRL5\_A register.

The data-ready signal rises to 1 when a new set of data has been generated and it is available for reading. In DRDY latched mode (DRDY\_PULSED bit = 0 in CTRL5\_A register), which is the default condition, the signal gets reset when the higher part of one of the channels has been read (29h, 2Bh, 2Dh). In DRDY pulsed mode (DRDY\_PULSED = 1), the pulse duration is about 75  $\mu$ s.

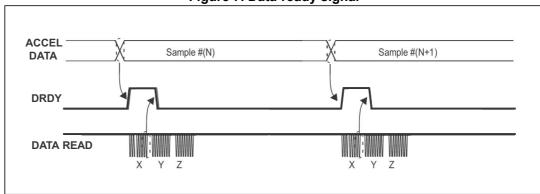


Figure 7. Data-ready signal

#### 13.4 Using the block data update (BDU) feature

If reading the accelerometer data is particularly slow and cannot be synchronized (or it is not required) with either the DRDY event bit in the STATUS\_A register or with the DRDY signal driven to the INT1\_XL/INT2\_XL pins, it is strongly recommended to set the BDU (block data update) bit to 1 in the CTRL1 A (20h) register.

This feature avoids reading values (most significant and least significant parts of output data) related to different samples. In particular, when the BDU is activated, the data registers related to each channel always contain the most recent output data produced by the device, but, in case the read of a given pair (i.e. OUTX\_H\_A and OUTX\_L\_A, OUTY\_H\_A and OUTY\_L\_A, OUTZ\_H\_A and OUTZ\_L\_A) is initiated, the refresh for that pair is blocked until both MSB and LSB parts of the data are read.

Note:

BDU only guarantees that the LSB part and MSB part have been sampled at the same moment. For example, if the reading speed is too slow, X and Y can be read at T1 and Z sampled at T2.

#### 13.5 Understanding output data

The measured acceleration data are sent to the OUTX\_H\_A, OUTX\_L\_A, OUTY\_H\_A, OUTY\_L\_A, OUTZ\_H\_A, and OUTZ\_L\_A registers. These registers contain, respectively, the most significant part and the least significant part of the acceleration signals acting on the X, Y, and Z axes.

The complete output data for the X, Y, Z channels is given by the concatenation OUTX\_H\_A & OUTX\_L\_A, OUTY\_H\_A & OUTY\_L\_A, OUTZ\_H\_A & OUTZ\_L\_A and it is expressed as a two's complement number.

Acceleration data is represented as 16-bit numbers, called LSB, but has different resolution according to the selected operating mode (LP/HR/HF). See *Table 11: Accelerometer ODR and power mode selection*.

After calculating the LSB, it must be multiplied by the proper sensitivity parameter to obtain the corresponding value in mg.

#### 13.5.1 Example of output data

Hereafter there is a simple example of how to use the LSB data and transform it into mg.

The values are given under the hypothesis of perfect device calibration (i.e. no offset, no gain error,....).

Get raw data from the sensor (HR mode, ODR 200 Hz):

```
OUTX_L_A: 5Ch
OUTX_H_A: FDh
OUTY_L_A: 74h
OUTY_H_A: 00h
OUTZ_L_A: F8h
OUTZ_H_A: 42h
```

#### Do registers concatenation:

```
OUTY_H_A & OUTY_L_A: FD5Ch
OUTY_H_A & OUTY_L_A: 0074h
OUTZ_H_A & OUTZ_L_A: 42F8h
```

#### Apply sensitivity (e.g. 0.061 at full scale $\pm 2 g$ ):

```
X: -676 * 0.061 = -41 mg

Y: +116 * 0.061 = +7 mg

Z: +17144 * 0.061 = +1046 mg
```

**57**/

# 14 Accelerometer interrupt generation and embedded functions

In the LSM303AH accelerometer the interrupt generation is based on accelerometer data, so, for interrupt-generation purposes, the accelerometer sensor has to be set in an active operating mode (not in power-down).

The interrupt generator can be configured to detect:

- Free-fall;
- Wake-up;
- 6D/4D orientation detection;
- Single-tap and double-tap sensing;
- Activity/Inactivity detection.

In addition, the LSM303AH accelerometer can efficiently run the sensor-related features specified in the leading OSs, saving power and enabling faster reaction time. In particular, it has been designed to implement in hardware:

- Significant motion;
- Tilt:
- Pedometer functions;

All these interrupt signals, together with FIFO interrupt signals and sensor data-ready, can be independently driven to the INT1\_XL and INT2\_XL interrupt pins or checked by reading the dedicated source register bits.

Note: When the MODULE\_ON bit is set to 1, the embedded functions (pedometer, tilt and significant motion) are not available.

The H\_LACTIVE bit of the CTRL3\_A register must be used to select the polarity of the interrupt pins also when the DRDY signal is routed to them. If this bit is set to 0 (default value), the interrupt pins are active high and they change from low to high level when the related interrupt condition is verified. Otherwise, if the H\_LACTIVE bit is set to 1 (active low), the interrupt pins are normally at high level and they change from high to low when interrupt condition is reached.

The PP\_OD bit of CTRL3\_A allows changing the behavior of the interrupt pins also when the DRDY signal is routed to them from push-pull to open drain. If the PP\_OD bit is set to 0, the interrupt pins are in push-pull configuration (low-impedance output for both high and low level). When the PP\_OD bit is set to 1, only the interrupt active state is a low-impedance output.

The LIR bit of CTRL3\_A allows applying the latched mode to the interrupt signals (not affecting the DRDY signal). When the LIR bit is set to 1, once the interrupt pin is asserted, it must be reset by reading the related interrupt source register. If the LIR bit is set to 0, the interrupt signal is automatically reset when the interrupt condition is no longer verified or after a certain amount of time in function of the type of interrupt.



#### 14.1 Interrupt pin configuration

The device is provided with two pins that can be activated to generate either data ready or interrupt signals. The functionality of these pins is selected through the CTRL4\_A register for the INT1\_XL pin, and through the CTRL5\_A register for the INT2\_XL pin.

Hereafter the description of these interrupt control registers; the default value of their bits is equal to 0, which corresponds to 'disable'. In order to enable the routing of a specific interrupt signal on the pin, the related bit has to be set to 1.

Table 14. CTRL4\_A register

b7	b6	b5	b4	b3	b2	b1	b0
0	INT1_						
	S_TAP	WU	FF	TAP	6D	FTH	DRDY

- INT1 S TAP: Single-tap event recognition is routed on the INT1 XL pin.
- INT1\_WU: Wakeup event recognition is routed on the INT1\_XL pin.
- INT1 FF: Free-fall event recognition is routed on the INT1 XL pin.
- INT1\_TAP: Tap event recognition is routed on the INT1\_XL pin.
- INT1 6D: 6D event recognition is routed on the INT1 XL pin.
- INT1 FTH: FIFO threshold event is routed on the INT1 XL pin.
- INT1\_DRDY: Accelerometer data-ready is routed on the INT1\_XL pin.

Table 15. CTRL5\_A register

b7	b6	b5	b4	b3	b2	b1	b0
DRDY_	INT2_	INT2_ON_	INT2_	INT2_SIG	INT2_STEP	INT2_	INT2_
PULSED	BOOT	INT1	TILT	_MOT		FTH	DRDY

- DRDY PULSED: Data-ready interrupt mode selection: latched mode / pulsed mode.
- INT2 BOOT: Boot state routed on the INT2 XL pin.
- INT2\_ON\_INT1: All INT2 signals are routed also to the INT1\_XL pin.
- INT2 TILT: Tilt event recognition is routed on the INT2 XL pin.
- INT2\_SIG\_MOT: Significant motion event recognition is routed on the INT2\_XL pin.
- INT2\_STEP: Step event recognition is routed on the INT2 XL pin.
- INT2 FTH: FIFO threshold event is routed on the INT2 XL pin.
- INT2\_DRDY: Accelerometer data-ready on the INT2\_XL pin.

#### 14.2 Event status

If multiple interrupt signals are routed on the same pin (INTx), the logic level of this pin is the "OR" combination of the selected interrupt signals. In order to know which event has generated the interrupt condition, the application should read the proper status register, which also will clear the event.

As indicated below, the STATUS\_A register is duplicated at address 36h in order to allow a multiple read of consecutive registers (36h/37h/38h/39h).

- STATUS\_A (27h) or STATUS\_DUP\_A (36h)
- WAKE\_UP\_SRC\_A (37h)
- TAP\_SRC\_A (38h)
- 6D\_SRC\_A (39h)
- FUNC\_CK\_GATE\_A (3Dh)

### 14.3 Free-fall interrupt

Free-fall detection refers to a specific register configuration that allows recognizing when the device is in free-fall: the acceleration measured along all the axes goes to zero. In a real case a "free-fall zone" is defined around the zero-g level where all the accelerations are small enough to generate the interrupt. Configurable threshold and duration parameters are associated to free-fall event detection: the threshold parameter defines the free-fall zone amplitude; the duration parameter defines the minimum duration of the free-fall interrupt event to be recognized (Figure 8: Free-fall interrupt).

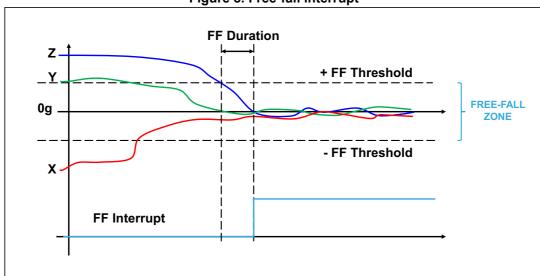


Figure 8. Free-fall interrupt

The free-fall event signal can be routed to the INT1\_XL pin by setting to 1 the INT1\_FF bit of the CTRL4\_A register; it can also be checked by reading the FF\_IA bit of the WAKE\_UP\_SRC\_A register.

If latch mode is disabled (LIR bit of CTRL3\_A is set to 0), the interrupt signal is automatically reset when the free-fall condition is no longer verified. If latch mode is enabled and the free-fall interrupt signal is driven to the interrupt pins, once a free-fall event has occurred and the interrupt pin is asserted, it must be reset by reading the WAKE\_UP\_SRC\_A register. If the

latch mode is enabled, but the interrupt signal is not driven to the interrupt pins, the latch feature does not take effect (the FF\_IA bit in WAKE\_UP\_SRC\_A is reset when the free-fall condition is no longer verified).

The register used to configure the threshold parameter is named FREE\_FALL\_A; the unsigned threshold value is related to the value of the FF\_THS[2:0] field value as indicated in *Table 16* and is expressed in units of 31.25 mg. The LSB values given in this table are valid for any accelerometer full-scale value.

FREE\_FALL\_A - FF\_THS[2:0] Threshold LSB value 000 5 001 7 010 8 011 10 100 11 13 101 110 15 111 16

Table 16. Free-fall threshold LSB value

Duration time is measured in N/ODR, where N is the content of the FF\_DUR[5:0] field of the FREE\_FALL\_A / WAKE\_UP\_DUR\_A registers and ODR is the accelerometer data rate.

A basic SW routine for free-fall event recognition is given below.

```
    Write 60h in CTRL1_A  // Turn on the accelerometer  // ODR = 400 Hz, FS = ±2 g
    Write 00h in WAKE_UP_DUR_A  // Set event duration (FF_DUR5 = 0)
    Write 33h in FREE_FALL_A  // Set FF threshold (FF_THS[2:0] = 011b)  // Set six sample event duration (FF_DUR[5:0] = 000110b)
    Write 10h in CTRL4_A  // FF interrupt driven to INT1_XL pin
    Write 04h in CTRL3_A  // Latch interrupt
```

The sample code exploits a threshold set to  $\sim 310$  mg (31.25 mg \* 10) for free-fall recognition and the event is notified by hardware through the INT1\_XL pin. The FF\_DUR[5:0] field of FREE\_FALL\_A / WAKE\_UP\_DUR\_A registers is configured like this to ignore events that are shorter than 6/ODR = 6/400 Hz = 15 msec in order to avoid false detections.

### 14.4 Wake-up interrupt

In the LSM303AH device the wake-up feature is implemented using the slope filter (see Section 12.4.1: Accelerometer slope filter for more details), as illustrated in Figure 6: Accelerometer slope filter. The wake-up interrupt signal is generated if a certain number of consecutive slope filtered data exceed the configured threshold (Figure 9: Wake-up interrupt).

The unsigned threshold value is defined using the WU\_THS[5:0] bits of the WAKE\_UP\_THS\_A register; the value of 1 LSB of these 6 bits depends on the selected accelerometer full scale: 1 LSB = FS/64. The threshold is applied to both positive and negative data: for a wake-up interrupt generation at least one of the three axes must be bigger than the threshold.

The duration parameter defines the minimum duration of the wake-up event to be recognized; its value is set using the WU\_DUR[1:0] bits of the WAKE\_UP\_DUR\_A register: 1 LSB corresponds to 1\*ODR time, where ODR is the accelerometer output data rate. It is important to appropriately define the duration parameter to avoid unwanted wake-up interrupts due to spurious spikes of the input signal.

This interrupt signal can be driven to the INT1\_XL interrupt pin by setting to 1 the INT1\_WU bit of the CTRL4\_A register; it can also be checked by reading the WU\_IA bit of the WAKE\_UP\_SRC\_A register. The X\_WU, Y\_WU, Z\_WU bits of the WAKE\_UP\_SRC\_A register indicate which axis has triggered the wake-up event.

If latch mode is disabled (LIR bit of CTRL3\_A is set to 0), the interrupt signal is automatically reset when the filtered data falls below the threshold. If latch mode is enabled and the wake-up interrupt signal is driven to the interrupt pins, once a wake-up event has occurred and the interrupt pin is asserted, it must be reset by reading the WAKE\_UP\_SRC\_A register. If the latch mode is enabled but the interrupt signal is not driven to the interrupt pins, the latch feature does not take effect (the WU\_IA bit in WAKE\_UP\_SRC\_A is reset when the free-fall condition is no longer verified).



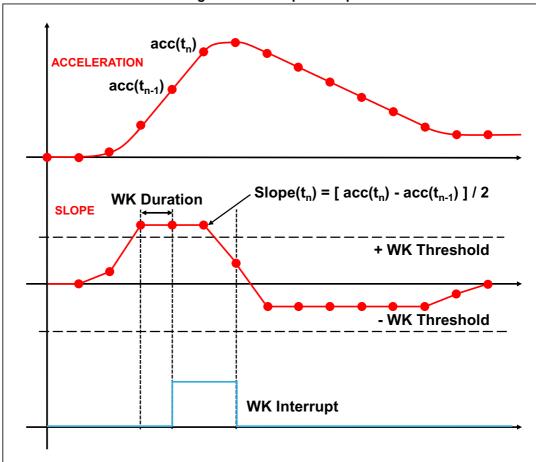


Figure 9. Wake-up interrupt

The example code which implements the SW routine for the wake-up event recognition is given below.

```
    Write 60h in CTRL1_A  // Turn on the accelerometer  // ODR = 400 Hz, FS = ±2 g
    Write 00h in WAKE_UP_DUR_A  // No duration
    Write 02h in WAKE_UP_THS_A  // Set wake-up threshold
    Write 20h in CTRL4_A  // Wake-up interrupt driven to INT1_XL pin
```

Since the duration time is set to zero, the wake-up interrupt signal is generated for each X,Y,Z slope data exceeding the configured threshold. The WU\_THS field of the WAKE\_UP\_THS\_A register is set to 000010b, therefore the wake-up threshold is 62.5 mg (= 2 \* FS / 64).

#### 14.5 6D/4D orientation detection

The LSM303AH device provides the capability to detect the orientation of the device in space, enabling easy implementation of energy-saving procedures and automatic image rotation for mobile devices.

#### 14.5.1 6D orientation detection

Six orientations of the device in space can be detected; the interrupt signal is asserted when the device switches from one orientation to another. The interrupt is not re-asserted as long as the position is maintained.

6D interrupt is generated when only one axis exceeds a selected threshold and the acceleration values measured from the other two axes are lower than the threshold: the ZH, ZL, YH, YL, XH, XL bits of the 6D\_SRC\_A register indicate which axis has triggered the 6D event.

In more detail:

Table 17. 6D\_SRC\_A register

b7	b6	b5	b4	b3	b2	b1	b0
0	6D_IA	ZH	ZL	YH	YL	XH	XL

- 6D\_IA is set high when the device switches from one orientation to another.
- ZH (YH, XH) is set high when the face perpendicular to the Z (Y,X) axis is almost flat and the acceleration measured on the Z (Y,X) axis is positive and in the module bigger than the threshold.
- ZL (YL, XL) is set high when the face perpendicular to the Z (Y,X) axis is almost flat and the acceleration measured on the Z (Y,X) axis is negative and in the module bigger than the threshold.

The 6D\_THS[1:0] bits of the TAP\_6D\_THS\_A register are used to select the threshold value used to detect the change in device orientation. The threshold values given in *Table 18: Threshold for 4D/6D function* are valid for each accelerometer full-scale value.

Table 18. Threshold for 4D/6D function

6D_THS[1:0]	Threshold value [degrees]
00	80
01	70
10	60
11	50

This interrupt signal can be driven to the INT1\_XL interrupt pin by setting to 1 the INT1\_6D bit of the CTRL4\_A register; it can also be checked by reading the 6D\_IA bit of the 6D\_SRC\_A register.

If latch mode is disabled (LIR bit of CTRL3\_A is set to 0), the interrupt signal is active only for 1/ODR[s] then it is automatically deasserted (ODR is the accelerometer output data rate). If latch mode is enabled and the 6D interrupt signal is driven to the interrupt pins, once



an orientation change has occurred and the interrupt pin is asserted, a read of the 6D\_SRC\_A register clears the request and the device is ready to recognize a different orientation. If the latch mode is enabled, but the interrupt signal is not driven to the interrupt pins, the latch feature does not take effect.

Referring to the six possible cases illustrated in *Figure 10: 6D recognized orientations*, the content of the 6D\_SRC\_A register for each position is shown in *Table 19: 6D\_SRC\_A register for 6D positions*.

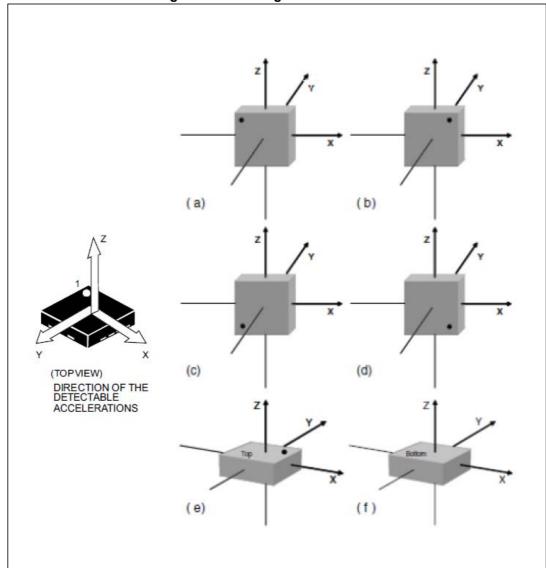


Figure 10. 6D recognized orientations

**577** 

Case	6D_IA	ZH	ZL	YH	YL	хн	XL
(a)	1	0	0	0	1	0	0
(b)	1	0	0	0	0	0	1
(c)	1	0	0	0	0	1	0
(d)	1	0	0	1	0	0	0
(e)	1	1	0	0	0	0	0
(f)	1	0	1	0	0	0	0

Table 19. 6D\_SRC\_A register for 6D positions

Hereafter an example which implements the SW routine for 6D orientation detection:

Write 60h in CTRL1\_A // Turn on the accelerometer // ODR = 400 Hz, FS = ±2 g
 Write 40h in TAP\_6D\_THS\_A // Set 6D threshold (6D\_THS[1:0] = 10b = 60 degrees)
 Write 04h in CTRL4\_A // 6D interrupt driven to INT1\_XL pin

#### 14.5.2 4D orientation detection

The 4D direction function is a subset of the 6D function especially defined to be implemented in mobile devices for portrait and landscape computation. It can be enabled by setting the 4D\_EN bit of the TAP\_6D\_THS\_A register to 1. In this configuration, the Z-axis position detection is disabled, therefore reducing position recognition to cases (a), (b), (c), and (d) of *Table 19: 6D\_SRC\_A register for 6D positions*.

### 14.6 Single-tap and double-tap recognition

The single-tap and double-tap recognition functions featured in the LSM303AH help to create a man-machine interface with little software loading. The device can be configured to output an interrupt signal on a dedicated pin when tapped in any direction.

If the sensor is exposed to a single input stimulus, it generates an interrupt request on the interrupt pin INT1\_XL. A more advanced feature allows the generation of an interrupt request when a double input stimulus with programmable time between the two events is recognized, enabling a mouse button-like function.

In the LSM303AH device the single-tap and double-tap recognition functions use the slope between two consecutive acceleration samples to detect the tap events; the slope data is computed using the following formula:

$$slope(t_n) = [acc(t_n) - acc(t_n-1)]/2$$

This function can be fully programmed by the user in terms of expected amplitude and timing of the slope data by means of a dedicated set of registers.

Single and double-tap recognition is meaningful only for ODR ≥ 400 Hz.



#### 14.6.1 Single tap

If the device is configured for single-tap event detection, an interrupt is generated when the slope data on the selected channel exceed the programmed threshold, and return below it within the shock time window.

In the single-tap case, if the LIR bit of the CTRL3\_A register is set to 0, the interrupt is kept high for the duration of the quiet window.

In order to enable the latch feature on the single-tap interrupt signal, the LIR bit of CTRL3\_A has to be set to 1: the interrupt is kept high until the TAP\_SRC\_A register is read.

The SINGLE\_DOUBLE\_TAP bit of WAKE\_UP\_THS\_A has to be set to 0 in order to enable single-tap recognition only.

In case (a) of *Figure 11: Single-tap event recognition* the single-tap event has been recognized, while in case (b) the tap has not been recognized because the slope data fall under the threshold after the shock time window has expired.

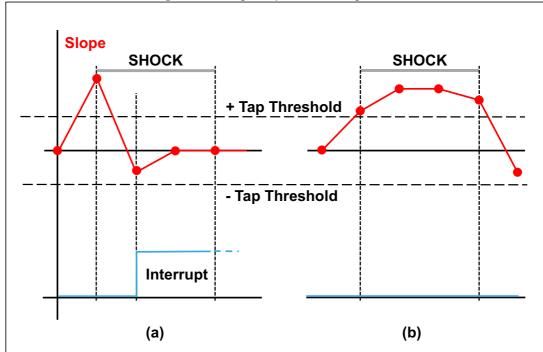


Figure 11. Single-tap event recognition

#### 14.6.2 **Double tap**

If the device is configured for double-tap event detection, an interrupt is generated when, after a first tap, a second tap is recognized. The recognition of the second tap occurs only if the event satisfies the rules defined by the shock, the latency and the quiet time windows.

In particular, after the first tap has been recognized, the second tap detection procedure is delayed for an interval defined by the quiet time. This means that after the first tap has been recognized, the second tap detection procedure starts only if the slope data exceed the threshold after the quiet window but before the latency window has expired. In case (a) of *Figure 12: Double-tap event recognition (LIR bit = 0)*, a double-tap event has been correctly recognized, while in case (b) the interrupt has not been generated because the slope data exceed the threshold after the latency window interval has expired.

Once the second tap detection procedure is initiated, the second tap is recognized with the same rule as the first: the slope data must return below the threshold before the shock window has expired.

It is important to appropriately define the quiet window to avoid unwanted taps due to spurious bouncing of the input signal.

In the double-tap case, if the LIR bit of the CTRL3\_A register is set to 0, the interrupt is kept high for the duration of the quiet window. If the LIR bit is set to 1, the interrupt is kept high until the TAP SRC A register is read.

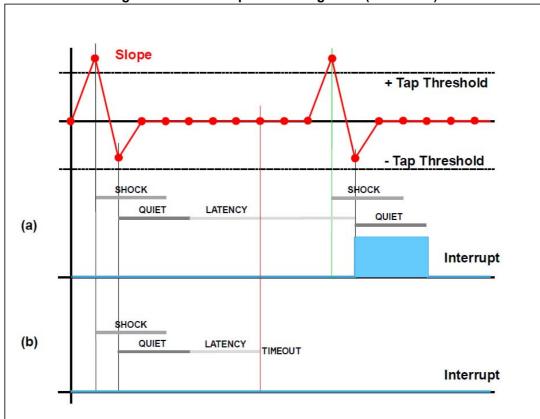


Figure 12. Double-tap event recognition (LIR bit = 0)

#### 14.6.3 Single-tap and double-tap recognition configuration

The LSM303AH device can be configured to output an interrupt signal when tapped (once or twice) in any direction: the TAP X EN, TAP Y EN and TAP Z EN bits of the CTRL3 A register must be set to 1 to enable the tap recognition on X, Y, Z directions, respectively.

Configurable parameters for tap recognition functionality are the tap threshold and the shock, quiet and latency time windows. Valid ODRs are 400 Hz, 800 Hz and 1600 Hz.

The TAP\_THS[4:0] bits of the TAP\_6D\_THS\_A register are used to select the unsigned threshold value used to detect the tap event. The value of 1 LSB of these 5 bits depends on the selected accelerometer full scale: 1 LSB = FS/32. The unsigned threshold is applied to both positive and negative slope data.

The shock time window defines the maximum duration of the overthreshold event: the acceleration must return below the threshold before the shock window has expired, otherwise the tap event is not detected. The SHOCK[1:0] bits of the INT DUR A register are used to set the shock time window value: the default value of these bits is 00b and corresponds to 4/ODR time, where ODR is the accelerometer output data rate. If the SHOCK[1:0] bits are set to a different value, 1 LSB corresponds to 8/ODR time.

In the double-tap case, the quiet time window defines the time after the first tap recognition in which there must not be any overthreshold. When the latch mode is disabled (LIR bit of CTRL3 A is set to 0), the quiet time also defines the length of the interrupt pulse (in both single and double-tap case). The QUIET[1:0] bits of the INT DUR A register are used to set the quiet time window value: the default value of these bits is 00b and corresponds to 2/ODR time, where ODR is the accelerometer output data rate. If the QUIET[1:0] bits are set to a different value, 1 LSB corresponds to 4/ODR time.

In the double-tap case, the latency time window defines the maximum time between two consecutive detected taps. The latency time period starts just after the completion of the quiet time of the first tap. The LAT[3:0] bits of the INT DUR A register are used to set the latency time window value: the default value of these bits is 0000b and corresponds to 16/ODR time, where ODR is the accelerometer output data rate. If the LAT[3:0] bits are set to a different value, 1 LSB corresponds to 32/ODR time.

Figure 13: Single and double-tap event recognition (LIR bit = 0) illustrates a single-tap event (a) and a double-tap event (b). These interrupt signals can be driven to the INT1 XL interrupt pin by setting to 1 the INT1 S TAP bit of the CTRL4 A register for the single-tap case, and setting to 1 the INT1 TAP bit of the CTRL4 A register for the double-tap case.

No single/double-tap interrupt is generated if the accelerometer is in inactivity status (see Section 14.7: Activity/Inactivity recognition for more details.



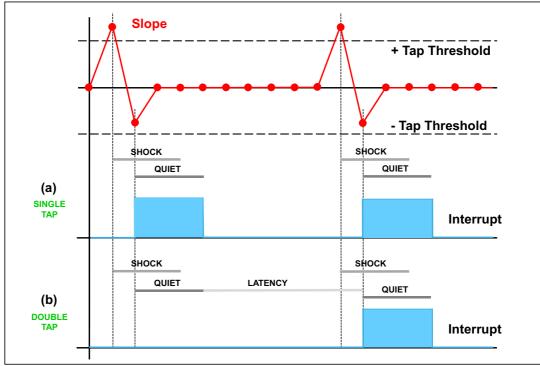


Figure 13. Single and double-tap event recognition (LIR bit = 0)

The tap interrupt signals can also be checked by reading the TAP\_SRC\_A (38h) register, described in *Table 20: TAP\_SRC\_A register*.

b7	b6	b5	b4	b3	b2	b1	b0
0	TAP_IA	SINGLE _TAP	DOUBLE _TAP	TAP _SIGN	X_TAP	Y_TAP	Z_TAP

Table 20. TAP SRC A register

- TAP IA is set high when a single-tap or double-tap event has been detected.
- SINGLE\_TAP is set high when a single tap has been detected.
- DOUBLE\_TAP is set high when a double tap has been detected.
- TAP\_SIGN indicates the acceleration sign when the tap event is detected. It is set low in case of positive sign and it is set high in case of negative sign.
- X\_TAP (Y\_TAP, Z\_TAP) is set high when the tap event has been detected on the X (Y, Z) axis

Single and double-tap recognition works independently. Setting the SINGLE\_DOUBLE\_TAP bit of WAKE\_UP\_THS\_A to 0, only the single-tap recognition is enabled: double-tap recognition is disabled and cannot be detected. When the SINGLE\_DOUBLE\_TAP is set to 1, both single and double-tap recognition are enabled.

If the latch mode is enabled and the interrupt signal is driven to the interrupt pins, the value assigned to SINGLE\_DOUBLE\_TAP also affects the behavior of the interrupt signal: when it is set to 0, the latch mode is applied to the single-tap interrupt signal; when it is set to 1, the latch mode is applied to the double-tap interrupt signal only. The latched interrupt signal is kept high until the TAP\_SRC\_A register is read. If the latch mode is enabled but the interrupt signal is not driven to the interrupt pins, the latch feature does not take effect.



#### 14.6.4 Single-tap example

Hereafter an example code which implements the SW routine for single-tap detection.

```
1.
     Write 60h in CTRL1 A
                                         // Turn on the accelerometer
                                         // ODR = 400 Hz, FS = \pm 2 g
     Write 38h in CTRL3 A
                                         // Enable tap detection on X, Y, Z-axis
3.
     Write 09h in TAP 6D THS A
                                         // Set tap threshold
4.
     Write 06h in INT DUR A
                                         // Set guiet and shock time windows
5.
     Write 00h in WAKE UP THS A
                                         // Only single tap enabled (SINGLE DOUBLE TAP = 0)
6.
     Write 40h in CTRL4 A
                                         // Single-tap interrupt driven to INT1 XL pin
```

In this example the TAP\_THS field of the TAP\_6D\_THS\_A register is set to 01001b, therefore the tap threshold is 562.5 mg (= 9 \* FS / 32).

The SHOCK field of the INT\_DUR\_A register is set to 10b: an interrupt is generated when the slope data exceeds the programmed threshold, and returns below it within 40 ms (= 2 \* 8 / ODR) corresponding to the shock time window.

The QUIET field of the INT\_DUR\_A register is set to 01b: since the latch mode is disabled, the interrupt is kept high for the duration of the quiet window, therefore 10 ms (= 1 \* 4 / ODR).

#### 14.6.5 Double-tap example

The example code which implements the SW routine for single-tap detection is given below.

```
    Write 60h in CTRL1_A  // Turn on the accelerometer  // ODR = 400 Hz, FS = ±2 g
    Write 38h in TAP_CFG_A  // Enable tap detection on X, Y, Z-axis
    Write 0Ch in TAP_6D_THS_A  // Set tap threshold
    Write 7Fh into INT_DUR_A  // Set duration, quiet and shock time windows
    Write 80h in WAKE_UP_THS_A  // Single & double-tap enabled (SINGLE_DOUBLE_TAP = 1)
    Write 08h in CTRL4_A  // Double-tap interrupt driven to INT1_XL pin
```

In this example the TAP\_THS field of the TAP\_6D\_THS\_A register is set to 01100b, therefore the tap threshold is 750 mg (= 12 \* FS / 32).

For interrupt generation, during the first and the second tap the slope data must return below the threshold before the shock window has expired. The SHOCK field of the INT\_DUR\_A register is set to 11b, therefore the shock time is 60 ms (= 3 \* 8 / ODR).

For interrupt generation, after the first tap recognition there must not be any slope data overthreshold during the quiet time window. Furthermore, since the latch mode is disabled, the interrupt is kept high for the duration of the quiet window. The QUIET field of the INT\_DUR\_A register is set to 11b, therefore the quiet time is 30 ms (= 3 \* 4 / ODR).

For the maximum time between two consecutive detected taps, the LAT field of the INT\_DUR\_A register is set to 0111b, therefore the duration time is 560 ms (= 7 \* 32 / ODR).



### 14.7 Activity/Inactivity recognition

The activity/inactivity recognition function allows reducing system power consumption and developing new smart applications.

When the activity/inactivity recognition function is activated, the LSM303AH device is able to automatically enter low-power mode and decrease the accelerometer sampling rate to 12.5 Hz, increasing back the accelerometer ODR and bandwidth as soon as the wake-up interrupt event has been detected.

With this feature the system may be efficiently switched from low-power consumption to full performance and vice-versa depending on user-selectable acceleration events, thus ensuring power saving and flexibility.

The activity/inactivity recognition function is enabled by setting to 1 the SLEEP\_ON bit of the WAKE\_UP\_THS\_A register.

The activity/inactivity recognition function uses the slope between two consecutive acceleration samples to detect the activity/inactivity event; the slope data is computed using the following formula:

$$slope(t_n) = [acc(t_n) - acc(t_n-1)]/2$$

This function can be fully programmed by the user in terms of expected amplitude and timing of the slope data by means of a dedicated set of registers (*Figure 14: Activity/Inactivity recognition*).

The unsigned threshold value is defined using the WK\_THS[5:0] bits in the WAKE\_UP\_THS\_A register; the value of 1 LSB of these 6 bits depends on the selected accelerometer full scale: 1 LSB = 1 / 64 of FS. The threshold is applied to both positive and negative slope data.

When a certain number of consecutive X,Y,Z slope data is smaller than the configured threshold, the ODR [3:0] bits of the CTRL1\_A register are bypassed (inactivity) and the accelerometer is internally set to 12.5 Hz although the content of CTRL1\_A is left untouched. The duration of the inactivity status to be recognized is defined by the SLEEP\_DUR[3:0] bits of the WAKE\_UP\_DUR\_A register: 1 LSB corresponds to 512/ODR time, where ODR is the accelerometer output data rate.

When the inactivity status is detected, no interrupt is generated to the application processor (SLEEP STATE IA bit of the WAKE UP SRC A register cannot be routed on the pin).

When a single sample of slope data on one axis becomes bigger than the threshold, the CTRL1\_A register settings are immediately restored (activity). The wake-up interrupt event can be delayed in function of the value of the WU\_DUR[1:0] bits of the WAKE\_UP\_DUR\_A register: 1 LSB corresponds to 1/ODR time, where ODR is the accelerometer output data rate. In order to generate the interrupt at the same time as the Inactivity/Activity event, WU\_DUR[1:0] have to be set to 0.

When the wake-up event is detected, the interrupt is set high for 1/ODR period, then it is automatically deasserted (the WU\_IA event on the pin must be routed by setting the INT1 WU bit of CTRL4 A register to 1).



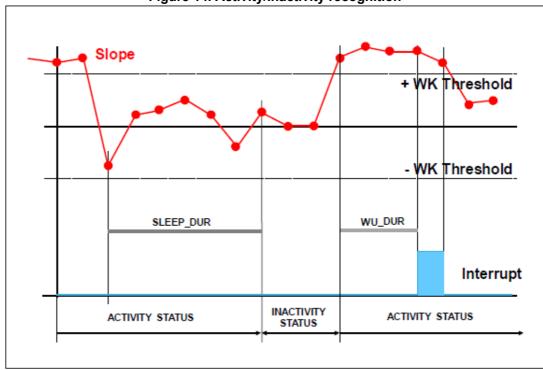


Figure 14. Activity/Inactivity recognition

The code provided below is a basic routine for activity/inactivity detection implementation.

```
    Write 50h in CTRL1_A  // Turn on the accelerometer  // ODR = 200 Hz, FS = ±2 g
    Write 42h in WAKE_UP_DUR_A  // Set duration for inactivity detection  // Set duration for wake-up detection
    Write 42h in WAKE_UP_THS_A  // Set activity/inactivity threshold  // Enable activity/inactivity detection
    Write 20h in CTRL4 A  // Activity (wakeup) interrupt driven to INT1 XL pin
```

In this example the WU\_THS field of the WAKE\_UP\_THS\_A register is set to 000010b, therefore the activity/inactivity threshold is 62.5 mg (= 2 \* FS / 64).

Before inactivity detection, the X,Y,Z slope data must be smaller than the configured threshold for a period of time defined by the SLEEP\_DUR field of the WAKE\_UP\_DUR\_A register: this field is set to 0010b, corresponding to 5.12 s (= 2 \* 512 / ODR). After this period of time has elapsed, the accelerometer ODR is internally set to 12.5 Hz.

The activity status is detected and the CTRL1\_A register settings immediately restored if the slope data of (at least) one axis are bigger than the threshold and the wake-up interrupt was notified after an interval defined by the WU\_DUR field of the WAKE\_UP\_DUR\_A register: this field is set to 10b, corresponding to 10 ms (= 2 \* 1 / ODR).

#### 14.8 Boot status

After the device is powered up, the LSM303AH accelerometer performs a 20 ms boot procedure to load the trimming parameters. After the boot is completed the accelerometer is automatically configured in power-down mode.

After power-up, the trimming parameters can be re-loaded by setting to 1 the BOOT bit of the CTRL2\_A register.

No toggle of the device power lines is required and the content of the device control registers is not modified, so the device operating mode doesn't change after boot. If the reset to the default value of the control registers is required, it can be performed by setting to 1 the SW RESET bit of the CTRL2 A register.

The boot status signal can be driven to the INT2\_XL interrupt pin by setting to 1 the INT2\_BOOT bit of the CTRL5\_A register: the signal goes to '1' while a boot is taking place, and returns to '0' when it is done.

To return the device to the power-down default settings, follow these steps from ANY operating mode:

- Set SW RESET bit to '1'
- 2. Wait until SW\_RESET bit returns to '0'
- 3. Set BOOT bit to '1'
- 4. Wait 20 ms

#### 14.9 Embedded functions

The LSM303AH accelerometer implements in hardware the sensor-related functions specified in the leading OSs; specific IP blocks with negligible power consumption and high-level performance implement the following functions:

- Pedometer functions (step detector and step counter)
- Significant motion
- Tilt

#### 14.9.1 Pedometer functions: step detector and step counter

A specific IP block of the LSM303AH accelerometer is dedicated to pedometer functions: the step detector and the step counter.

Pedometer functions work at 25 Hz, so the accelerometer ODR must be set at a value of 25 Hz or higher. The max step frequency that can be detected is around 3 Hz.

In order to enable the pedometer functions the STEP\_CNT\_ON bit of the FUNC\_CTRL\_A register must be set to 1. When the pedometer is enabled, the Module\_8bit\_A (0Ch) register is also available.

The step detector functionality generates an interrupt every time a step is recognized. Instead of generating an interrupt every time a step is recognized, it is possible to generate it if at least one step is detected within a certain time period. This time period is defined by setting a value higher than 00h in the bits [0:7] of the STEP\_COUNT\_DELTA\_A register in the advanced configuration registers (1 LSB of the value of the STEP\_COUNT\_DELTA\_A register corresponds to 1.6384 seconds).



In case of interspersed step sessions, 7 consecutive steps have to be detected before the first interrupt generation (debounce functionality) in order to avoid false step detections.

The number of debounce steps can be modified through the DEB\_STEP [2:0] bits of register PEDO\_DEB\_REG\_A in the advanced configuration registers. 1LSB corresponds to 1 step. The debounce functionality restarts after a period of time (debouncing time) that can be modified through the DEB\_TIME[4:0] bits of register PEDO\_DEB\_REG\_A in the advanced configuration registers. 1LSB corresponds to 80 ms, default value = 13 (13 \*80 ms = 1040 ms).

This interrupt signal can be driven to the INT2\_XL interrupt pin by setting to 1 the INT2\_STEP bit of the CTRL5\_A register; it can also be checked by reading the STEP\_DETECT bit of the FUNC\_CK\_GATE\_A register.

The step counter indicates the number of steps detected by the step detector algorithm after the pedometer function has been enabled. The step count is given by the concatenation of the STEP\_COUNTER\_H\_A and STEP\_COUNTER\_L\_A registers and it is represented as a 16-bit unsigned number. The step count is not reset to zero when the accelerometer is configured in power-down or the pedometer is disabled; it can be reset to zero by setting the RST\_NSTEP bit of the STEP\_COUNTER\_MINTHS\_A register to 1.

The step counter overflow condition (count reaches 216) can be driven to the INT2\_XL pin by setting to 1 the INT2\_STEP\_COUNT\_OV bit (bit #4) of FIFO\_CTRL\_A (25h).

If latch mode is disabled (LIR bit of CTRL3\_A is set to 0), the interrupt signal generated by the pedometer functions is pulsed: the duration of the pulse observed on the interrupt pins is about  $60~\mu s$ .

If latch mode is enabled (LIR bit of CTRL3\_A is set to 1) and the interrupt signal is driven to the interrupt pins, once a step has occurred, a read of the FUNC\_CK\_GATE\_A register clears the request on both the pins and the device is ready to recognize the next step. If latch mode is enabled but the event is not driven to the interrupt pins, the STEP\_DETECT bit of the FUNC\_CK\_GATE\_A register is pulsed, with a fixed duration of 1/25 Hz.

As default, the step counter works at  $\pm 2~g$  full scale, independently of the configured device full scale, but it can be configured to  $\pm 4~g$  by setting to 1 the PEDO4g bit of the STEP\_COUNTER\_MINTHS\_A register provided that the full scale set in CTRL1\_A register is at least  $\pm 4~g$ .

It is also possible to set the "minimum threshold", i.e. the value at which the threshold for step recognition asymptotically tends if no steps are detected and below which it cannot descend. This configuration is in the SC\_MTHS[5:0] field of the STEP\_COUNTER\_MINTHS\_A register. The value of 1 LSB of these 6 bits depends on the selected step counter full scale

 $(\pm 2 \ g \ or \pm 4 \ g)$ : 1 LSB = FS / 64.



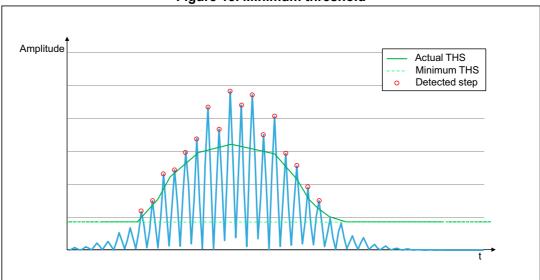


Figure 15. Minimum threshold

Hereafter a basic SW routine which shows how to enable the pedometer functions:

Write 20h in CTRL1\_A // Turn on the accelerometer // ODR = 25 Hz, FS = ±2 g
 Write 01h in FUNC\_CTRL\_A // Enable pedometer algorithm
 Write 04h in CTRL5\_A // Step detector interrupt driven to INT2\_XL pin

The interrupt signal is generated when a step is recognized and the step count is available by reading the STEP\_COUNTER\_H\_A / STEP\_COUNTER\_L\_A registers.

#### 14.9.2 Significant motion

The significant motion functionality can be used in location-based applications in order to receive a notification indicating when the user is changing location.

The significant motion function generates an interrupt when a 'significant motion', that could be due to a change in user location, is detected. To be considered significant, a motion should be at least 5 steps.

In the LSM303AH device this function has been implemented in hardware using the accelerometer and works at 25 Hz, so the accelerometer ODR must be set at a value of 25 Hz or higher.

In order to enable significant motion detection, the SIGN\_MOT\_ON bit of the FUNC\_CTRL\_A register must be set to 1.

The significant motion interrupt signal can be driven to the INT2\_XL interrupt pin by setting to 1 the INT2\_SIG\_MOT bit of the CTRL5\_A register; it can also be checked by reading the SIG\_MOT\_DETECT bit of the FUNC\_CK\_GATE\_A register.

If latch mode is disabled (LIR bit of CTRL3\_A is set to 0), the interrupt signal generated by the significant motion function is pulsed: the duration of the pulse observed on the interrupt pins is about 60  $\mu$ s; the duration of the pulse observed on the SIG\_MOT\_DETECT bit of the FUNC\_CK\_GATE\_A register is 1/25 Hz.

If latch mode is enabled (LIR bit of CTRL3\_A is set to 1) and the interrupt signal is driven to the interrupt pin, once a 'significant motion' is detected, a read of the FUNC\_CK\_GATE\_A register clears the request on INT2\_XL and the SIG\_MOT\_DETECT bit of the FUNC\_CK\_GATE\_A register, and the device is ready to recognize the next event. If latch mode is enabled but the interrupt signal is not driven to the interrupt pins, the SIG\_MOT\_DETECT bit of the FUNC\_CK\_GATE\_A register is pulsed, with a fixed duration of 1/25 Hz.

The user can configure the significant motion minimum threshold, which is the number of steps to be performed by the user upon a change of location before the significant motion interrupt is generated. For this purpose the SM\_THS\_A register (34h) of the advanced configuration registers may be used:

b7	b6	b5	b4	b3	b2	b1	b0
SM_THS							
_7	_6	_5	_4	_3	_2	_1	_0

Please note that the SMD threshold is effective when its value (SM\_THS\_[7:0] bits of SM\_THS\_A (34h) register) is equal to or higher than the Pedometer Debounce threshold (DEB\_STEP[2:0] bits of the PEDO\_DEB\_REG\_A (2Bh) advanced register). The following table indicates a possible scenario for the SMD threshold value.

Table 21. SMD threshold


Configurations	SM_THS_[7:0]	DEB_STEP[2:0]
Pedometer debounce not active	V	
Pedometer debounce is active and SMD threshold is ≥ pedometer debounce threshold	V	
Pedometer debounce is active and SMD threshold is < pedometer debounce threshold		√

When the pedometer debounce is active and the SMD threshold is lower than the default (=6), the bits DEB\_STEP[2:0] of the PEDO\_DEB\_REG\_A register have to be decreased accordingly.

Note:

An excessive reduction of the pedometer debounce threshold can cause the pedometer to report false step detections!

Hereafter a basic SW routine which shows how to enable the significant motion detection function:

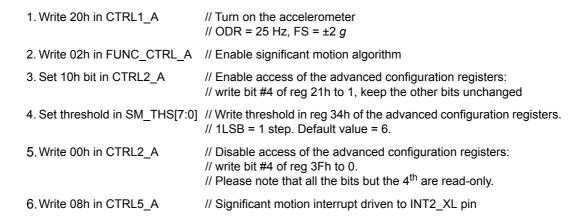



#### 14.9.3 Tilt

The tilt function allows detecting when an activity change occurs (e.g. when phone is in a front pocket and the user goes from sitting to standing or standing to sitting): in the LSM303AH device it has been implemented in hardware.

In order to enable tilt detection the TILT\_ON bit of the FUNC\_CTRL\_A register must be set to 1.

If the device is configured for tilt event detection, an interrupt is generated when the device is tilted by an angle greater than 35 degrees from the start position. The start position is defined as the position of the device when tilt detection is enabled or the position of the device when the last tilt interrupt was generated.

After this function is enabled, for the generation of the first tilt interrupt the device should be continuously tilted by an angle greater than 35 degrees from the start position for a period of time of at least 2 seconds. After the first tilt interrupt is generated, the tilt interrupt signal is set high as soon as the device is tilted by an angle greater than 35 degrees from the position of the device corresponding to the last interrupt detection (no need to wait 2 seconds).

This interrupt signal can be driven to the INT2\_XL pin by setting to 1 the INT2\_TILT bit of the CTRL5\_A register; it can also be checked by reading the TILT\_INT bit of the FUNC CK GATE A register.

If latch mode is disabled (LIR bit of CTRL3\_A is set to 0), the interrupt signal generated by the tilt function is pulsed: the duration of the pulse observed on the interrupt pins is about  $60 \mu s$ ; the duration of the pulse observed on the TILT\_INT bit of the FUNC\_CK\_GATE\_A register is 1/25 Hz.

If latch mode is enabled (LIR bit of CTRL3\_A is set to 1) and the interrupt signal is driven to the interrupt pins, once a tilt is detected, a read of the FUNC\_CK\_GATE\_A register clears the request on the INT2\_XL pin and the TILT\_INT bit of FUNC\_CK\_GATE\_A register, and the device is ready to recognize the next tilt event. If latch mode is enabled but the interrupt signal is not driven to the interrupt pins, the TILT\_INT bit of the FUNC\_CK\_GATE\_A register is pulsed, with a fixed duration of 1/25 Hz.

The tilt function works at 25 Hz independently of the device ODR.

Hereafter a basic SW routine which shows how to enable the tilt detection function:

```
    Write 20h in CTRL1_A  // Turn on the accelerometer  // ODR = 25 Hz, FS = ±2 g
    Write 10h in FUNC_CTRL_A  // Enable tilt detection
    Write 10h in CTRL5_A  // Tilt detector interrupt driven to INT2_XL pin
```

## 15 Accelerometer First-In First-Out (FIFO) buffer

In order to limit intervention by the host processor and facilitate post-processing data for events recognition, the LSM303AH embeds a first-in, first-out buffer (FIFO) for each of the three accelerometer output channels, X, Y, and Z.

FIFO use allows consistent power saving for the system, it can wake up only when needed and burst the significant data out from the FIFO.

The FIFO buffer can work according to five different modes that guarantee a high level of flexibility during application development: Bypass mode, FIFO mode, Continuous mode, Bypass-to-Continuous and Continuous-to-FIFO mode.

A programmable watermark level and the FIFO\_FULL event can be enabled to generate dedicated interrupts on the INT1 XL pin.

### 15.1 FIFO description

The FIFO buffer is able to store up to 256 acceleration samples of 14 bits for each channel or store the output of the acceleration module computation up to 768 entries (see *Section 15.4: Module-to-FIFO*); data are stored in the 14-bit 2's complement left-justified representation, which means that they always have to be right-shifted by two.

The data sample set consists of 6 bytes (XI, Xh, YI, Yh, ZI, and Zh) and they are released to the FIFO at the selected output data rate (ODR).

The new sample set is placed in the first empty FIFO slot until the buffer is full, therefore, the oldest value is overwritten.

Table 22. FIFO buffer full representation (256<sup>th</sup> sample set stored)

Output registers	28h	29h	2Ah	2Bh	2Ch	2Dh	
Output registers	ΧI	Xh	YI	Yh	ZI	Zh	
FIFO index	FIFO sample set						
FIFO(0)	XI(0)	Xh(0)	YI(0)	Yh(0)	ZI(0)	Zh(0)	
FIFO(1)	XI(1)	Xh(1)	YI(1)	Yh(1)	ZI(1)	Zh(1)	
FIFO(2)	XI(2)	Xh(2)	YI(2)	Yh(2)	ZI(2)	Zh(2)	
FIFO(3)	XI(3)	Xh(3)	YI(3)	Yh(3)	ZI(3)	Zh(3)	
FIFO(254)	XI(254)	Xh(254)	YI(254)	Yh(254)	ZI(254)	Zh(254)	
FIFO(255)	XI(255)	Xh(255)	YI(255)	Yh(255)	ZI(255)	Zh(255)	

Table 23. FIFO buffer full representation (257<sup>th</sup> sample set stored and 1st sample discarded)

Output registers	28h	29h	2Ah	2Bh	2Ch	2Dh	
Output registers	ΧI	Xh	YI	Yh	ZI	Zh	
FIFO index	Sample set						
FIFO(0)	XI(1)	Xh(1)	YI(1)	Yh(1)	ZI(1)	Zh(1)	
FIFO(1)	XI(2)	Xh(2)	YI(2)	Yh(2)	ZI(2)	Zh(2)	
FIFO(2)	XI(3)	Xh(3)	YI(3)	Yh(3)	ZI(3)	Zh(3)	
FIFO(3)	XI(4)	Xh(4)	YI(4)	Yh(4)	ZI(4)	Zh(4)	
FIFO(255)	XI(256)	Xh(256)	YI(256)	Yh(256)	ZI(256)	Zh(256)	

Table 22: FIFO buffer full representation (256<sup>th</sup> sample set stored) represents the FIFO full status when 256 samples are stored in the buffer while Table 23: FIFO buffer full representation (257<sup>th</sup> sample set stored and 1st sample discarded) represents the next step when the 257th sample is inserted into FIFO and the 1st sample is overwritten. The new oldest sample set is made available in the output registers.

When FIFO is enabled and the mode is different from Bypass, the LSM303AH accelerometer output registers (28h to 2Dh) always contain the oldest FIFO sample set.



### 15.2 FIFO registers

The FIFO buffer is managed by four different accelerometer registers, two of these allow enabling and configuring the FIFO behavior, the other two provide information about the buffer status.

A few other registers are used to route FIFO events on the pin to interrupt the application processor. These are discussed in *Section 15.3: FIFO interrupts*.

#### 15.2.1 FIFO\_CTRL\_A register (25h)

The FIFO\_CTRL\_A register contains the mode at which the FIFO is set. At reset by default the FIFO mode is Bypass which means off; the FIFO gets enabled and starts storing the samples (or the module) as soon as the mode is set to a mode other than Bypass.

b7 h6 h<sub>2</sub> h1 b0 b4 b3 INT2\_ **MODULE** IF CS **STEP** FMODE2 FMODE1 FMODE0 0 0 COUNT\_ TO FIFO PU DIS \_OV

Table 24. FIFO\_CTRL\_A register

The FMODE[2:0] bits select the FIFO buffer behavior:

- 1. FMODE[2:0] = 000b: Bypass mode (FIFO turned off)
- 2. FMODE[2:0] = 001b: FIFO mode
- 3. FMODE[2:0] = 011b: Continuous-to-FIFO mode
- 4. FMODE[2:0] = 100b: Bypass-to-continuous mode
- 5. FMODE[2:0] = 110b: Continuous mode

 $\label{eq:module_TO_FIFO} MODULE\_TO\_FIFO \ enables \ the \ module \ of the \ X/Y/Z \ samples \ (sqrt(x2+y2+z2)) \ to \ go \ in \ FIFO \ instead \ of the \ samples \ themselves. Please note that the MODULE\_ON bit \ of the \ FUNC\_CTRL\_A \ register \ must be \ on. \ When \ the \ MODULE\_ON \ bit \ is set to 1, the \ embedded \ functions \ (pedometer, \ tilt \ and \ significant \ motion) \ are \ not \ available.$ 

#### 15.2.2 FIFO THS A register (2Eh)

This register may be used to set the FIFO threshold level.

Table 25. FIFO\_THS\_A register

b7	b6	b5	b4	b3	b2	b1	b0
FTH7	FTH6	FTH5	FTH4	FTH3	FTH2	FTH1	FTH0

The FTH[7:0] bits define the watermark level; when FIFO content is greater than or equal to this value, the FTH bit is set to 1 in the FIFO\_SRC\_A register.

#### 15.2.3 FIFO\_SRC\_A (2Fh)

This register is updated at every ODR and provides information about the FIFO buffer status.

Table 26. FIFO\_SRC\_A register

b7	b6	b5	b4	b3	b2	b1	b0
FTH	FIFO_ OVR	DIFF8	0	0	0	0	0

- FTH bit is set high when FIFO content exceeds watermark level. This flag can be routed to the pin (see Section 15.3: FIFO interrupts).
- FIFO\_OVR bit is set high when the first sample is overwritten after the FIFO buffer is full. This means that the FIFO buffer contains 256 unread samples. The FIFO\_OVR bit is reset when the first sample set has been read.
- DIFF8 bit (or FIFO\_FULL bit) is used together with bits of FIFO\_SAMPLES (DIFF[7:0]) to provide information of how many FIFO entries are used (000000000b means FIFO empty, 100000000b means FIFO full). This flag can be routed to the pin (see Section 15.3: FIFO interrupts).

The register content is updated synchronous to the FIFO write and read operation.

Table 27. FIFO\_SRC\_A behavior assuming FTH[7:0] = 15

FTH	DIFF8 (FIFO_FULL)	FIFO_OVR	DIFF[8:0]	Unread FIFO samples	Timing
0	0	0	00000000	0	t0
0	0	0	00000001	1	t0 + 1/ODR
0	0	0	00000010	2	t0 + 2/ODR
0	0	0	000001110	14	t0 + 14/ODR
1	0	0	000001111	15	t0 + 15/ODR
1	0	0	011111111	255	t0 + 255/ODR
1	1	0	100000000	256	t0 + 256/ODR
1	1	1	100000000	256	t0 + 257/ODR



#### 15.2.4 FIFO\_SAMPLES\_A (30h)

The content of this register is used together with the DIFF8 bit of the FIFO\_SRC\_A register (DIFF[7:0]) to provide information of how many FIFO entries are used (000000000b means FIFO empty, 100000000b means FIFO full).

Table 28. FIFO\_SAMPLES\_A register

b7	b6	b5	b4	b3	b2	b1	b0
DIFF7	DIFF6	DIFF5	DIFF4	DIFF3	DIFF2	DIFF1	DIFF0

### 15.3 FIFO interrupts

There are two specific FIFO events that can be routed to the pin in order to interrupt the main processor: FIFO threshold and FIFO full.

The third FIFO event, FIFO\_OVR, cannot be routed on the pin, but can instead be polled by reading the corresponding bit in the FIFO\_SRC\_A register.

#### 15.3.1 FIFO threshold

The FIFO threshold is a configurable feature that can be used to generate a specific interrupt in order to know when the FIFO buffer contains at least the number of samples defined as the threshold level. The user can select the desired level in a range from 0 to 255 using the FTH[7:0] field in the FIFO THS A register.

If the number of entries in FIFO (DIFF[8:0]) is greater than or equal to the value programmed in FTH[7:0], the FTH bit is set high in the FIFO\_SRC\_A register.

DIFF[8:0] increases by one step at the ODR frequency and decreases by one step every time that a sample set read is performed by the user.

The threshold flag (FTH) can be routed to the INT1\_XL and INT2\_XL pin to provide a dedicated interrupt for the application processor that can consume less power between each interrupt. The INT1\_FTH bit of CTRL4\_A register and the INT2\_FTH bit of CTRL5\_A register are dedicated to this task.

#### 15.3.2 FIFO full

It is possible to configure the device to generate an interrupt whenever the FIFO gets full. To do so just set the INT1\_FSS7 bit of the WAKE\_UP\_DUR\_A register to '1'. To avoid losing samples, the FIFO read operation must start and complete inside 1 ODR window.

#### 15.4 Module-to-FIFO

If the module computation is on (MODULE\_ON bit of FUNC\_CTRL\_A register is '1') and the MODULE\_TO\_FIFO bit of FIFO\_CTRL\_A is set to '1', then the FIFO buffer will not contain the acceleration samples but instead the computation of their module (sqrt(x2+y2+z2)).

Since the module is a number of 14-bit in size, the FIFO buffer may contain up to 768 module entries (256 \* 3). When the module is stored in FIFO, the threshold set in FIFO\_THS\_A and the number of stored data available in the FIFO\_SAMPLES\_A register are represented by 1LSb = 3 samples.

The following is a simple procedure to enable the FIFO to contain the acceleration sample module:

- 1. Set MODULE\_ON to 1 in FUNC\_CTRL\_A (3Fh) to enable module computation
- 2. Set MODULE\_TO\_FIFO bit of FIFO\_CTRL\_A (25h) to '1' to save module in FIFO buffer
- 3. Enable the FIFO in one of the operative modes (see Section 15.5: FIFO modes)

#### 15.5 FIFO modes

The LSM303AH FIFO buffer can be configured to operate in five different modes selectable by the FMODE[2:0] field in FIFO\_CTRL\_A register. Available configurations ensure a high-level of flexibility and extend the number of functions usable in application development.

Bypass, FIFO, Continuous, Bypass-to-Continuous and Continuous-to-FIFO modes are described in the following paragraphs.

### 15.5.1 Bypass mode

When Bypass mode is enabled, the FIFO is not operational: buffer content is cleared, output registers (0x28 to 0x2D) are frozen at the last value loaded, and the FIFO buffer remains empty until another mode is selected.

Bypass mode is activated by setting the FMODE[2:0] field to 000b in the FIFO\_CTRL\_A register.

Bypass mode must be used in order to stop and reset the FIFO buffer when a different mode is operating. Note that placing the FIFO buffer into Bypass mode clears the whole buffer content.

#### 15.5.2 FIFO mode

In FIFO mode, the buffer continues filling until full (256 sample sets stored). As soon as the FIFO\_OVR flag gets to '1', the FIFO stops collecting data and its content remains unchanged until a different mode is selected.

FIFO mode is activated by setting the FMODE[2:0] field to 001b in the FIFO\_CTRL\_A register.

By selecting this mode, FIFO starts data collection and DIFF[8:0] changes according to the number of samples stored. At the end of the procedure, the FIFO\_OVR flag rises to 1, and data can then be retrieved, performing a 256 sample set read from the output registers. Communication speed is not so important in FIFO mode because data collection is stopped and there is no risk of overwriting acquired data. Before restarting FIFO mode, at the end of the read procedure it is necessary to exit Bypass mode.



In order to serve the FIFO\_FULL event as soon as possible, it is recommended to route it to the pin in order to generate an interrupt, which will then be managed by a specific handler:

- Set INT1\_FSS7 to '1': Enables FIFO\_FULL interrupt
- 2. Set FMODE[2:0] = 001b: Enables FIFO mode

When the FIFO\_FULL interrupt is generated or the FIFO\_OVR bit is high (polling mode):

1. Read data from the accelerometer output registers

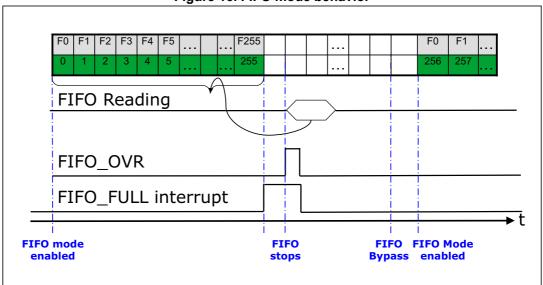


Figure 16. FIFO mode behavior

As indicated in *Figure 16: FIFO mode behavior*, when FIFO mode is enabled, the buffer starts to collect data and fills all 256 slots (from F0 to F255) at the selected output data rate. When the buffer is full, as the next sample comes in and overrides the buffer, the FIFO\_OVR bit goes high and data collection is permanently stopped; the user can decide to read FIFO content at any time because it is maintained unchanged until Bypass mode is selected. The read procedure may be performed inside an interrupt handler triggered by a FIFO\_FULL condition (DIFF8) and it is composed of a 256 sample set of 6 bytes for a total of 1236 bytes and retrieves data starting from the oldest sample stored in FIFO (F0). The FIFO\_OVR bit is reset when the first sample set has been read. The Bypass mode setting resets FIFO and allows the user to enable FIFO mode again.



#### 15.5.3 Continuous mode

In Continuous mode FIFO continues filling, when the buffer is full, the FIFO index restarts from the beginning and older data is replaced by current data. The oldest values continue to be overwritten until a read operation frees FIFO slots. The host processor reading speed is most important in order to free slots faster than new data is made available. FMODE[2:0] in Bypass configuration is used to stop this mode.

Follow these steps for FIFO Continuous configuration which sets a threshold to generate an interrupt to trigger a read by the application processor:

- Set FTH[7:0] to 255.
- 2. Set INT2 FTH to '1': Enable FIFO threshold interrupt
- 3. Activate Continuous mode by setting the FMODE[2:0] field to 110b in the FIFO CTRL A register (25h).

When the FTH interrupt is generated, data is read from the accelerometer output registers.

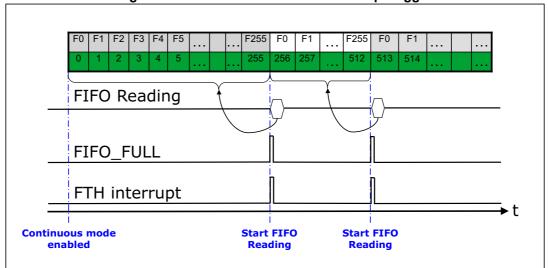


Figure 17. Continuous mode with interrupt trigger

As indicated in *Figure 17*, when Continuous mode is enabled, the FIFO buffer is continuously filling (from F0 to F255) at the selected output data rate. When the buffer is full, the FTH interrupt (as well as the FIFO\_FULL condition indicated by the DIFF8 bit in FIFO\_SRC\_A (2Fh), which might also be used to trigger an interrupt) goes high, and the application processor may read all FIFO samples (256 \* 6 bytes) as soon as possible to avoid loss of data and to limit intervention by the host processor which increases system efficiency. See *Section 15.6: Retrieving data from FIFO* for more details on FIFO reading speed.

When a read command is sent to the device, the content of the output registers is moved to the SPI/I<sup>2</sup>C register and the current oldest FIFO value is shifted into the output registers in order to allow the next read operation.

**577** 

#### 15.5.4 Continuous-to-FIFO mode

This mode is a combination of the Continuous and FIFO modes previously described. In Continuous-to-FIFO mode, the FIFO buffer starts operating in Continuous mode and switches to FIFO mode when the selected interrupt (e.g. wakeup, free-fall, tap, ...) occurs.

This mode can be used in order to analyze the samples history that generate an interrupt; the standard operation is to read FIFO content when FIFO mode is triggered and FIFO buffer is full and stopped.

Follow these steps for Continuous-to-FIFO mode configuration:

- 1. Configure the desired interrupt generator by following the instructions in *Section 14:*Accelerometer interrupt generation and embedded functions (be sure it is latched).
- 2. Activate Continuous-to-FIFO mode by setting the FMODE[2:0] field to 011b in the FIFO\_CTRL\_A register (25h).

Note: When the requested event takes place, the FIFO mode change is triggered if and only if the event flag is routed to the INT1\_XL or INT2\_XL pin.

While in Continuous mode the FIFO buffer continues filling; when the requested event takes place the FIFO mode changes; then, as soon as the buffer becomes full, the FIFO\_OVR bit is set high and the next samples overwrite the oldest and the FIFO stops collecting data (see *Figure 18*).

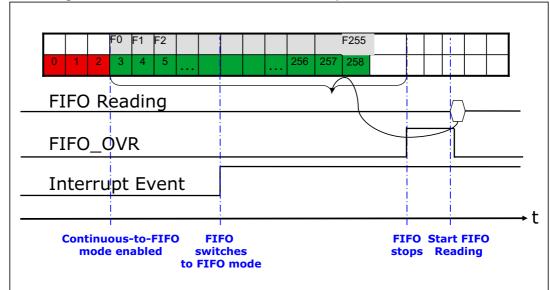


Figure 18. Continuous-to-FIFO mode: interrupt latched and non-latched

#### 15.5.5 Bypass-to-Continuous mode

This mode is a combination of the Bypass and Continuous modes previously described. In Bypass-to-Continuous mode, the FIFO buffer starts in Bypass mode and switches to Continuous mode when the selected interrupt (e.g. wakeup, free-fall, tap, ...) occurs.

Follow these steps for Bypass-to-Continuous mode configuration:

- 1. Configure desired interrupt generator by following the instructions in Section 14: Accelerometer interrupt generation and embedded functions (be sure it is latched).
- 2. Set FTH[7:0] to 255.
- 3. Set INT2 FTH to '1': Enables FIFO threshold interrupt
- 4. Activate Bypass-to-Continuous mode by setting the FMODE[2:0] field to 100b in the FIFO\_CTRL\_A register (25h).

When the FTH interrupt is generated, data is read from the accelerometer output registers.

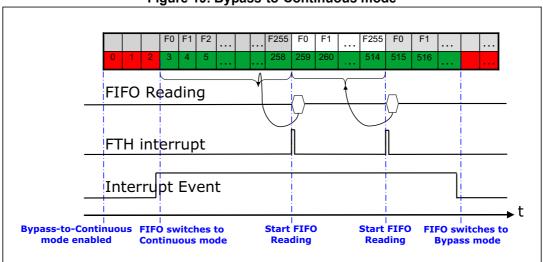


Figure 19. Bypass-to-Continuous mode

As indicated in *Figure 19*, the FIFO is initially in Bypass mode, so no samples enter in the FIFO buffer. As soon as an event occurs (e.g. a wakeup or a free-fall event) the FIFO switches to Continuous mode and starts to store the samples at the configured data rate. When the programmed threshold is reached, the FTH interrupt goes high, and the application processor may start reading all FIFO samples (256 \* 6 bytes) as soon as possible to avoid loss of data.

If the FIFO\_OVR flag was set, it will go to 0 as soon as the first FIFO set is read, creating space for new data. Since the FIFO is still in Continuous mode, the FIFO eventually reaches the threshold again and the situation repeats.

Finally, either the interrupt event is cleared or the FIFO enters directly Bypass mode and then it stops collecting data.



### 15.6 Retrieving data from FIFO

When the FIFO mode is different from Bypass, reading the output registers (28h to 2Dh) returns the oldest FIFO sample set.

Whenever the output registers are read, their content is moved to the SPI/I<sup>2</sup>C output buffer. FIFO slots are ideally shifted up one level in order to release room for receiving a new sample and the output registers load the current oldest value stored in the FIFO buffer.

The whole FIFO content is retrieved by performing 256 read operations from the accelerometer output registers. The size of the data stored in FIFO is always 14-bit regardless of the power mode. Every other read operation returns the same last value until a new sample set is available in the FIFO buffer.

Data can be retrieved from FIFO using every read byte combination in order to increase application flexibility (ex: 1536 single byte read, 256 reads of 6 bytes, 1 multiple read of 1536 bytes, etc.).

It is recommended to read all FIFO slots in a multiple byte read of 1536 bytes (6 output registers by 256 slots). In order to minimize communication between the master and slave the read address may be automatically incremented by the device by setting the IF\_ADD\_INC bit of CTRL2\_A register to '1'; the device rolls back to 0x28 when register 0x2D is reached.

The I<sup>2</sup>C speed is lower than SPI and it needs about 29 clock pulses to start communication (Start, Slave Address, Register Address+Write, Restart, Register Address+Read) plus an additional 9 clock pulses for every byte to read (total of 83 clock pulses). So, in the case of standard I<sup>2</sup>C mode being used (max rate 100 kHz), a single sample set read takes 830 µs while total FIFO download takes about 138.53 ms (29 + 9 \* 1536 clock pulses).

In the case of the SPI, instead, 9 clock pulses are required only once at the very beginning to get started (r/w + Register Address) plus additional 8 clock pulses for every byte to read. With a 2 MHz clock a single sample set read would take 28.5  $\mu$ s, while total FIFO download takes about 6.15 ms.

If this recommendation were followed, using a standard I $^2$ C (100 kHz) the complete FIFO read (138.53 ms) would take 14/ODR with ODR at 100 Hz. Using a SPI @2 MHz (10 MHz is the maximum supported by the device) the complete FIFO read would take 1/ODR with ODR at 100 Hz.

So, in order to not lose samples, the application will read samples before the FIFO becomes full, setting a threshold and using the FTH interrupt (see Section 15.3: FIFO interrupts).

ODR (Hz)	FTH_THS (I <sup>2</sup> C @ 100 kHz)	FTH_THS (I <sup>2</sup> C @ 400 kHz)	FTH_THS (SPI @ 2 MHz)
50	36	147	256
100	17	73	256
200	8	36	208
400	4	17	103
800	1	8	51
1600	-	4	25

Table 29. Example: threshold function of ODR

Accelerometer self-test AN5087

### 16 Accelerometer self-test

When the accelerometer self-test is enabled, an actuation force is applied to the sensor, leading to a deflection of the moveable part of the sensor and generates an acceleration. In this case the sensor outputs exhibit a change in their DC levels which are related to the selected full scale through the sensitivity value.

The accelerometer self-test function is off when the ST[2:1] bits of the CTRL3\_A register are programmed to 00b; it is enabled when the ST[2:1] bits are set to 01b (positive sign self-test) or 10b (negative sign self-test).

When the accelerometer self-test is activated, the sensor output level is given by the algebraic sum of the signals produced by the acceleration acting on the sensor and by the electrostatic test-force.

The procedure consists of:

- 1. enabling the accelerometer
- 2. averaging five samples before enabling the self-test
- 3. averaging five samples after enabling the self-test
- 4. computing the difference in module for each axis and verify it falls in a given range. The min and max value are provided in the datasheet.

The complete accelerometer self-test procedure is indicated in *Figure 20*.

Note: Keep the device still during the self-test procedure.





Figure 20. Accelerometer self-test procedure

```
* Initialize Sensor:
 * Set BDU=1, FS=2G, ODR = 50Hz
                                                                  /* Read/discard first set of samples AFTER Self-Test */
                                                                  Check DRDY in STATUS A (27h)
Write 31h to CTRL1 A (20h)
                                                                  Read OUTX (28h/29h), OUTY (2Ah/2Bh), OUTZ (2Ch/2Dh)
Wait 200 ms for stable output
                                                                  → Discard data
/* Read/discard first set of samples BEFORE Self-Test */
                                                                  /* Read five sets of samples AFTER enabling Self-Test */
Check DRDY in STATUS A (27h)
                                                                  Loop 5 times {
Read OUTX (28h/29h), OUTY (2Ah/2Bh), OUTZ (2Ch/2Dh)
                                                                    Check DRDY in STATUS A (27h)
→ Discard data
                                                                    Read OUTX (28h/29h), OUTY (2Ah/2Bh), OUTZ (2Ch/2Dh)
/* Read five sets of samples BEFORE enabling Self-Test */
                                                                  /* Calculate average of the 5 reads for each axis */
Loop 5 times {
                                                                  OUTX AVG ST
 Check DRDY in STATUS_A (27h)
                                                                  OUTY AVG ST
 Read OUTX (28h/29h), OUTY (2Ah/2Bh), OUTZ (2Ch/2Dh)
                                                                  OUTZ AVG ST
/* Calculate average of the 5 reads for each axis */
OUTX_AVG_NO_ST
                                                                   |Min(ST_X)| <=|OUTX_AVG_ST - OUTX_AVG_NO_ST| <= |Max(ST_X)|
OUTY_AVG_NO_ST
                                                                                              AND
OUTZ_AVG_NO_ST
                                                                   |Min(ST_Y)<=| OUTY_AVG_ST - OUTY_AVG_NO_ST | <= |Max(ST_Y)|
                                                                                              AND
                                                                  |Min(ST_Z)| <= | OUTZ_AVG_ST - OUTZ_AVG_NO_ST | <= |MAX(ST_Z)|
/* Enable positive-sign Self-Test */
Write 01h to ST[2:1] of CTRL3_A (22h)
                                                                           YES (PASS)
                                                                                                        NO (FAIL)
Wait 200 ms for stable output
                                                                  Write 00h to CTRL1_A (20h): /* Disable sensor */
                                                                  Write 00h to CTRL3_A (22h): /* Disable self-test */
```

Temperature sensor AN5087

### 17 Temperature sensor

The LSM303AH is provided with an internal temperature sensor that is suitable for ambient temperature measurement.

If the accelerometer sensor is in power-down mode, the temperature sensor is off and is showing the last value measured.

The output data rate of temperature sensor is fixed at 12.5 Hz.

The temperature data is given by the OUT\_T\_A register and it is represented as a number of 8 bits in two's complement format, with a sensitivity of +1 LSB/ $^{\circ}$ C. The output zero level corresponds to 25  $^{\circ}$ C ±15  $^{\circ}$ C.

### 17.1 Example of temperature data calculation

Table 30: Output data registers content vs. temperature provides a few basic examples of the data that is read from the temperature data registers at different ambient temperature values. The values listed in this table are given under the hypothesis of perfect device calibration (i.e. no offset, no gain error,....).

Table 30. Output data registers content vs. temperature

Temperature values	OUT_T_A (26h)
23 °C	FEh
24 °C	FFh
25 °C	00h
27 °C	02h

AN5087 Revision history

# 18 Revision history

Table 31. Document revision history

Date	Revision	Changes
19-Jan-2018	1	Initial release

#### IMPORTANT NOTICE - PLEASE READ CAREFULLY

STMicroelectronics NV and its subsidiaries ("ST") reserve the right to make changes, corrections, enhancements, modifications, and improvements to ST products and/or to this document at any time without notice. Purchasers should obtain the latest relevant information on ST products before placing orders. ST products are sold pursuant to ST's terms and conditions of sale in place at the time of order acknowledgement.

Purchasers are solely responsible for the choice, selection, and use of ST products and ST assumes no liability for application assistance or the design of Purchasers' products.

No license, express or implied, to any intellectual property right is granted by ST herein.

Resale of ST products with provisions different from the information set forth herein shall void any warranty granted by ST for such product.

ST and the ST logo are trademarks of ST. All other product or service names are the property of their respective owners.

Information in this document supersedes and replaces information previously supplied in any prior versions of this document.

© 2018 STMicroelectronics – All rights reserved

